

Tabla de Contenido

1A. Introducción	11
Paso 1 - Info Guía	12
Paso 2 - How to navigate through the manual	12
Paso 3 - View high resolution images	13
Paso 4 - Compatibilidad	13
Paso 5 - Importante: Protección de la electrónica	14
Paso 6 - Guía por etiquetas	15
Paso 7 - Bolsa de piezas extra	15
Paso 8 - We are here for you!	16
Paso 9 - Pro tip: inserting the nuts	17
Paso 10 - Distribuidor Lubricación Rodamientos	18
Paso 11 - Prepara tu escritorio	18
1B. Inspección MK4S	19
Paso 1 - Introducción	20
Paso 2 - Actualización de Firmware	20
Paso 3 - Preparación de la Impresora 2	21
Paso 4 - Preparación de la Impresora 2	21
Paso 5 - Preparación Impresora 3	22
Paso 6 - Inspección de la base calefactable	22
Paso 7 - Inspección Y-Rods	23
Paso 8 - Haribo?	23
Paso 9 - Cómo Empezar	24
1C. Desmontaje de la Impresora	25
Paso 1 - Herramientas Necesarias	26
Paso 2 - Desmontaje Electrónica	26
Paso 3 - Desmontaje Wi-Fi	27
Paso 4 - Desmontaje Haz de cables	27
Paso 5 - Desconexión Cables 1	28
Paso 6 - Desconexión Cables 2	28
Paso 7 - Liberación Haz de Cables	29
Paso 8 - Extracción xLCD	29
Paso 9 - Desmontaje Tensor Y	30
Paso 10 - Extracción Polea Tensora	30
Paso 11 - Extracción Motor Y	31
Paso 12 - Power Panic Cable Removal	31
Paso 13 - Retirando el Cable Alimentación	32
Paso 14 - Extracción Fuente Alimentación 1	32
Paso 15 - Extracción Fuente Alimentación 2	33
Paso 16 - Extracción Base Calefactable	33
Paso 17 - Extracción Eje Y	34
Paso 18 - Desmontaje Eje Y	34
Paso 19 - Extracción Rodamientos	35
Paso 20 - Desmontaje Junta de Expansión	35
Paso 21 - Extracción Cubierta Extrusor	35
Paso 22 - Extracción Conjunto Hotend	36
Paso 23 - Extracción Ventilador de Impresión	36
Paso 24 - Extracción Ventilador Disipador	37
Paso 25 - Extracción Nextruder	37
Paso 26 - Extracción LoveBoard	38
Paso 27 - Extracción Motores Z	38

Paso 28 - Z Motors Removal 2	39
Paso 29 - Z Motors Removal 3	39
Paso 30 - Extracción Varillas Z	40
Paso 31 - Extracción Tuerca Trapezoidal	40
Paso 32 - Extracción Motor X	41
Paso 33 - Extracción Correa X	41
Paso 34 - Extracción Motor X	42
Paso 35 - X Idler Shaft Removal	42
Paso 36 - Desmontaje Tensor X	43
Paso 37 - Extracción xBuddy	43
1D. Preparación componentes	44
Paso 1 - Herramientas Necesarias	45
Paso 2 - Desmontaje Electrónica	45
Paso 3 - Desmontaje Wi-Fi	46
Paso 4 - Desmontaje Haz de cables	46
Paso 5 - Desconexión Cables 1	47
Paso 6 - Desconexión Cables 2	47
Paso 7 - Liberación Haz de Cables	48
Paso 8 - Extracción xLCD	48
Paso 9 - Desmontaje Tensor Y	49
Paso 10 - Extracción Polea Tensora	49
Paso 11 - Extracción Motor Y	50
Paso 12 - Power Panic Cable Removal	50
Paso 13 - Retirando el Cable Alimentación	51
Paso 14 - Extracción Fuente Alimentación 1	51
Paso 15 - Extracción Fuente Alimentación 2	52
Paso 16 - Extracción Base Calefactable	52
Paso 17 - Extracción Eje Y	53
Paso 18 - Desmontaje Eje Y	53
Paso 19 - Extracción Rodamientos	54
Paso 20 - Desmontaje Junta de Expansión	54
Paso 21 - Extracción Cubierta Extruder	54
Paso 22 - Extracción Conjunto Hotend	55
Paso 23 - Extracción Ventilador de Impresión	55
Paso 24 - Extracción Ventilador Disipador	56
Paso 25 - Extracción Nextruder	56
Paso 26 - Extracción LoveBoard	57
Paso 27 - Extracción Motores Z	57
Paso 28 - Z Motors Removal 2	58
Paso 29 - Z Motors Removal 3	58
Paso 30 - Extracción Varillas Z	59
Paso 31 - Extracción Tuerca Trapezoidal	59
Paso 32 - Extracción Motor X	60
Paso 33 - Extracción Correa X	60
Paso 34 - Extracción Motor X	61
Paso 35 - X Idler Shaft Removal	61
Paso 36 - Desmontaje Tensor X	62
Paso 37 - Extracción xBuddy	62
2. Montaje de la base	63
Paso 1 - Tools necessary for this chapter	64
Paso 2 - Base assembly: parts preparation	64
Paso 3 - Inserting the zip ties	65
Paso 4 - Base assembly: parts preparation	65
Paso 5 - Installing the motor mounts	66

Paso 6 - Installing the rear motor	66
Paso 7 - Securing the rear motor	67
Paso 8 - Installing the front motor right	67
Paso 9 - Installing the front motor left	68
Paso 10 - Bottom frame: parts preparation	68
Paso 11 - Assembling the bottom profile: front + left	69
Paso 12 - Assembling the bottom profile: left + rear	69
Paso 13 - Assembling the bottom profile: right	70
Paso 14 - Inserting the spacer pins	70
Paso 15 - Anti-vibration feet: parts preparation	71
Paso 16 - Installing the anti-vibration feet	71
Paso 17 - Installing the bottom frame	72
Paso 18 - Mounting the bottom frame: right side	72
Paso 19 - Mounting the bottom frame: rear + left + front	73
Paso 20 - Momento Haribo	73
Paso 21 - Listo	74
3. Montaje trasera	75
Paso 1 - Herramientas necesarias para este capitulo	76
Paso 2 - xBuddy: preparación de piezas I.	76
Paso 3 - xBuddy: preparación de piezas II.	77
Paso 4 - Applying the thermal pads	77
Paso 5 - Installing the xBuddy	78
Paso 6 - Installing the xBuddy extension	78
Paso 7 - Instalando las bridas	79
Paso 8 - Connecting the xBuddy extension board	79
Paso 9 - Inserting grommets: xBuddy box	80
Paso 10 - Wi-Fi: parts preparation	80
Paso 11 - Assembling the Wi-Fi	81
Paso 12 - Installing the Wi-Fi assembly	81
Paso 13 - PSU assembly: parts preparation	82
Paso 14 - Preparing the PSU	82
Paso 15 - Power cables info	83
Paso 16 - Conectando la fuente de alimentación	84
Paso 17 - Back panel: parts preparation	84
Paso 18 - Installing grommets: back panel top	85
Paso 19 - Installing grommets: sides	85
Paso 20 - Aligning the PSU	86
Paso 21 - Mounting the PSU	86
Paso 22 - Aligning the xBuddy box assembly	87
Paso 23 - Mounting the xBuddy box	87
Paso 24 - PSU-cable-cover: preparación de las piezas	88
Paso 25 - Preparing the PSU-cable-cover	88
Paso 26 - PSU-cable-cover installation	89
Paso 27 - Chamber fans: parts preparation	89
Paso 28 - Assembling the fan grid	90
Paso 29 - Colocando los ventiladores	91
Paso 30 - Covering the cooling fans	91
Paso 31 - Rear profiles: parts preparation	92
Paso 32 - Installing the rear profiles	92
Paso 33 - Mounting the back panel	93
Paso 34 - Securing the Back panel	93
Paso 35 - Power Terminal Screws Preparation	94
Paso 36 - Connecting the power cables	94
Paso 37 - Stepper splitter: parts preparation	95

Paso 38 - Guiding the Stepper splitter cable	95
Paso 39 - Connecting the Stepper splitter	96
Paso 40 - Mounting the Stepper Splitter	96
Paso 41 - LCD cable: parts preparation	97
Paso 42 - Guiding the LCD cable	97
Paso 43 - Main FE cable INFO	98
Paso 44 - Connecting the FE cable (no 3.)	98
Paso 45 - Guiding the FE cable (no. 2)	99
Paso 46 - Guiding the FE cable (no. 1)	99
Paso 47 - Guiding the FE cable (no. 4 and 5)	100
Paso 48 - Cable Bundle Cleanup	100
Paso 49 - FE cable - xBuddy: parts preparation	101
Paso 50 - Connecting the FE cable: xBuddy	101
Paso 51 - Plugging the xLCD cable	102
Paso 52 - PSU-cover: parts preparation	102
Paso 53 - Connecting the FE cable: PSU	103
Paso 54 - Momento Haribo	103
Paso 55 - Listo	104
4. Heatbed assembly	105
Paso 1 - Tools necessary for this chapter	106
Paso 2 - Heatbed: parts preparation	107
Paso 3 - Heatbed Cable Assembly 1	107
Paso 4 - Heatbed Cable Assembly 2	108
Paso 5 - Bed-cable-cover-bottom: parts preparation	108
Paso 6 - Attaching the cable cover	109
Paso 7 - Heatbed carriage: parts preparation	109
Paso 8 - Preparing the heatbed carriage	110
Paso 9 - Installing the expansion joints	110
Paso 10 - RGB LED strip: parts preparation	111
Paso 11 - Installing the LED strip	111
Paso 12 - Attaching the LED strip diffuser	112
Paso 13 - Covering the RGB LED strip	112
Paso 14 - Guiding the RGB LED strip cable	113
Paso 15 - Bearing Lubrication Preparation	113
Paso 16 - Bearing Lubrication	114
Paso 17 - Bed mounts: parts preparation	114
Paso 18 - Assembling the bed mounts	115
Paso 19 - Securing the bed mounts	115
Paso 20 - Bed mounts: inserting the nuts	116
Paso 21 - Assembling the CORE-One-bed-spacer-rear	116
Paso 22 - Installing the bed-mount-right	116
Paso 23 - Installing the bed-mount-left	117
Paso 24 - Mounting the heatbed: parts preparation	117
Paso 25 - Mounting the heatbed	118
Paso 26 - Tightening the heatbed	118
Paso 27 - Covering the cables: parts preparation	119
Paso 28 - Guiding the heatbed cables	119
Paso 29 - Covering the heatbed cables	120
Paso 30 - Mounting the heatbed: parts preparation	120
Paso 31 - Attaching the heatbed assembly	121
Paso 32 - Mounting the heatbed assembly: rear motor	122
Paso 33 - Mounting the heatbed assembly: front motor left	122
Paso 34 - Mounting the heatbed assembly: front motor right	123
Paso 35 - Attaching the heatbed cables l.	123

Paso 36 - Attaching the heatbed cables II.	124
Paso 37 - Securing the heatbed cables: parts preparation	124
Paso 38 - Securing the textile sleeve	125
Paso 39 - Guiding the heatbed assembly cables	125
Paso 40 - Connecting the heatbed power cables	126
Paso 41 - Haribo time	126
5. CoreXY assembly	127
Paso 1 - Tools necessary for this chapter	128
Paso 2 - Rod holders: parts preparation	128
Paso 3 - Assembling the rod holders	129
Paso 4 - Preparing the front rod holders	129
Paso 5 - Installing the front rod holders	130
Paso 6 - XY carriage: parts preparation	130
Paso 7 - Assembling the XY-carriages	131
Paso 8 - Assembling the linear holder left	131
Paso 9 - Assembling the linear holder right	132
Paso 10 - Attaching the linear holder assemblies	132
Paso 11 - Smooth rods INFO	133
Paso 12 - Mounting the smooth rods	133
Paso 13 - Securing the rear rod holders	134
Paso 14 - Securing the front rod holders	134
Paso 15 - Motor mounts: parts preparation	135
Paso 16 - Motor mounts: part preparation	135
Paso 17 - Assembling the XY-motor-mount-right I.	136
Paso 18 - Assembling the XY-motor-mount-right II.	136
Paso 19 - Assembling the XY-motor-mount-left I.	137
Paso 20 - Assembling the XY-motor-mount-left II.	137
Paso 21 - Belt tensioners: parts preparation I.	138
Paso 22 - Belt tensioners: parts preparation II.	138
Paso 23 - Preparing the tensioner pulleys	139
Paso 24 - Assembling the belt tensioner left I.	139
Paso 25 - Assembling the belt tensioner left II.	140
Paso 26 - Montaje del tensor derecho de la correa	140
Paso 27 - Instalando los tensores de las correas: preparación de las piezas	141
Paso 28 - Installing the motor mount left	141
Paso 29 - Installing the motor mount right	142
Paso 30 - Installing the belt-tensioner-left	142
Paso 31 - Installing the belt-tensioner-right	143
Paso 32 - Guías lineales: preparación de las piezas	143
Paso 33 - Colocando la guía lineal	144
Paso 34 - Securing the linear rail	144
Paso 35 - Installing the linear rail: parts preparation	145
Paso 36 - Installing the linear rail assembly	145
Paso 37 - Linear rail: removing the safety pins	146
Paso 38 - Bed-stop: parts preparation	146
Paso 39 - Assembling the bed-stop	146
Paso 40 - Mounting the bed-stop	147
Paso 41 - X&Y motors: parts preparation	147
Paso 42 - Instalando la polea del eje X	148
Paso 43 - Installing the Y-axis pulley	149
Paso 44 - XY belts: parts preparation	150
Paso 45 - XY belts INFO	150
Paso 46 - Y belt guiding: Y motor pulley	151
Paso 47 - Securing the Y-axis motor	151

Paso 48 - Y belt guiding: Y motor mount	152
Paso 49 - Y belt guiding: belt tensioner	152
Paso 50 - Y belt guiding: X motor mount	153
Paso 51 - Y belt guiding: securing the belt	153
Paso 52 - X belt guiding: X motor pulley	154
Paso 53 - Securing the X-axis motor	154
Paso 54 - Y belt guiding: X motor mount	155
Paso 55 - X belt guiding: belt tensioner	155
Paso 56 - X belt guiding: Y motor mount	156
Paso 57 - X belt guiding: securing the belt	156
Paso 58 - Checking the belt guidance	157
Paso 59 - Bowden guide: parts preparation	157
Paso 60 - Securing the Nextruder holder	158
Paso 61 - Securing the Y motor cable	158
Paso 62 - Securing the X motor cable	159
Paso 63 - Installing the bowden guide	159
Paso 64 - White LED strip: parts preparation	160
Paso 65 - Sticking the White LED strip	160
Paso 66 - Installing the white LED assembly	161
Paso 67 - Door sensor & White LED strip: parts preparation	161
Paso 68 - Inserting the zip ties	162
Paso 69 - Installing the door sensor	162
Paso 70 - Securing the door sensor cable	163
Paso 71 - Guiding the cables: LED and door sensor	163
Paso 72 - Smooth rods: parts preparation	164
Paso 73 - Installing the CoreXY assembly	164
Paso 74 - Securing the smooth rods	165
Paso 75 - Aligning the linear rail	165
Paso 76 - Guiding the corexy cables	166
Paso 77 - Guiding the cooling fan cables	166
Paso 78 - Fixing the bed-stop	167
Paso 79 - Connecting the cooling fans cables	167
Paso 80 - Connecting the corexy cables	168
Paso 81 - Haribo time	168
Paso 82 - Done	169
6. Nextruder assembly	170
Paso 1 - Tool necessary for this chapter	171
Paso 2 - Nextruder idler assembly: parts preparation	171
Paso 3 - Assembling the extruder idler	172
Paso 4 - Assembling the extruder: parts preparation I.	172
Paso 5 - Assembling the extruder: parts preparation II.	173
Paso 6 - Assembling the extruder	173
Paso 7 - Assembling the gearbox	174
Paso 8 - Assembling the PG-ring	175
Paso 9 - Assembling the PG-assembly	175
Paso 10 - Checking the PG-assembly	176
Paso 11 - Assembling the Nextruder idler	176
Paso 12 - Gear lubrication: parts preparation	177
Paso 13 - Lubricating the gear	177
Paso 14 - Covering the planetary gear	178
Paso 15 - Assembling the Idler-swivel: parts preparation	178
Paso 16 - Assembling the Idler-swivel	179
Paso 17 - Assembling the Idler-nut	179
Paso 18 - Mounting the Idler-swivel assembly	180

Paso 19 - NTC thermistor: parts preparation	180
Paso 20 - Assembling the NTC thermistor	181
Paso 21 - Mounting the Nextruder: parts preparation	181
Paso 22 - Protecting the heatbed	182
Paso 23 - Mounting the Nextruder	182
Paso 24 - Hotend fan: parts preparation	183
Paso 25 - Installing the Hotend fan	183
Paso 26 - Guiding the Hotend fan cables	184
Paso 27 - LoveBoard: parts preparation I.	184
Paso 28 - LoveBoard: parts preparation II.	185
Paso 29 - Assembling the Loveboard-mount	185
Paso 30 - Assembling the Printhead-cover	186
Paso 31 - Assembling the LoveBoard	186
Paso 32 - Guiding the main cable	187
Paso 33 - Covering the LoveBoard	187
Paso 34 - Swingarm: parts preparation I.	188
Paso 35 - Swingarm: parts preparation II.	188
Paso 36 - Guiding the main cable	189
Paso 37 - Mounting the main cable	189
Paso 38 - Attaching the LoveBoard assembly	190
Paso 39 - Mounting the swingarm	190
Paso 40 - Attaching the main cable	191
Paso 41 - Inserting the PTFE tube	191
Paso 42 - Securing the PTFE tube	192
Paso 43 - Checking the movement	192
Paso 44 - Print fan: parts preparation	193
Paso 45 - Assembling the fan-shroud	193
Paso 46 - Installing the print fan assembly	194
Paso 47 - Hotend: parts preparation	194
Paso 48 - Installing the hotend	195
Paso 49 - Connecting the heatsink cables	195
Paso 50 - Connecting the hotend cables	196
Paso 51 - Connecting the print fan cable	196
Paso 52 - Connect E-motor cable	196
Paso 53 - LoveBoard covers: parts preparation	197
Paso 54 - Covering the LoveBoard	197
Paso 55 - LoveBoard: Wiring check	198
Paso 56 - Guiding the main cable	198
Paso 57 - Haribo time	199
Paso 58 - Done	199
7. Bodywork & Electronics	200
Paso 1 - Tools necessary for this chapter	201
Paso 2 - Front profiles: parts preparation	201
Paso 3 - Installing the front right profile	202
Paso 4 - Installing the front left profile	202
Paso 5 - Top profiles: parts preparation	203
Paso 6 - Assembling the top profiles I.	203
Paso 7 - Assembling the top profiles II.	204
Paso 8 - Aligning the top profiles	204
Paso 9 - Installing the top profiles	205
Paso 10 - CoreXY fixing screws: parts preparation	205
Paso 11 - Fixing the CoreXY assembly	206
Paso 12 - Side sensor base: parts preparation	206
Paso 13 - Assembling the side sensor base	207

Paso 14 - Probando la palanca	207
Paso 15 - Montaje del interruptor	208
Paso 16 - IR Sensor: parts preparation	208
Paso 17 - Connecting the IR sensor	209
Paso 18 - Installing the IR sensor	209
Paso 19 - Installing the side sensor cover	210
Paso 20 - Side filament sensor: parts preparation	210
Paso 21 - Installing the side filament sensor	211
Paso 22 - Guide the filament sensor cable	211
Paso 23 - Connecting the side filament sensor	212
Paso 24 - NFC Antenna: parts preparation	212
Paso 25 - Applying the adhesive film	213
Paso 26 - Installing the NFC Coil	213
Paso 27 - Connecting the NFC Coil	214
Paso 28 - Comprobación del cableado	214
Paso 29 - Preparing the electronics cover	215
Paso 30 - Installing the electronics cover	215
Paso 31 - Nota Cámara Buddy3D	216
Paso 32 - xBuddy cover: parts preparation	216
Paso 33 - Installing the xBuddy cover	217
Paso 34 - Installing the rear cover	217
Paso 35 - Right side: parts preparation	218
Paso 36 - Installing the spoolholder puck	218
Paso 37 - Right handle: parts preparation	219
Paso 38 - Instalando la presilla	219
Paso 39 - Montando el asa	220
Paso 40 - Fixing the right side	220
Paso 41 - Left side: parts preparation	221
Paso 42 - Installing the left side	221
Paso 43 - Momento Haribo	222
Paso 44 - Listo	222
8. Trim, Door & xLCD	223
Paso 1 - Tools necessary for this chapter	224
Paso 2 - Top cover: parts preparation	224
Paso 3 - Retirando la película	225
Paso 4 - Test-fitting the top cover	225
Paso 5 - Assembling the top cover I.	226
Paso 6 - Assembling the top cover II.	226
Paso 7 - Probando la ventilación	227
Paso 8 - Installing the top cover	227
Paso 9 - Side covers: parts preparation	228
Paso 10 - Retirando la película	228
Paso 11 - Covering the left side	229
Paso 12 - Covering the right side	229
Paso 13 - xLCD: preparación de las piezas	230
Paso 14 - Assembling the xLCD I.	230
Paso 15 - Assembling the xLCD II.	231
Paso 16 - Installing the FE Faston connector	231
Paso 17 - Installing the LCD knob	232
Paso 18 - xLCD bezel: parts preparation	232
Paso 19 - Mounting the xLCD I.	233
Paso 20 - Mounting the xLCD II.	233
Paso 21 - Installing the xLCD assembly	234
Paso 22 - Securing the xLCD assembly	234

Paso 23 - Door seal: parts preparation	235
Paso 24 - Attaching the top seal	235
Paso 25 - Attaching the side seals	236
Paso 26 - Magnet holders: parts preparation	236
Paso 27 - Assembling the magnet holders	237
Paso 28 - Installing the magnet holders	237
Paso 29 - Bisagras: preparación de las piezas	238
Paso 30 - Installing the door-hinge-in parts	238
Paso 31 - Installing the door-hinge-out I.	239
Paso 32 - Installing the door-hinge-out II.	239
Paso 33 - Door panel: parts preparation	240
Paso 34 - Door panel: removing the protective film	240
Paso 35 - Instalando el panel de la puerta	241
Paso 36 - Assembling the door handle	241
Paso 37 - Securing the door handle	242
Paso 38 - Colocando la pegatina: preparación de las piezas	242
Paso 39 - Colocando la pegatina	243
Paso 40 - Momento Haribo	243
Paso 41 - Hecho	244
9. Calibration & First run	245
Paso 1 - Tensado de la correa	246
Paso 2 - Instalando el porta bobinas: preparación de las piezas	246
Paso 3 - Colocando la lámina de impresión y el porta bobinas	247
Paso 4 - Descarga del firmware	247
Paso 5 - Encendiendo la impresora	248
Paso 6 - Setting up the printer: Intro	248
Paso 7 - Setting up the printer: Network setup	249
Paso 8 - Asistente: Intro	249
Paso 9 - Wizard: Door Sensor Calibration	250
Paso 10 - Asistente: Test Célula de carga	250
Paso 11 - Asistente: Alineación de los engranajes	251
Paso 12 - Wizard: Filament Sensor Calibration	251
Paso 13 - Asistente finalizado	252
Paso 14 - Setting the printer up	252
Paso 15 - Momento Haribo	253
Paso 16 - Manual	253
Paso 17 - Actualización de firmware	254
Paso 18 - Base de conocimientos Prusa	254
Paso 19 - ¡Únete a Printables!	255
Lista de cambios del manual	256
Paso 1 - Historial de versiones	257

1A. Introducción




PASO 1 Info Guía



- Bienvenido a la guía sobre cómo convertir tu Original **Prusa MK4S** a **CORE One+**.
- Please prepare the upgrade kit received from Prusa Research.
- En la primera parte de la guía, comprobaremos los componentes clave de tu impresora MK4S, seguidos del desmontaje de la impresora.


A continuación, retocaremos algunas piezas y, por último, podrás comenzar el proceso de montaje de la CORE One+.

PASO 2 How to navigate through the manual

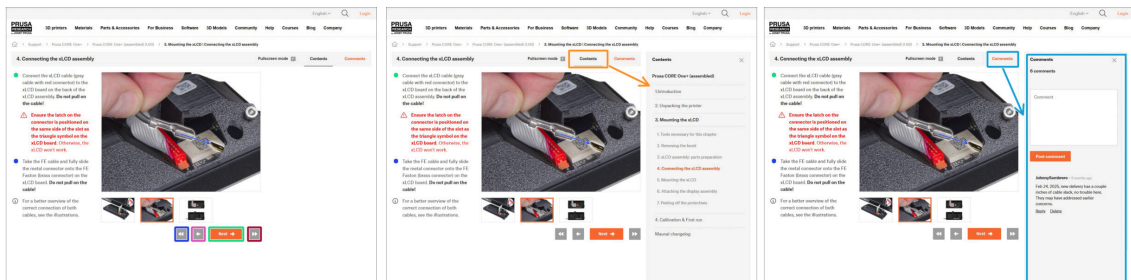


- Use the graphical navigation buttons in the bottom right corner or the arrow keys on your keyboard:
- **Next button / Right arrow key** - Moves to the next image, or to the next step if it's the last image in the step.
- **Left arrow button / Left arrow key** - Moves to the previous image, or to the previous step if it's the first image in the step.
- **Play backward button / Up arrow key** - Moves to the previous step.
- **Play forward (Next) button / Down arrow key** - Moves to the next step.
- Click on **Contents** to expand the full list of steps in this guide. This allows you to jump to any step regardless of the sequence.
- Click on **Comments** to open the discussion for a specific step and leave your feedback.

PASO 3 View high resolution images

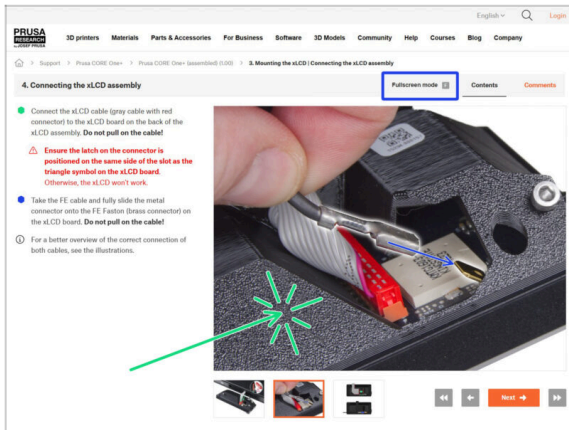

- When you browse the guide on help.prusa3d.com, you can view the original images in high resolution for clarity.
- Just click on the image to open it in high resolution for a detailed view.
- Click on **Fullscreen mode** or press the F key to maximize your screen space and focus entirely on the instructions.

PASO 4 Compatibilidad

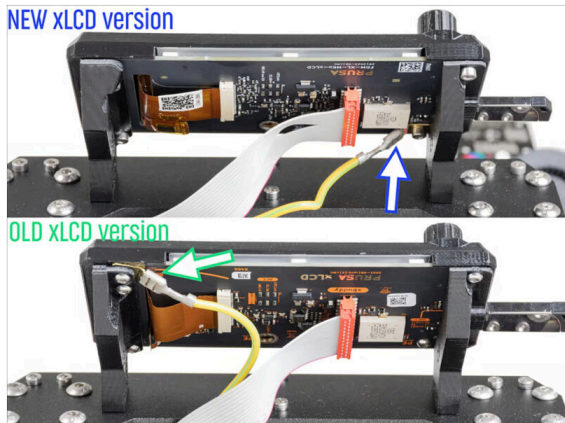

⚠ La única opción de conversión a CORE One+ es desde la **MK4S**.

Si tienes un modelo de impresora más antiguo, primero debes actualizarlo a MK4S y, a continuación, proceder con la conversión a CORE One+.


i There are two versions of the conversion package, depending on the xLCD version used in your MK4S printer.

⚠ The silver PSU is not compatible with the conversion kit.

If you have this PSU version, you will need to purchase a compatible one.

■ Para obtener información, consulta las notas de compatibilidad de la [página de la tienda de la Conversión a CORE One+](#).


PASO 5 Importante: Protección de la electrónica

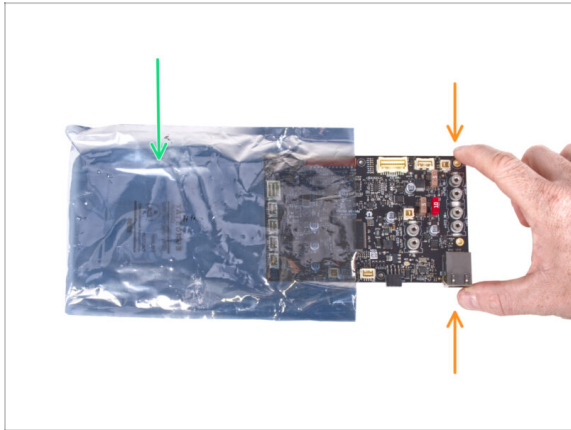


⚠ WARNING: Make sure to **protect the electronics against electrostatic discharge (ESD)**. When possible, always unpack the electronics right before you need them.

Here are some tips to prevent damage to the electronics:

- **Keep the electronics inside an ESD-safe bag** right until you are asked to install them.
- **Always touch the sides of the board only** while handling it. Avoid touching the components on the surface.
- **Before you touch the electronics** use any grounded conductive (metal) structure nearby to neutralize the possible static charge from your hands.
- Be extra cautious **in rooms with carpets**, which are often a source of electrostatic energy.
- Clothes made of wool or certain synthetic fabrics can easily gather static electricity too. It is safer to wear cotton clothing for the assembly.

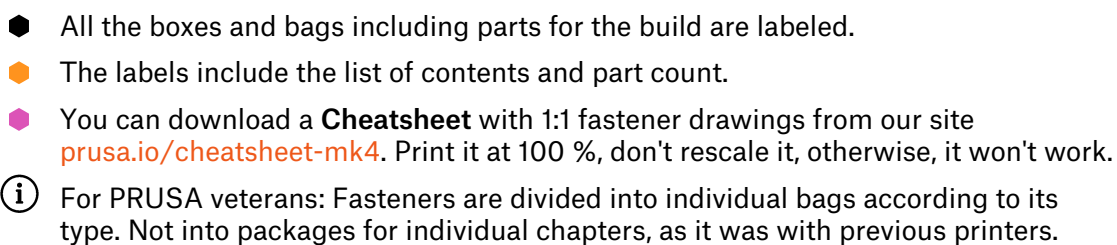

PASO 7 Bolsa de piezas extra

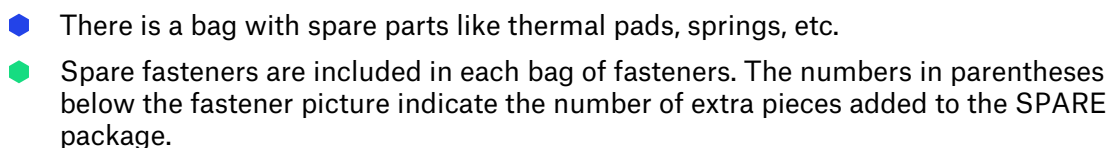

PASO 8 We are here for you!

PRUSA 3D

3D printers Materials Parts & Accessories Software 3D Models Applications Community Help Academy Blog Company

Support > Prusa CORE One > Prusa CORE One (assembly) 0.00 > 3. Mounting the xLCD / Connecting the xLCD assembly

4. Connecting the xLCD assembly

Fullscreen mode Contents Comments

5 comments

Connect the xLCD cable (gray cable with red connector) to the xLCD board on the back of the xLCD assembly. Do not pull on the cable!

Ensure the latch on the connector is positioned on the same side of the slot as the triangle symbol on the xLCD board. Otherwise, the xLCD won't work.

Take the FE cable and fully slide the metal connector into the FE Fasten (brass connector) on the xLCD board. Do not pull on the cable.

For a better overview of the correct connection of both cables, see the illustrations.

Oh look at the detail!

Post comment

JohnnyBumbers · 7 days ago

Feb 24, 2025, new delivery had a couple inches of cable slack, no trouble here. They may have addressed earlier concerns.

Reply Delete

Apurkine1982 · 10 days ago

Secure both parts with grub screw 3x2.5. Do not overtighten the screw! The grub screw protrudes from the PG-ring after tightening.

Apply a small amount of Prusa Lubricant all around the PG-ring and PG-assembly teeth.

Tip: apply a small amount of lubricant to the tip of the zip tie and then spread the lubricant over the gears.

Using a paper towel, wipe off any excess lubricant on the front surfaces.

2 comments

POWERED BY TRY

SUBMIT

Chat now

- Lost in the instructions, missing screw or cracked printed part? **Let us know!**
- You can contact us using the following channels:
 - Using comments under each step.
 - Using our 24/7 live chat here at help.prusa3d.com
 - Writing an email to info@prusa3d.com

PASO 9 Pro tip: inserting the nuts



- 3D printed parts are very precise, however, there still might be a tolerance in the printed part and the same goes for the size of the nut.
- Therefore it might happen, that the nut won't fit easily in or might be falling out. Let's see, how to fix it:
 - **Nut won't fit in:** use a screw with a thread along its entire length (typically: M3x10, M3x18) and screw it from the opposite side of the opening. While tightening the screw, the nut will be pulled in. Remove the screw afterwards.
 - **Nut keeps falling out:** Use a piece of tape to fix the nut temporarily in place, as soon as you insert the screw in, you can remove the tape. *Using glue isn't recommended as it can partly reach into the thread and you won't be able to tighten the screw properly.*
- Every time we recommend using the "screw pulling technique", you will be reminded with Joe's avatar ;)
- ① Parts in the pictures are used as an example.

PASO 10 Distribuidor Lubricación Rodamientos



- We will reuse two LM8UU bearings from your MK4S. It is a good practice to re-lubricate them before re-using.
- For this purpose, we suggest printing the **Bearing Lubrication Pacifier from Printables**, Before disassembling the printer
- ① It is a quick print, just under 20 minutes.
- The lube tube is included in the package.

PASO 11 Prepara tu escritorio



- Tidy up your desk! Tidying up decreases the probability of losing small parts.
- **Clear your workspace.** Make sure you have enough room. A nice clear flat workbench will get you the results you are aiming for.
- **Let there be light!** Make sure you are in a well-lit environment. Another lamp or even an extra flashlight will probably come in handy.
- Prepare something to contain the plastic bags and the removed packing materials so you can recycle them afterwards. Make sure there are no important parts being discarded.
- ⚠ **It's highly recommended to place a soft pad on your workbench. Some sheet metal parts have sharp edges that could scratch the surface.**
- OK, we are ready. Let's start! Go to the next chapter.

1B. Inspección MK4S



PASO 1 Introducción



- Some parts of your printer can be reused for upgrading, so it's essential to check their condition before starting.


This chapter will guide you through a visual inspection of these parts. If you find any in poor condition, you'll have enough time to order replacements while still using the printer.

⚠ Do not disassemble or disconnect anything until prompted.

- Any parts that are found to be in poor condition during the inspection can be replaced with new parts. Everything is available in our [eshop](#).

i Please note that you have to be logged in to access all parts.

PASO 2 Actualización de Firmware

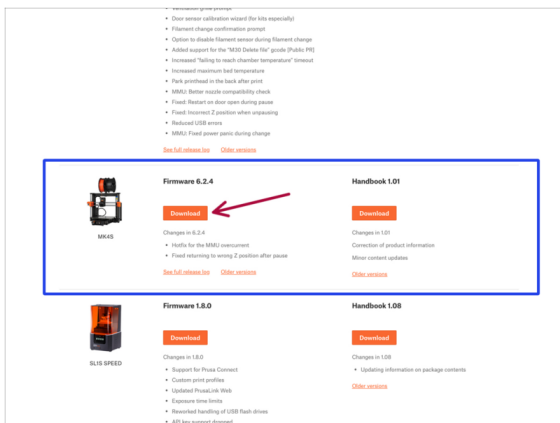


- On the printer, visit the menu **Info > Version Info** to check the firmware version.

⚠ Ensure your MK4S printer has **firmware 6.2.4 or newer before continuing. Otherwise, your newly converted CORE One will not work, and will resist updating.**

- The latest firmware can be downloaded at:
[Help.Prusa3D.com/Downloads](https://help.prusa3d.com/downloads)
- For more info, visit the [Firmware Update Article](#).



PASO 3 Preparación de la Impresora 2

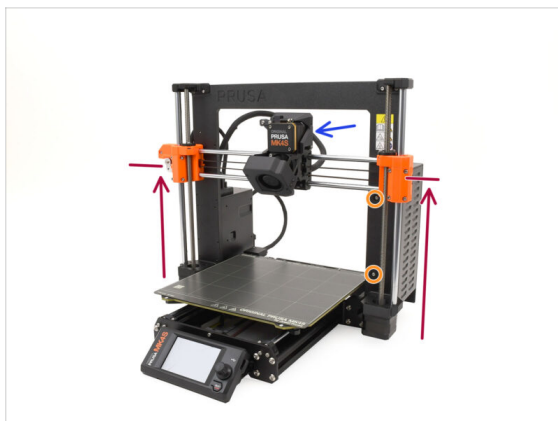

Before you start, do the following:

- Mueve el conjunto del eje X aproximadamente a la altura de 2/3, de modo que:
 - ① Pro Tip: Long press the knob and use the "Z Axis Move" option.
 - The rear of the extruder is accessible.
 - The PSU screws are accessible.
 - All the screws on the electronics box are accessible.

PASO 4 Preparación de la Impresora 2

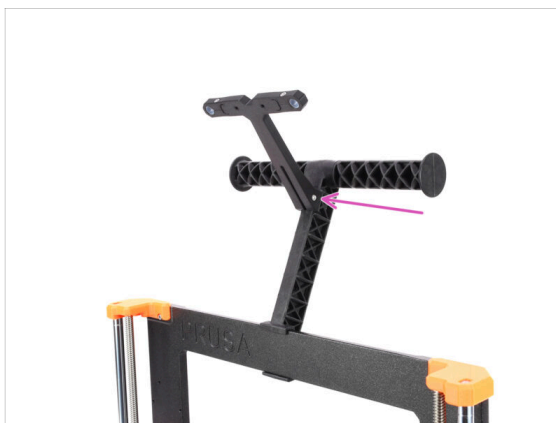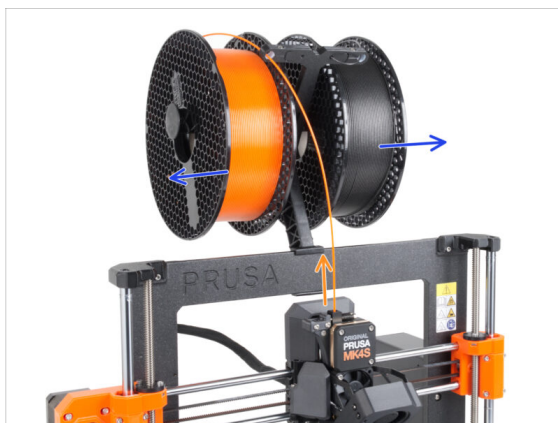



- Unload a filament, if it is loaded.
 - ① Menu Filament > Unload filament
- Remove the filament spools.
- Remove the spool holder.

PASO 5 Preparación Impresora 3



- Turn off your printer and disconnect it from the power.
- Remove the print sheet and save it for later use.

PASO 6 Inspección de la base calefactable

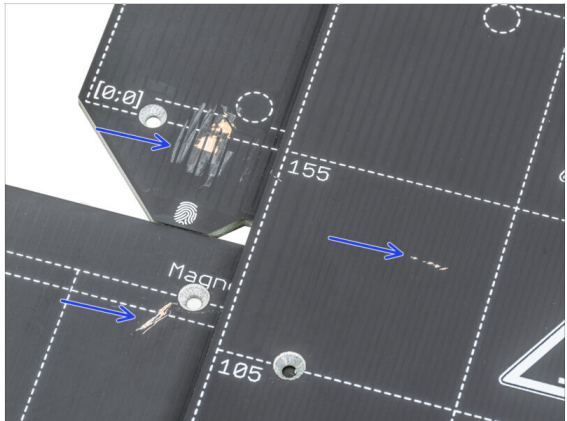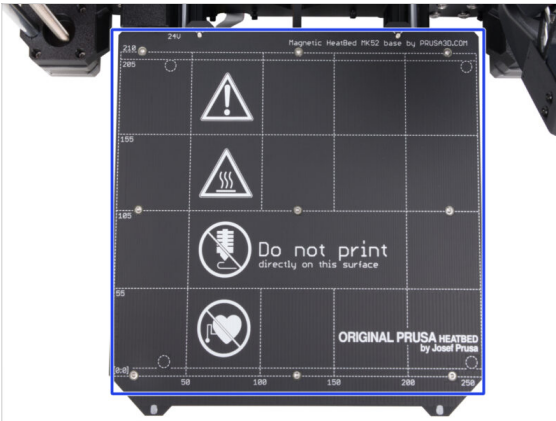

- Carefully inspect the surface of the heatbed. If you find any major scratches (up to the copper layer) consider replacing it with a new piece.

PASO 7 Inspeccion Y-Rods



- Wipe the entire length of the Y-axis smooth rods with a paper towel to remove any dirt.

i Carefully inspect the surface of the smooth rods up close, as we are going to reuse them.

- The surface must be clean and smooth.
- If you find very deep scratches, corrosion, or a rough surface, it is highly recommended to replace the rods.

You can purchase a new Smooth Rod Y-axis (8×330 mm) in our [eshop](#)

- Similarly, if the smooth rods are scratched or the bearings do not move smoothly (stuttering occurs), we recommend ordering new LM8UU bearings as well.

You can purchase new LM8UU bearings in our [eshop](#).

PASO 8 Haribo?



! Keep the Haribo bag closed for now!

- This dose of energy is primarily for the printer assembly. **Wait until you are prompted to open it.**


PASO 9 Cómo Empezar




- Got everything checked? Great! Let's begin disassembling the printer.

Proceed to the next chapter.

1C. Desmontaje de la Impresora

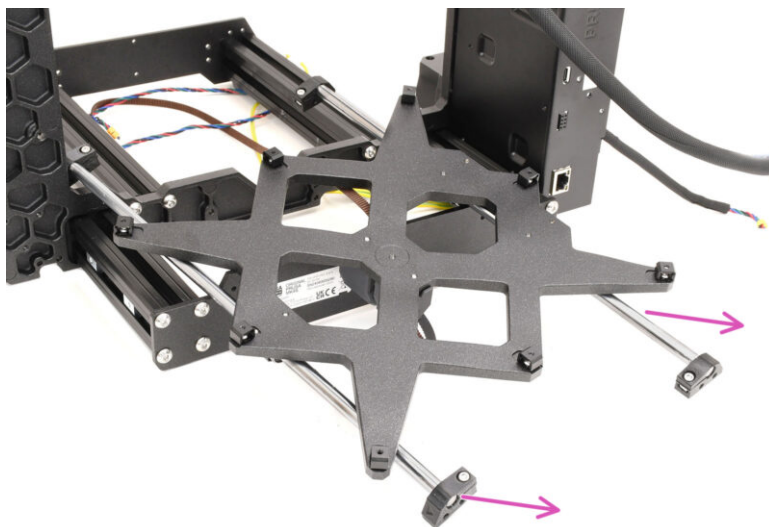


PASO 1 Herramientas Necesarias

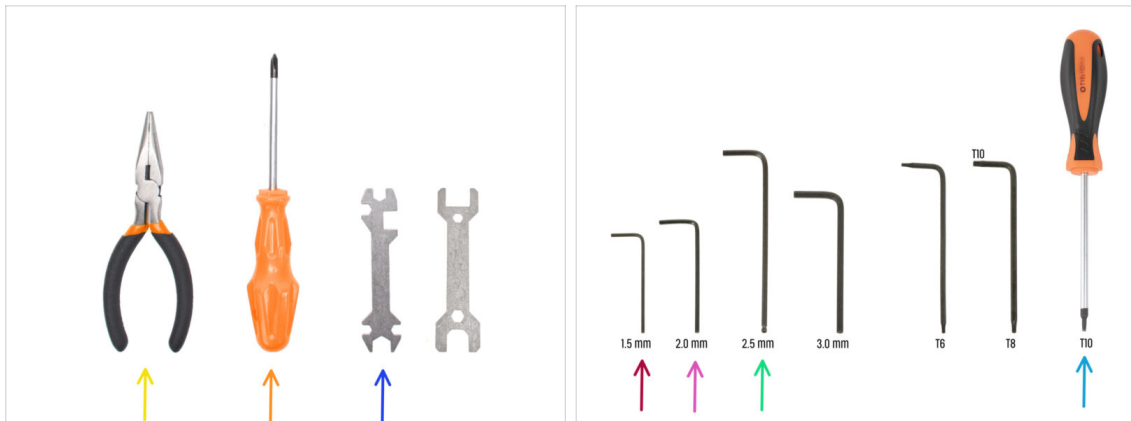

● For this chapter, please prepare:

- Alicates de punta fina
- Destornillador Phillips
- Llave universal
- Llave Allen de 1.5mm
- Llave Allen de 2mm
- Llave Allen de 2.5mm
- Destornillador T10



PASO 2 Desmontaje Electrónica

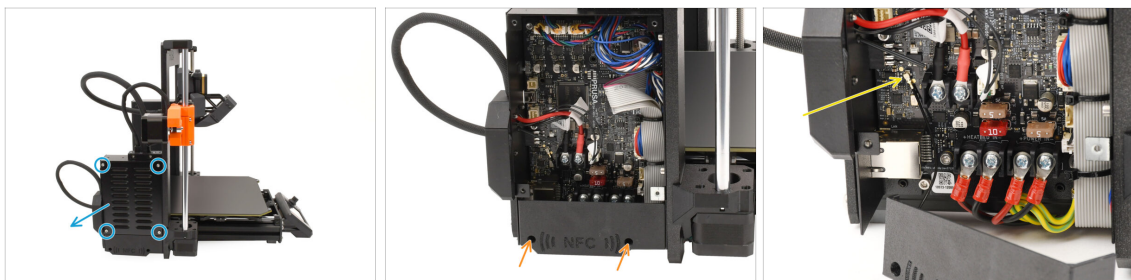

- Let's move onto the **left** side of the printer.
- Remove the four screws holding the xBuddy box cover and remove the cover.
- Using the 2.5mm Allen key, remove the two screws holding the NFC cover.
- Disconnect the NFC antenna from the xBuddy board by gently lifting the tiny connector.



Then, remove the antenna along with the cover.

PASO 3 Desmontaje Wi-Fi

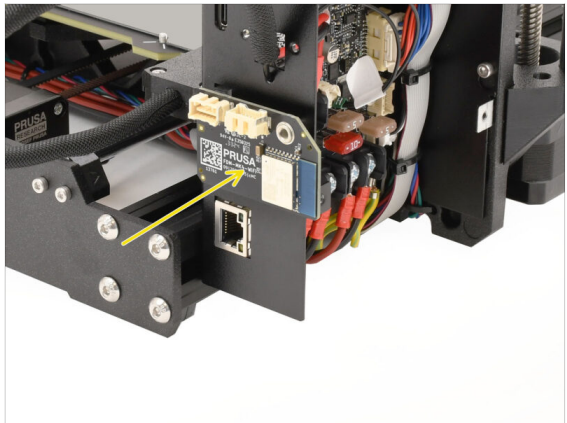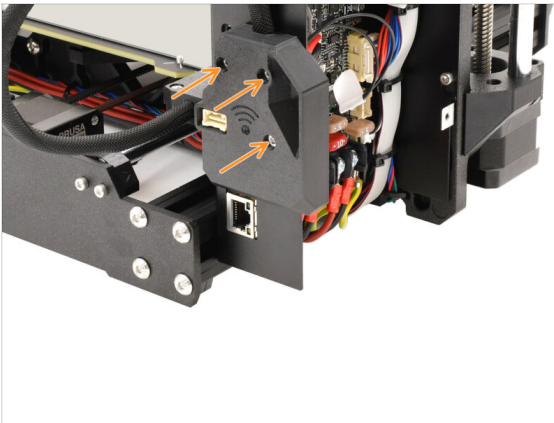


- 🟠 On the back of the electronics box, remove the three screws holding the Wi-Fi cover and remove the cover.
- 🟡 Remove the Wi-Fi module and **save it for later use**.
 - ⚠️ Ensure you store the module and all electronic components in an ESD-safe environment to prevent damage!

PASO 4 Desmontaje Haz de cables

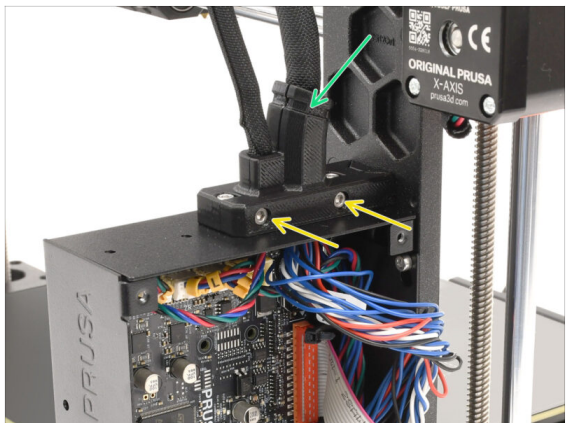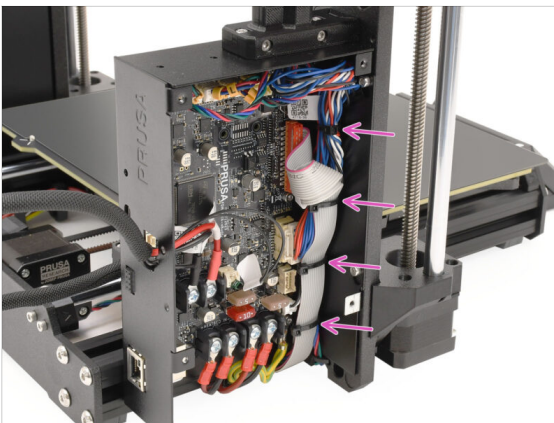


- 🟣 Remove all the zip-ties securing the cable bundle inside the xBuddy box.
 - ⚠️ When cutting the zip-ties, proceed carefully to prevent any damage to the cables or the electronics!
- 🟡 Remove the two screws on the main cable holder.
- 🟢 Cut the zip-tie holding the cover together, then remove the outer part of the holder.

PASO 5 Desconexión Cables 1

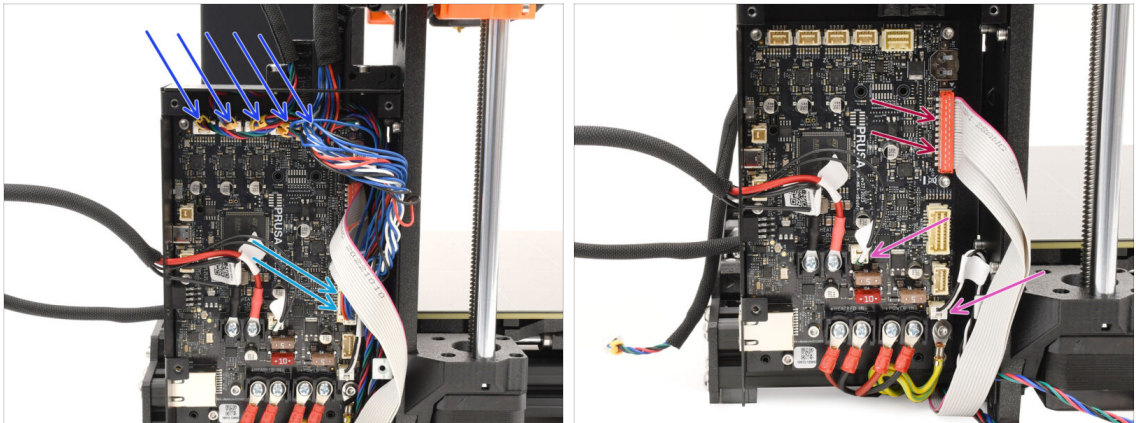


- ◆ Disconnect all the connectors on the top of the xBuddy board.
⚠ There is a safety latch on each of these connectors, which must be pressed in order to disconnect it.
- ◆ Disconnect the extruder main cable connector.
- ◆ Disconnect the heatbed thermistor and power panic cables.
- ◆ Disconnect the xLCD connector by lifting it carefully up.

PASO 6 Desconexión Cables 2

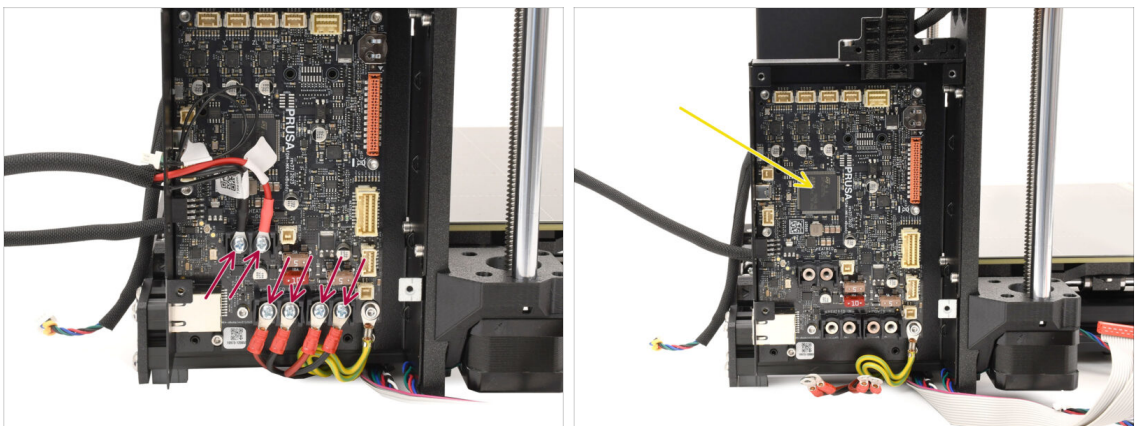


- ◆ Using the Phillips screwdriver, remove all the terminal screws holding the heatbed and power cable connectors.
- ◆ Leave the xBuddy board in the electronics box for now, as this way, it is well protected from damage.

PASO 7 Liberación Haz de Cables

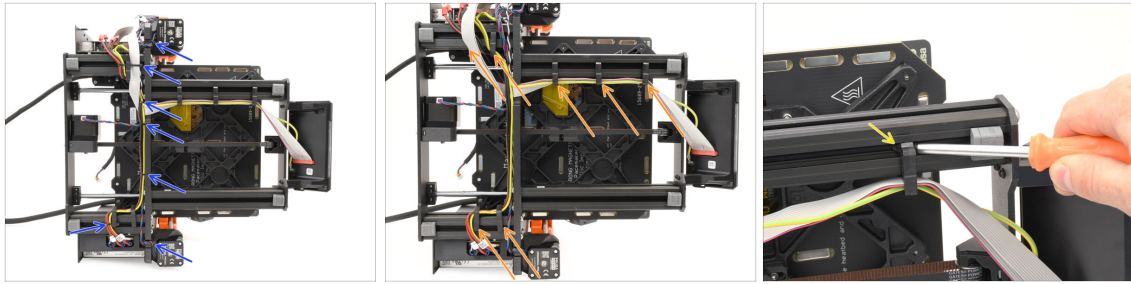


- Lay the printer onto the PSU side to access the bottom part.
- Carefully remove all the zip-ties holding the cable bundle
- Remove all the cable holders from the frame and detach them from the cables.
 - Pro tip: You can pry them off the metal profiles using the screwdriver.

PASO 8 Extracción xLCD

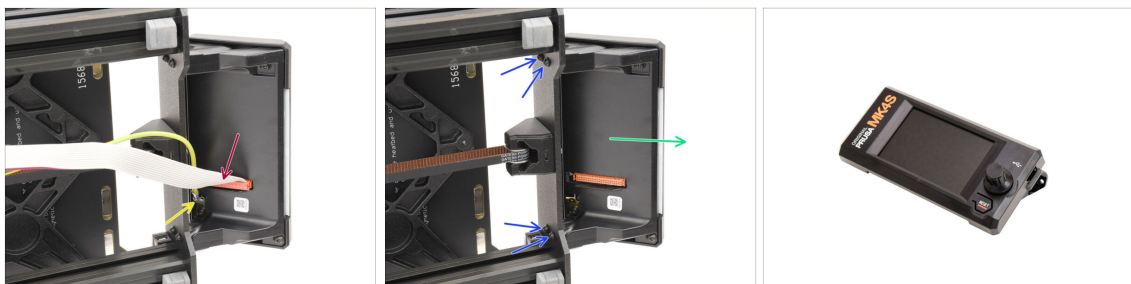

- Disconnect the main cable from the xLCD by gently lifting the connector up.
- Disconnect the grounding cable.
- Using the T10 screwdriver, remove the four screws holding the xLCD assembly.
- Remove the xLCD assembly and **save it for later use!**

PASO 9 Desmontaje Tensor Y

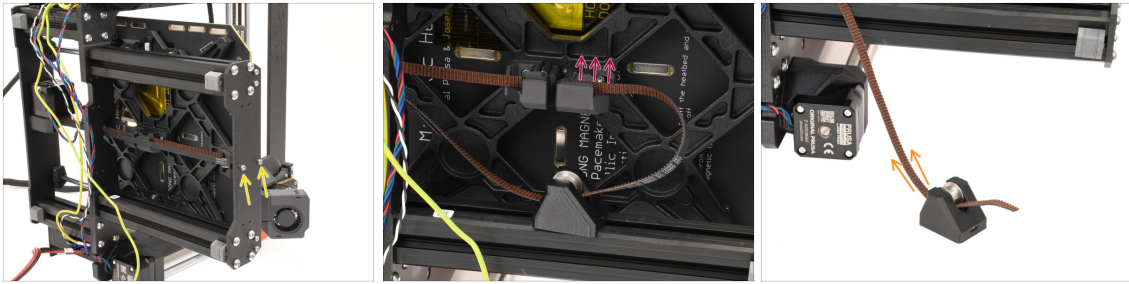


- ✦ Using the 2.5mm Allen key, remove the two screws holding the Y-Axis Idler on the front plate.
- ✦ Pull the end of the Y-axis belt out of the holder at the bottom of the heatbed to disengage it.
- ✦ Remove the belt from the idler by pulling it out.

PASO 10 Extracción Polea Tensora




- ✦ Orient the Y-Idler as shown in the picture.
- Remove the pulley by first moving it inward, then pulling it out to the side.
- Refer to the groove pattern in the picture for the correct trajectory.
- ✦ Remove the center shaft from the pulley.
 - ✦ **Save the pulley for later use.**

PASO 11 Extracción Motor Y

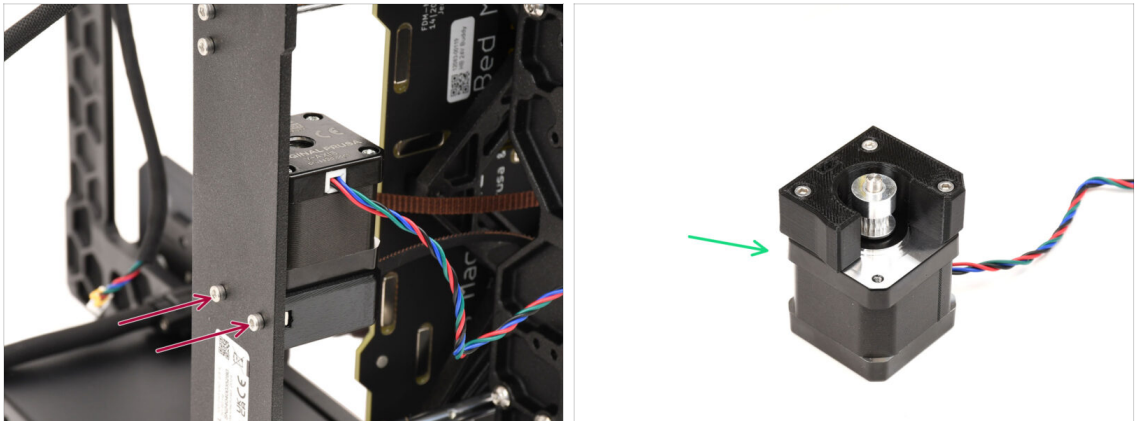


- Remove the two screws on the back of the printer, holding the Y-axis motor in place.
- Remove the Y-axis motor assembly and **save it for later use**.

PASO 12 Power Panic Cable Removal

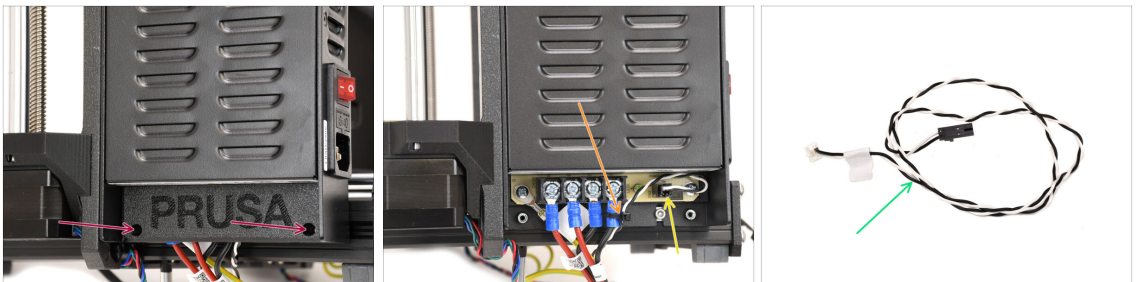


- Let's move onto the right side of the printer carcass, where the PSU lives.
- Remove the two screws securing the cover, then take off the cover.
- Carefully cut off the zip-tie holding the power panic cable.
- Save the power panic cable for later use.**
- i** The power panic cable may look different, depending on your xBuddy board version.

PASO 13 Retirando el Cable Alimentación

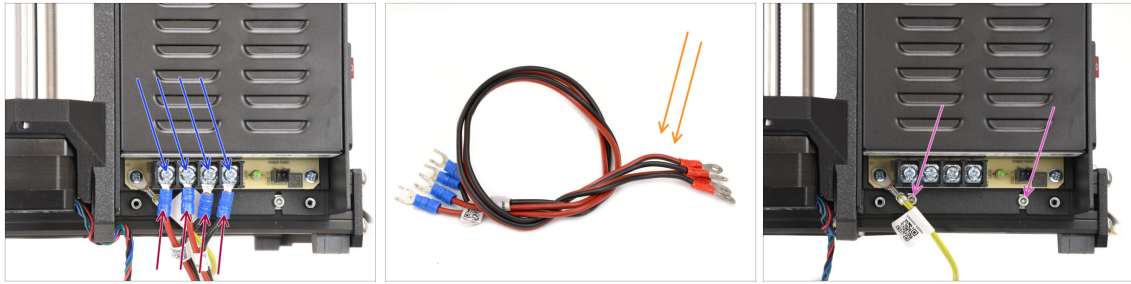

- Using the Phillips screwdriver, loosen the four power terminal screws. Do not remove them entirely.
- Remove the four power cable connectors by pulling them downward.
- Remove the power cables and **save them for later use**.
- Using the 2.5mm Allen key, remove the two screws holding the PSU to the printer's frame.

PASO 14 Extracción Fuente Alimentación 1

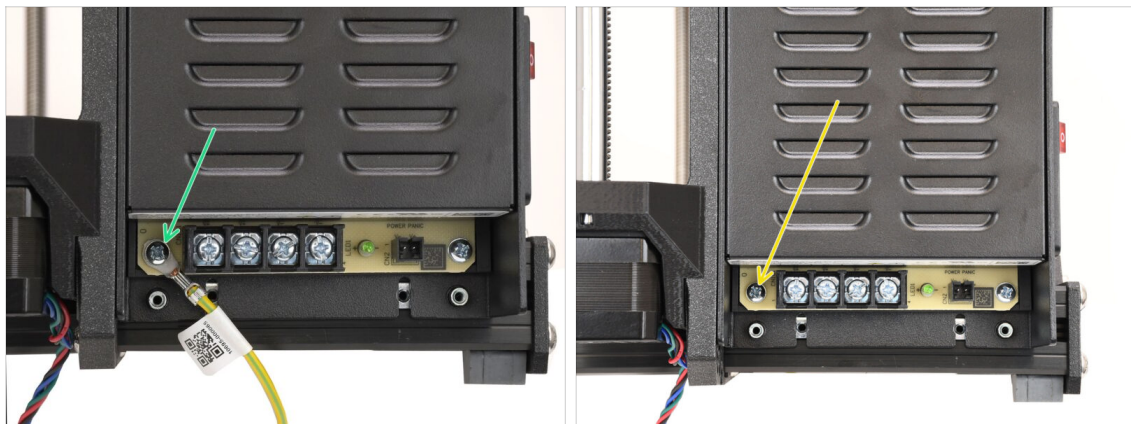

- Remove the screw holding the grounding cable to the PSU.
- Disconnect the grounding cable—it will no longer be needed.
- Re-install the screw you previously removed.

PASO 15 Extracción Fuente Alimentación 2




- On the front of the frame, remove the two screws holding the PSU.

⚠ The PSU might fall off to the side!

- Retira la fuente de alimentación y **guárdala para más tarde.**

PASO 16 Extracción Base Calefactable

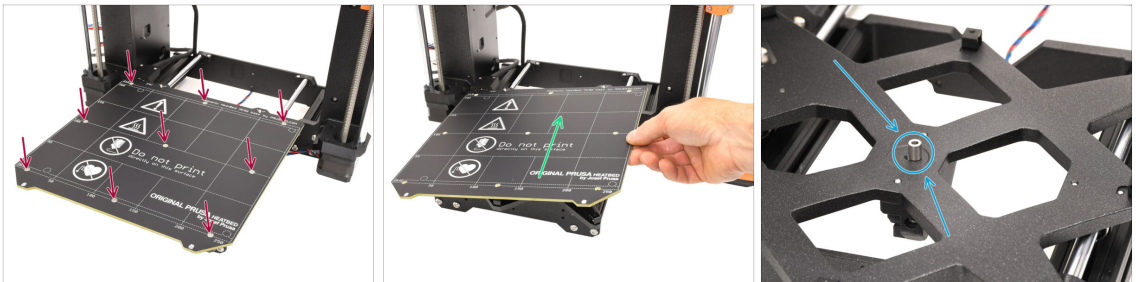

- Let's move onto the heatbed.

- Using the T10 Torx screwdriver, remove all 9 screws holding the heatbed.

- Retira la base calefactable levantándola. **Guárdala para más tarde.**

- There is a spacer in the middle of the heatbed. Make sure to save it for later use too!

- 📌 Be careful and store the heatbed on a soft surface to prevent scratching it.

PASO 17 Extracción Eje Y




- Using the 2.5mm Allen key, remove the four screws holding the Y-axis rods to the front of the frame.
- Remove the four screws holding the Y-axis rods to the back of the frame.
- Retira el conjunto del eje Y entero de la impresora.

PASO 18 Desmontaje Eje Y



- Remove the four screws fixing the rods to the Y-rod holders. Then, remove the plastic rod holders.
- Turn the assembly around.
- Saca las dos varillas del eje Y. Límpialas y **guárdalas para un uso posterior.**
- Remove all the screws holding the bearings to the carriage.

PASO 19 Extracción Rodamientos

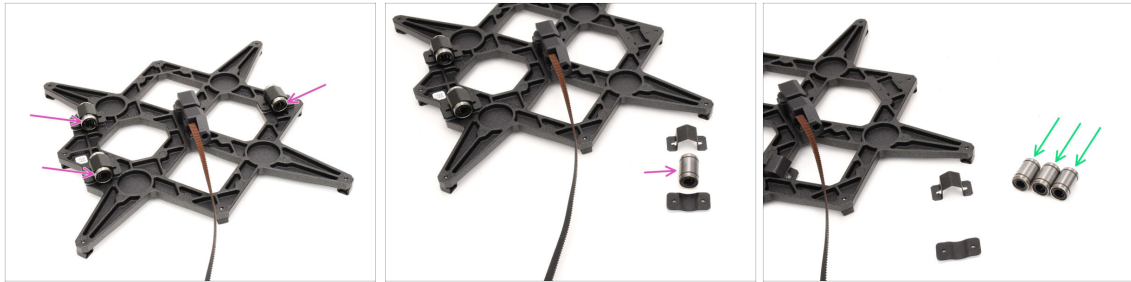


- ◆ Remove all three bearings from the bearing holders.
- ◆ Clean the bearings from any excess grease or dirt, and **save them for later use.**
- ❗ Para construir la CORE One+ se utilizarán dos rodamientos de este tipo.

PASO 20 Desmontaje Junta de Expansión




- ◆ Using the 2mm Allen key, remove all 8 expansion joints from the Y-Carriage.
- ◆ **Save the expansion joints for later use.**

PASO 21 Extracción Cubierta Extrusor

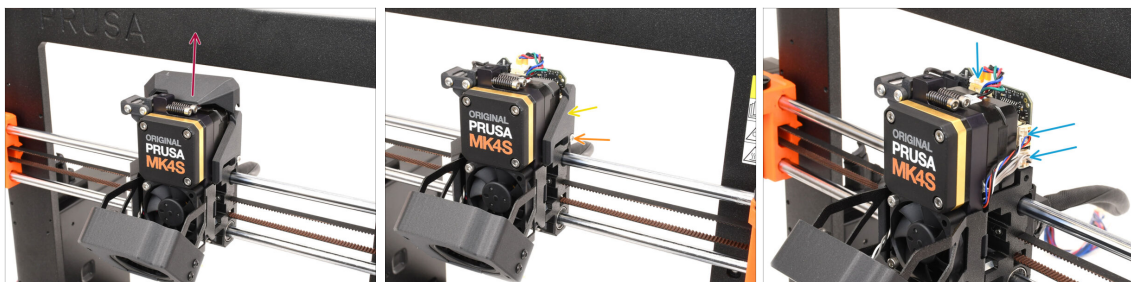


- ◆ Let's move onto the extruder.
- ◆ Remove the top cover on the extruder by lifting it up.
- ◆ Retira el tornillo que sujeta la tapa en el lado derecho.
- ◆ Remove the side cover.
- ◆ Disconnect the motor, filament sensor and loadcell cables.

PASO 22 Extracción Conjunto Hotend

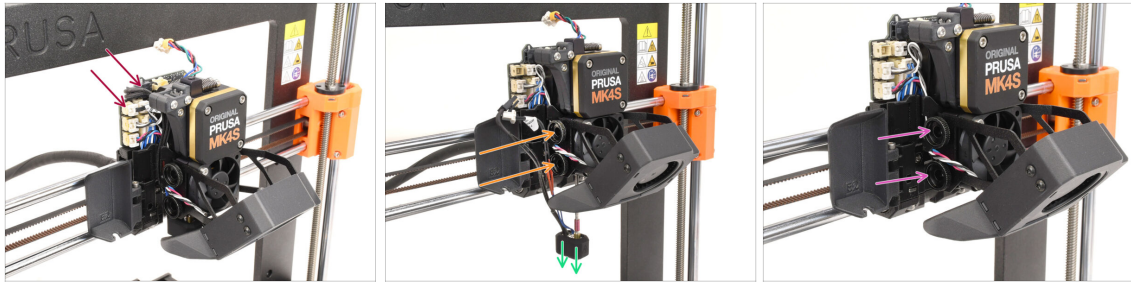


- On the opposite side, disconnect the nozzle thermistor and nozzle heater cables.
- Release the two thumb screws, until the hotend assembly drops.
- Retira el conjunto del hotend y **guárdalo para su uso posterior**.
- Remove the two thumb screws and save them for later use.

PASO 23 Extracción Ventilador de Impresión

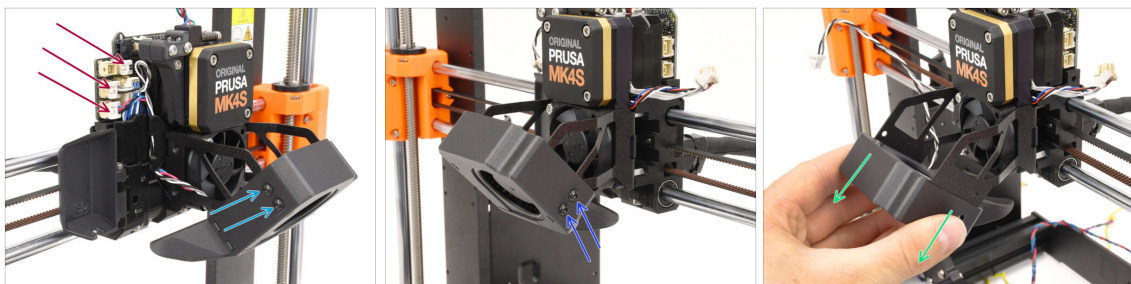

- Desconecta los cables en el lado izquierdo del Nextruder.
- Using the T10 screwdriver, remove the two screws holding the print fan on the left side.
- Retira los dos tornillos de la derecha.
- Remove the print fan assembly by sliding it out. Proceed carefully to prevent damaging the cable going through the metal holder. **Save the fan assembly for later use!**

PASO 24 Extracción Ventilador Disipador

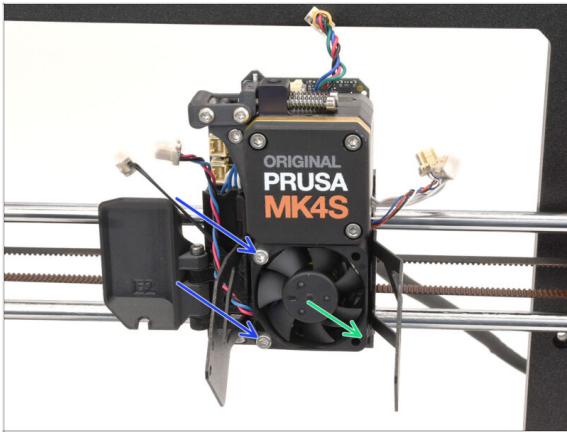


Retira los dos tornillos que sujetan el ventilador del hotend al disipador.

Remove the fan and **save it for later use.**



Procede con cuidado para no dañar el cable.

PASO 25 Extracción Nextruder

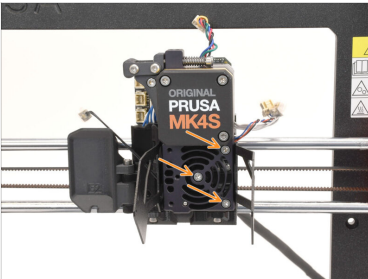

Remove the three screws holding the Nextruder to the X-carriage.


⚠ Watch out! The Nextruder might fall out!

Retira el Nextruder de la impresora.

Remove the Print fan support and a plastic spacer (if present). Proceed carefully to prevent damaging the heatsink thermistor cable.


Save the Nextruder for later use.

PASO 26 Extracción LoveBoard

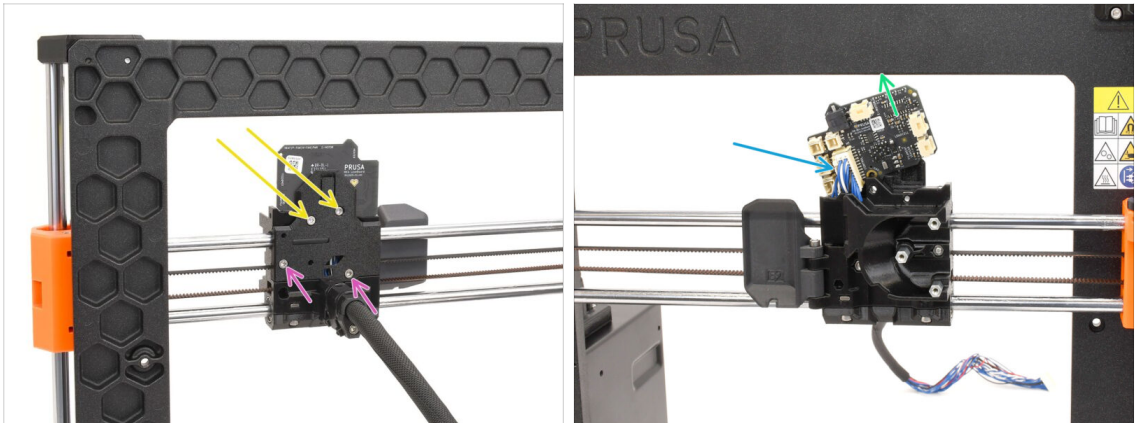


- Move onto the back of the X-carriage.
- Remove the two marked screws on top of the backing plate.
- Afloja los dos tornillos restantes, pero no los retires del todo todavía.
- Lift the Loveboard slightly to disconnect it from the main cable. Proceed carefully to prevent any damage to the Loveboard.
- **Remove the Loveboard and save it for later use.**

PASO 27 Extracción Motores Z

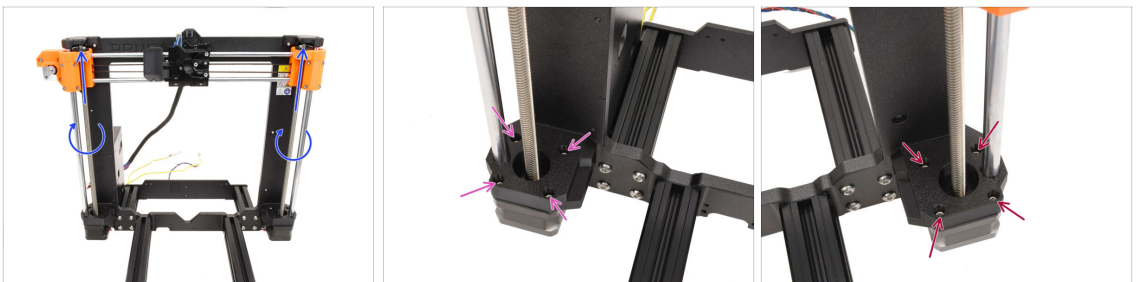


- Gira ambas varillas roscadas con la mano para desplazar el conjunto del eje X hasta la parte superior.
- Using a ball-end 2.5mm Allen key, remove all 4 screws securing the left Z motor.
- Retira también los 4 tornillos que sujetan el motor Z derecho.

PASO 28 Z Motors Removal 2

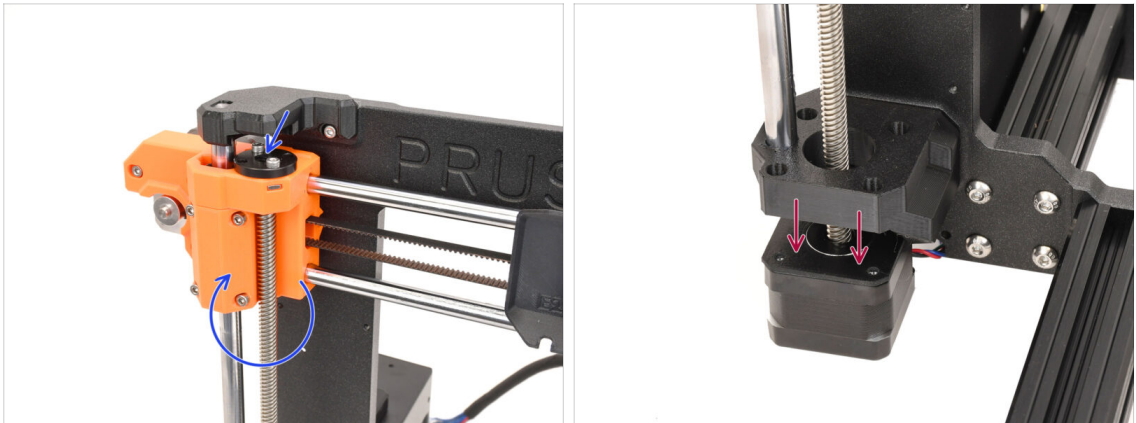


- Rotate the threaded rods on both sides to disengage both the motors from the trapezoid nuts on the X-End parts.
- Disengage the motors on both sides from the holders. The X-axis will drop slightly.

PASO 29 Z Motors Removal 3

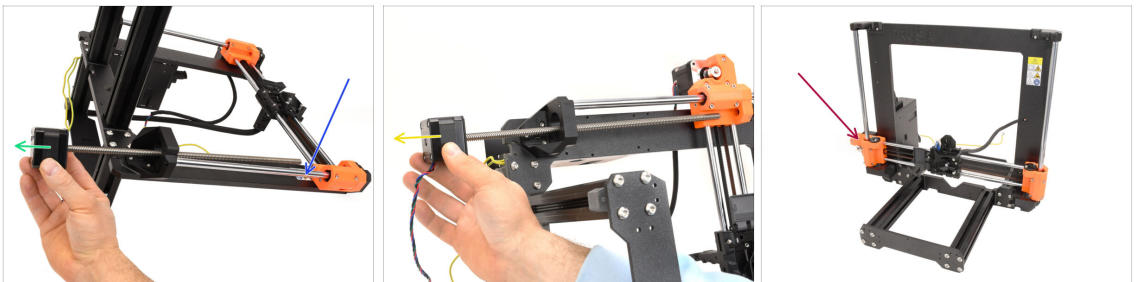


- Lay the frame onto its back part.
- Remove the right Z motor by sliding it out. **Save it for later use.**
- Retira el motor Z izquierdo. **Guárdalo para más tarde.**
- Move the frame back to the original position. **Expect that the X-axis now moves freely and may fall rapidly.**

PASO 30 Extracción Varillas Z

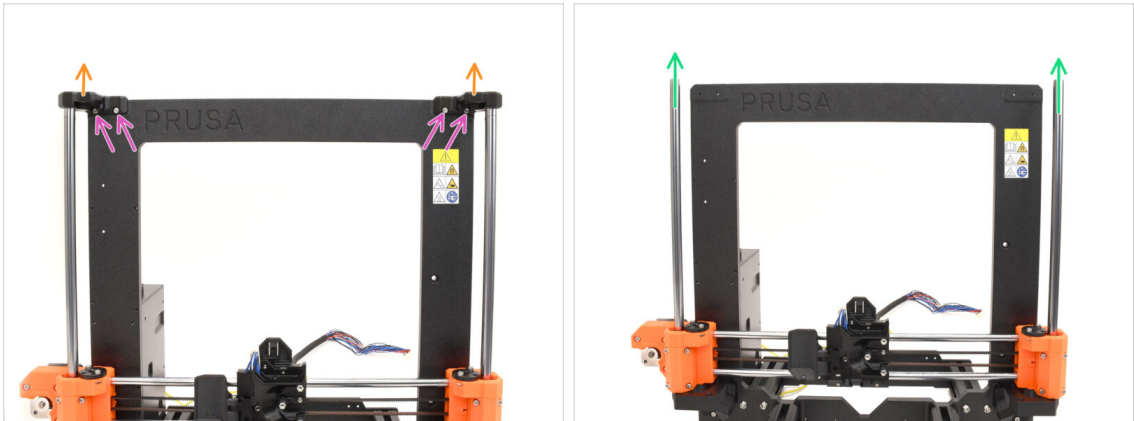


- ✦ Remove the four screws holding the Z-top parts on both sides.
 - ✦ Remove both Z-tops by pulling them up and disengaging from the rods.
 - ✦ Tira hacia arriba de ambas varillas Z y retíralas de la impresora.
Guarda ambas varillas para su uso posterior.
- (i)** A slight wiggling motion may help to disengage them from the plastic part.

PASO 31 Extracción Tuerca Trapezoidal

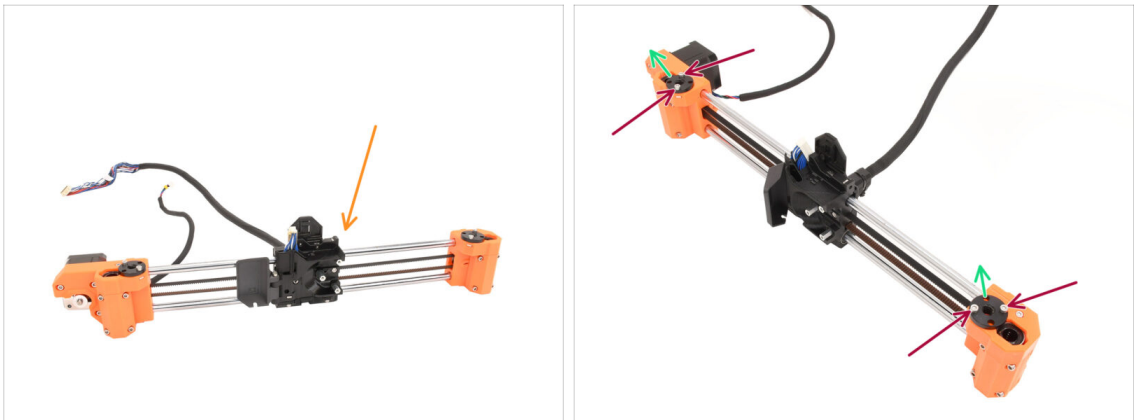


- ✦ Remove the X-axis assembly from the printer's frame.
 - ✦ Remove the four screws holding the trapezoid nuts on top of both sides of the assembly.
 - ✦ Retira ambas tuercas trapezoidales y **guárdalas para más tarde.**
- (i)** If the nuts are hard to remove, try rotating them, while pulling them up.
If that doesn't help, carefully use the threaded rod on one of the Z-motors, to pry them out.

PASO 32 Extracción Motor X

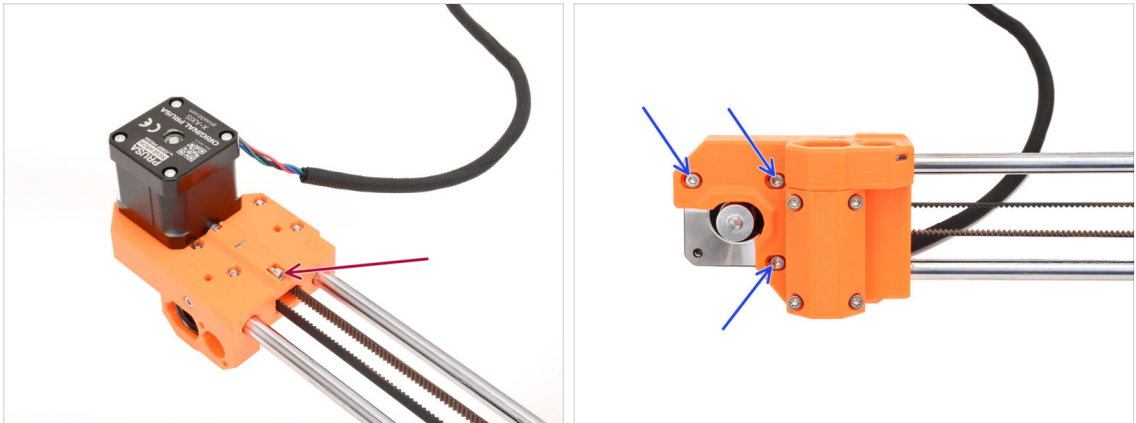

- On the back of the assembly, remove the belt tensioning screw
- Loosen the three screws holding the motor on the front.
- ① Tenemos que liberar la tensión de la correa, con el fin de liberar la correa en el siguiente paso.

PASO 33 Extracción Correa X

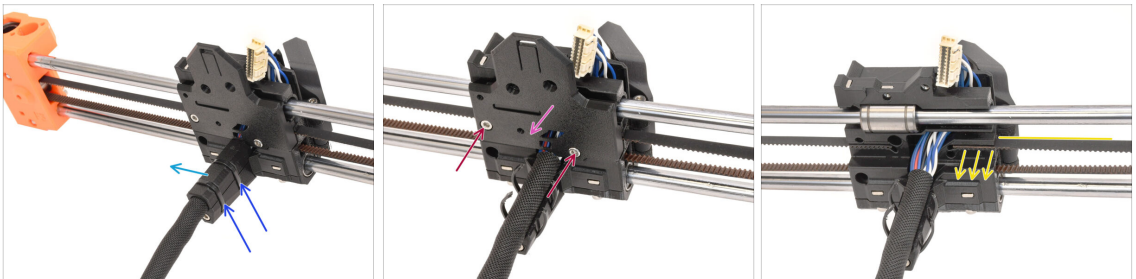


- On the back of the assembly, cut both the zip-ties holding the cable cover.
- Remove the cable cover.
- Remove both screws on the back of the X-carriage.
- Remove the cover on the back of the X-carriage.
- Pull out the end of the belt on the motor side, to disengage it.

PASO 34 Extracción Motor X



- Remove the three screws holding the X-motor at the front of the assembly.
- Remove the X-Axis motor and **save it for later use**.

PASO 35 X Idler Shaft Removal

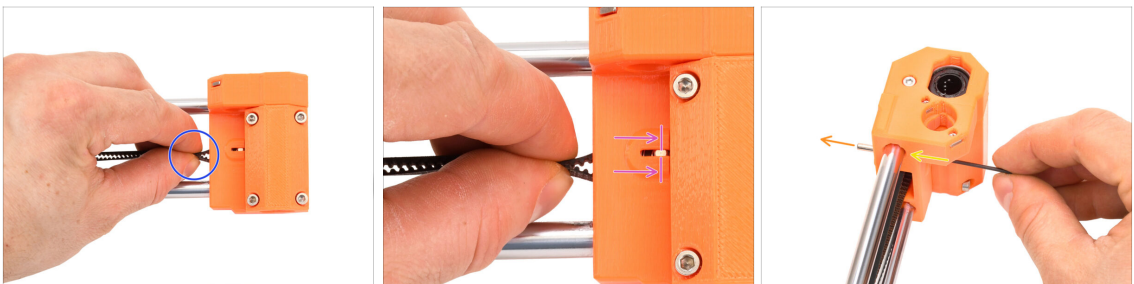

- Let's move onto the right X-end part.
- Use the belt as a handle for the Idler pulley inside the plastic part.
- Move the Idler **all the way inward**.

On the front, there is a small window where you can observe the idler shaft movement.


- While keeping the idler pushed all the way in, use the thinnest 1.5mm Allen key to push the shaft out of the part.
- The Idler shaft should exit the plastic part at the back. Remove it.

PASO 36 Desmontaje Tensor X




- Pull out the Idler pulley.
- Save the pulley for later use.

PASO 37 Extracción xBuddy

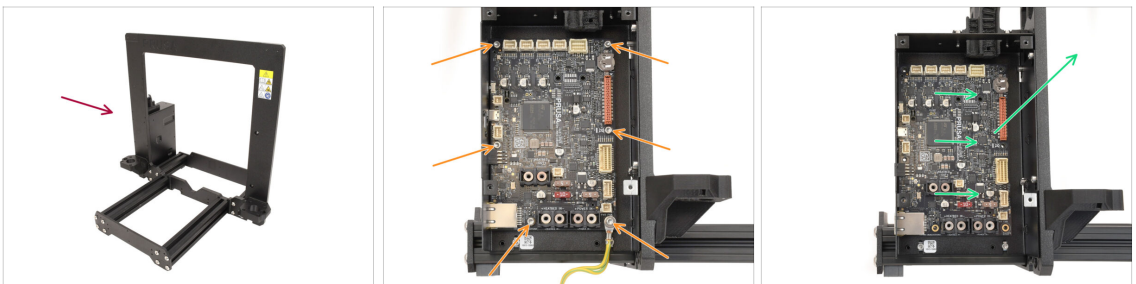


- Let's move back to the printer's frame.
- Remove the six screws holding the xBuddy board in place.
- Release the xBuddy by sliding it towards the frame, then lifting it. **Save it for later use.**

1D. Preparación componentes

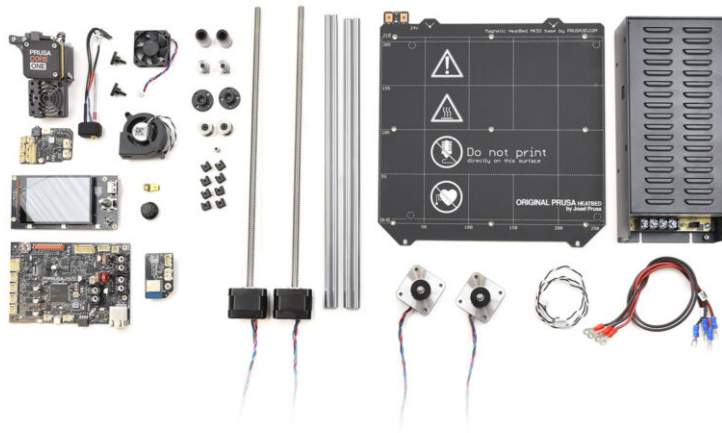


PASO 1 Herramientas Necesarias

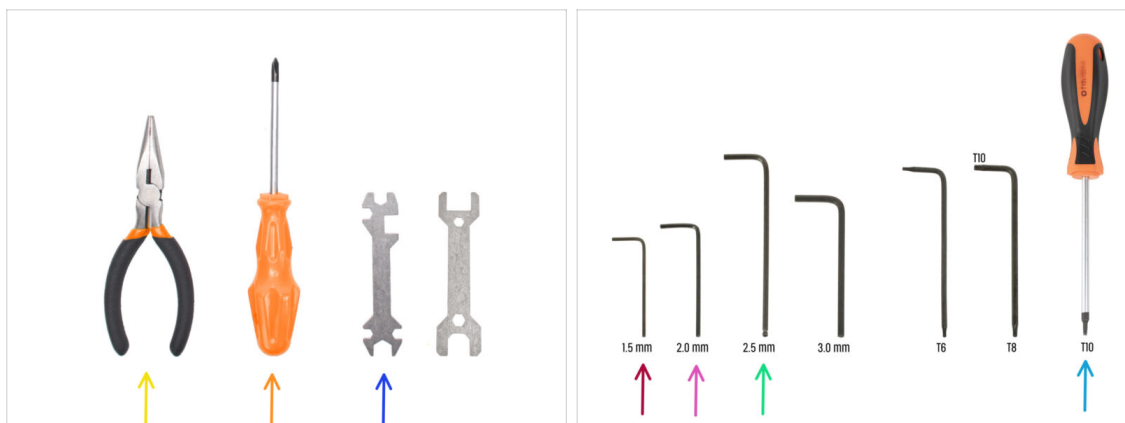

● For this chapter, please prepare:

- Alicates de punta fina
- Destornillador Phillips
- Llave universal
- Llave Allen de 1.5mm
- Llave Allen de 2mm
- Llave Allen de 2.5mm
- Destornillador T10


PASO 2 Desmontaje Electrónica

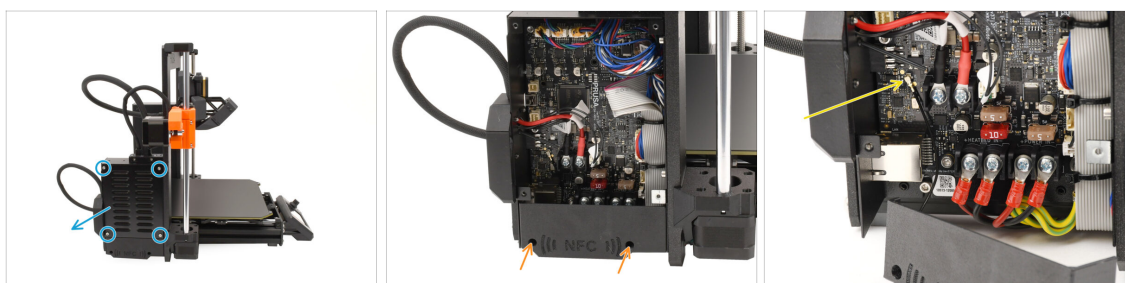

- Let's move onto the **left** side of the printer.
- Remove the four screws holding the xBuddy box cover and remove the cover.
- Using the 2.5mm Allen key, remove the two screws holding the NFC cover.
- Disconnect the NFC antenna from the xBuddy board by gently lifting the tiny connector.


Then, remove the antenna along with the cover.

PASO 3 Desmontaje Wi-Fi

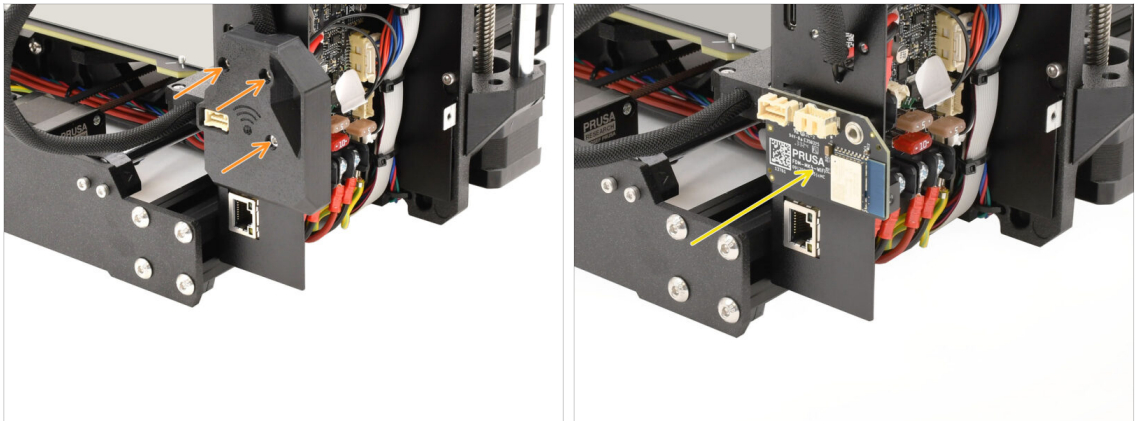


- 🟠 On the back of the electronics box, remove the three screws holding the Wi-Fi cover and remove the cover.
- 🟡 Remove the Wi-Fi module and **save it for later use**.
 - ⚠️ Ensure you store the module and all electronic components in an ESD-safe environment to prevent damage!

PASO 4 Desmontaje Haz de cables

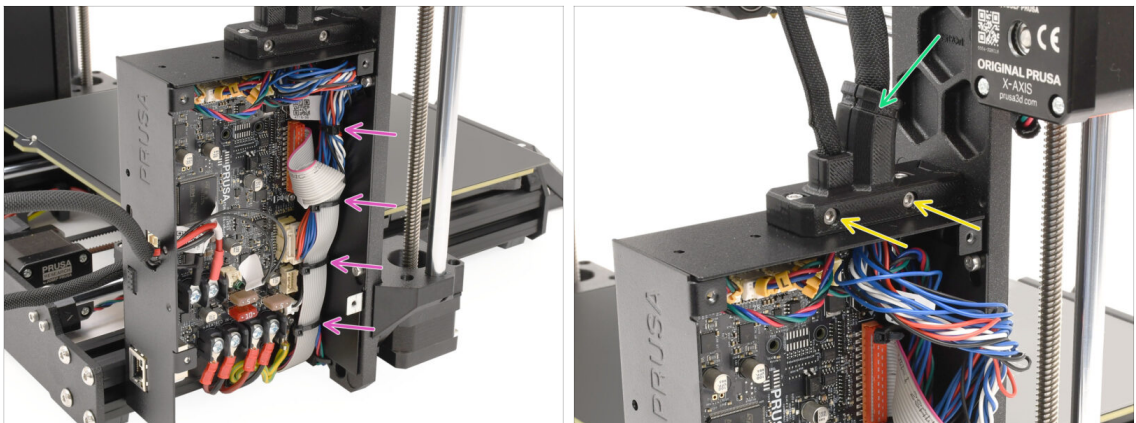


- 🟣 Remove all the zip-ties securing the cable bundle inside the xBuddy box.
 - ⚠️ When cutting the zip-ties, proceed carefully to prevent any damage to the cables or the electronics!
- 🟡 Remove the two screws on the main cable holder.
- 🟢 Cut the zip-tie holding the cover together, then remove the outer part of the holder.

PASO 5 Desconexión Cables 1

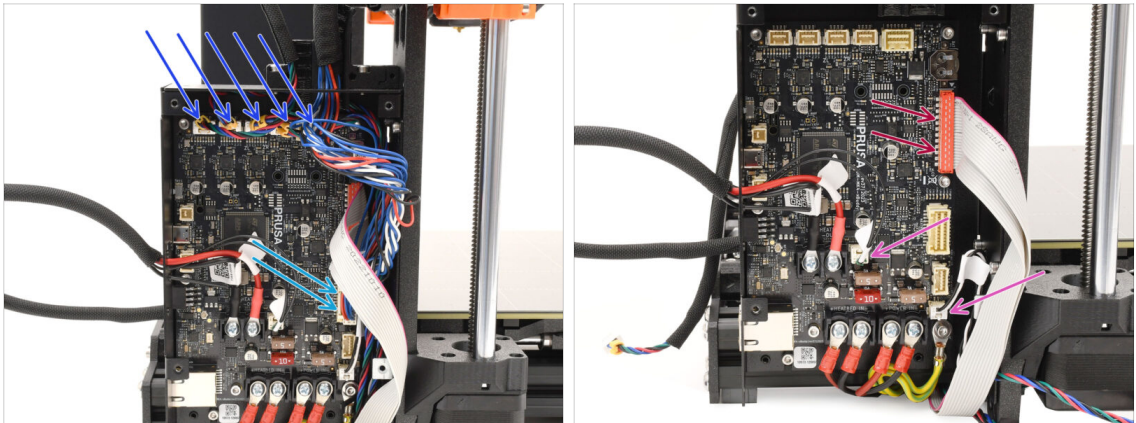


- ◆ Disconnect all the connectors on the top of the xBuddy board.
 ⚠ There is a safety latch on each of these connectors, which must be pressed in order to disconnect it.
- ◆ Disconnect the extruder main cable connector.
- ◆ Disconnect the heatbed thermistor and power panic cables.
- ◆ Disconnect the xLCD connector by lifting it carefully up.

PASO 6 Desconexión Cables 2

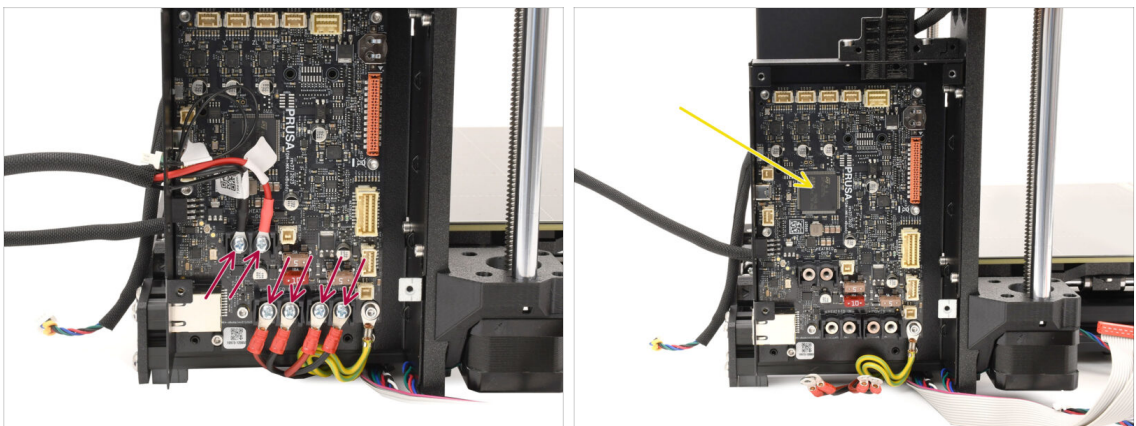


- ◆ Using the Phillips screwdriver, remove all the terminal screws holding the heatbed and power cable connectors.
- ◆ Leave the xBuddy board in the electronics box for now, as this way, it is well protected from damage.

PASO 7 Liberación Haz de Cables

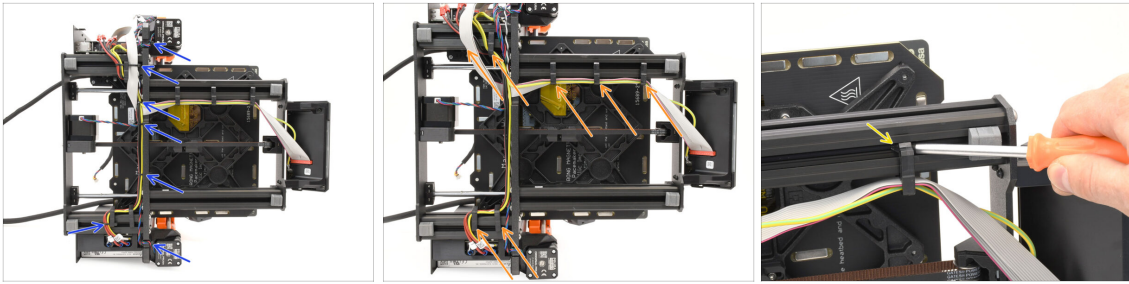


- Lay the printer onto the PSU side to access the bottom part.
- Carefully remove all the zip-ties holding the cable bundle
- Remove all the cable holders from the frame and detach them from the cables.
 - Pro tip: You can pry them off the metal profiles using the screwdriver.

PASO 8 Extracción xLCD

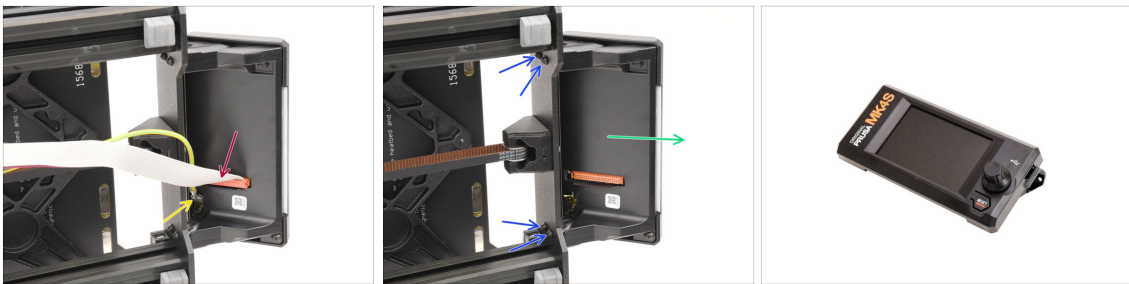

- Disconnect the main cable from the xLCD by gently lifting the connector up.
- Disconnect the grounding cable.
- Using the T10 screwdriver, remove the four screws holding the xLCD assembly.
- Remove the xLCD assembly and **save it for later use!**

PASO 9 Desmontaje Tensor Y

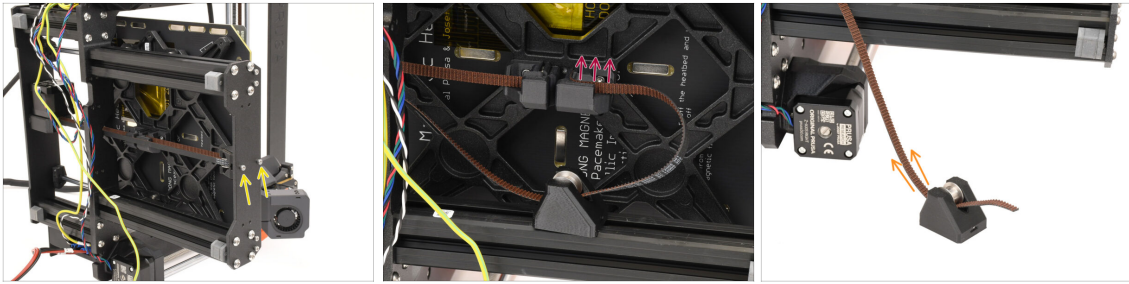


- ✦ Using the 2.5mm Allen key, remove the two screws holding the Y-Axis Idler on the front plate.
- ✦ Pull the end of the Y-axis belt out of the holder at the bottom of the heatbed to disengage it.
- ✦ Remove the belt from the idler by pulling it out.

PASO 10 Extracción Polea Tensora




- ✦ Orient the Y-Idler as shown in the picture.
- Remove the pulley by first moving it inward, then pulling it out to the side.
- Refer to the groove pattern in the picture for the correct trajectory.
- ✦ Remove the center shaft from the pulley.
 - ✦ **Save the pulley for later use.**

PASO 11 Extracción Motor Y

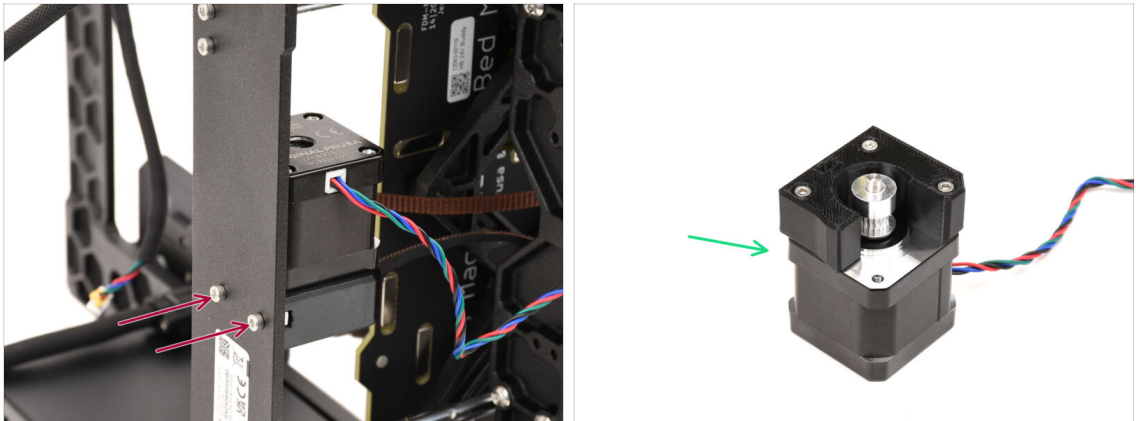


- Remove the two screws on the back of the printer, holding the Y-axis motor in place.
- Remove the Y-axis motor assembly and **save it for later use**.

PASO 12 Power Panic Cable Removal

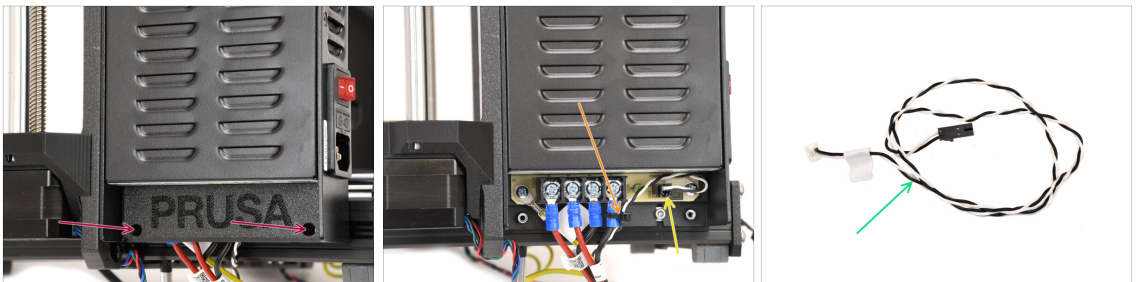


- Let's move onto the right side of the printer carcass, where the PSU lives.
- Remove the two screws securing the cover, then take off the cover.
- Carefully cut off the zip-tie holding the power panic cable.
- Save the power panic cable for later use.**
- i** The power panic cable may look different, depending on your xBuddy board version.

PASO 13 Retirando el Cable Alimentación

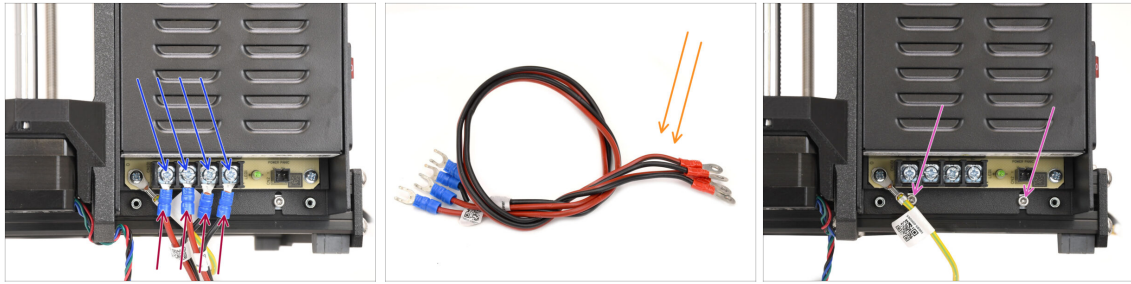

- Using the Phillips screwdriver, loosen the four power terminal screws. Do not remove them entirely.
- Remove the four power cable connectors by pulling them downward.
- Remove the power cables and **save them for later use**.
- Using the 2.5mm Allen key, remove the two screws holding the PSU to the printer's frame.

PASO 14 Extracción Fuente Alimentación 1

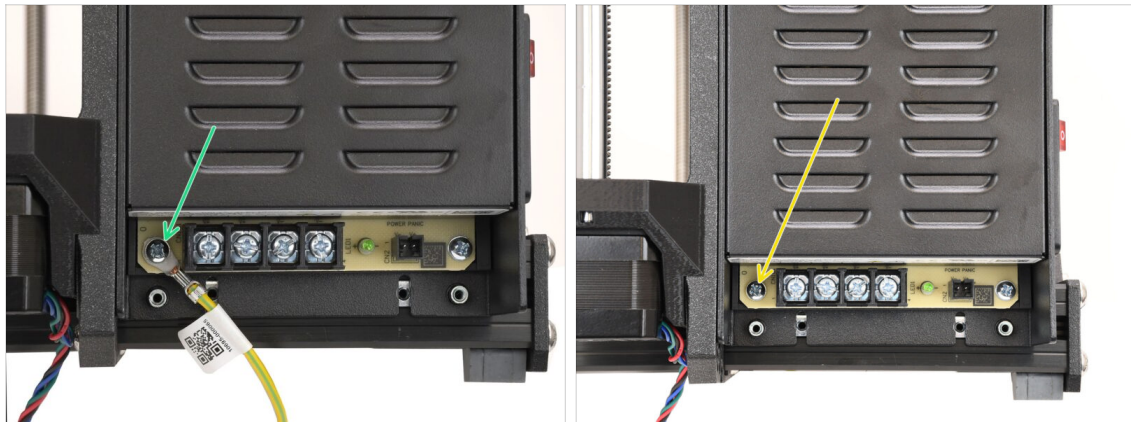

- Remove the screw holding the grounding cable to the PSU.
- Disconnect the grounding cable—it will no longer be needed.
- Re-install the screw you previously removed.

PASO 15 Extracción Fuente Alimentación 2




- On the front of the frame, remove the two screws holding the PSU.

⚠ The PSU might fall off to the side!

- Remove the PSU and **save it for later use**.

PASO 16 Extracción Base Calefactable

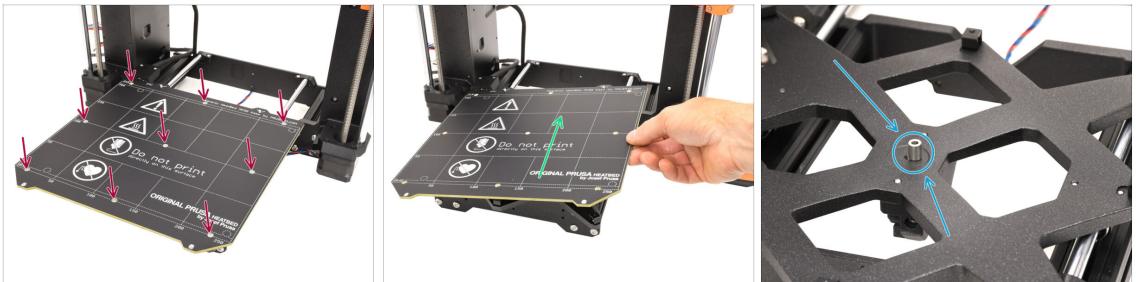

- Let's move onto the heatbed.

- Using the T10 Torx screwdriver, remove all 9 screws holding the heatbed.

- Remove the heatbed by lifting it up. **Save it for later use**.

- There is a spacer in the middle of the heatbed. Make sure to save it for later use too!


📌 Be careful and store the heatbed on a soft surface to prevent scratching it.

PASO 17 Extracción Eje Y




- Using the 2.5mm Allen key, remove the four screws holding the Y-axis rods to the front of the frame.
- Remove the four screws holding the Y-axis rods to the back of the frame.
- Remove the whole Y-axis assembly from the printer's frame.

PASO 18 Desmontaje Eje Y

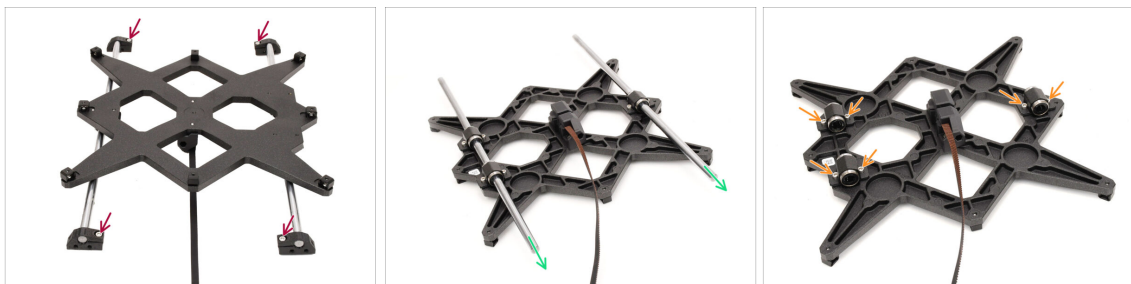

- Remove the four screws fixing the rods to the Y-rod holders. Then, remove the plastic rod holders.
- Turn the assembly around.
- Pull out both the Y-axis rods. Clean them up and **save them for later use**.
- Remove all the screws holding the bearings to the carriage.

PASO 19 Extracción Rodamientos

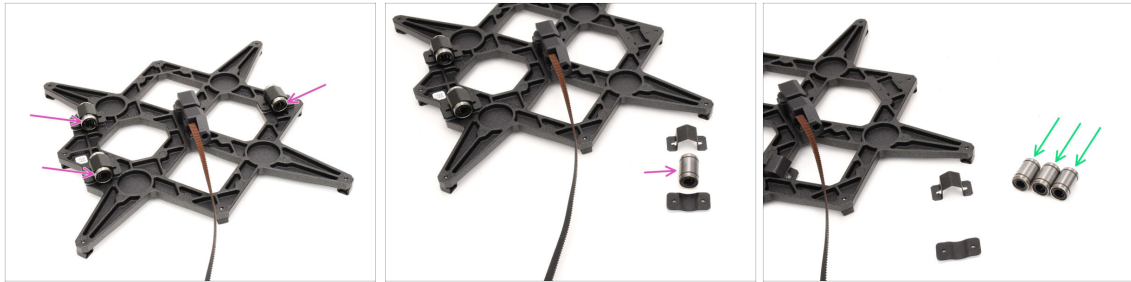


- ◆ Remove all three bearings from the bearing holders.
- ◆ Clean the bearings from any excess grease or dirt, and **save them for later use**.
- ❗ Two of this type of bearings will be used to build the CORE One.

PASO 20 Desmontaje Junta de Expansión




- ◆ Using the 2mm Allen key, remove all 8 expansion joints from the Y-Carriage.
- ◆ **Save the expansion joints for later use.**

PASO 21 Extracción Cubierta Extrusor

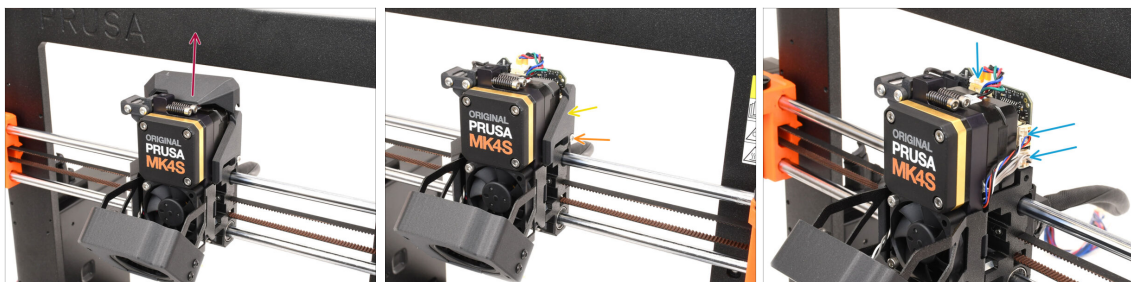


- ◆ Let's move onto the extruder.
- ◆ Remove the top cover on the extruder by lifting it up.
- ◆ Remove the screw holding the cover on the right side.
- ◆ Remove the side cover.
- ◆ Disconnect the motor, filament sensor and loadcell cables.

PASO 22 Extracción Conjunto Hotend

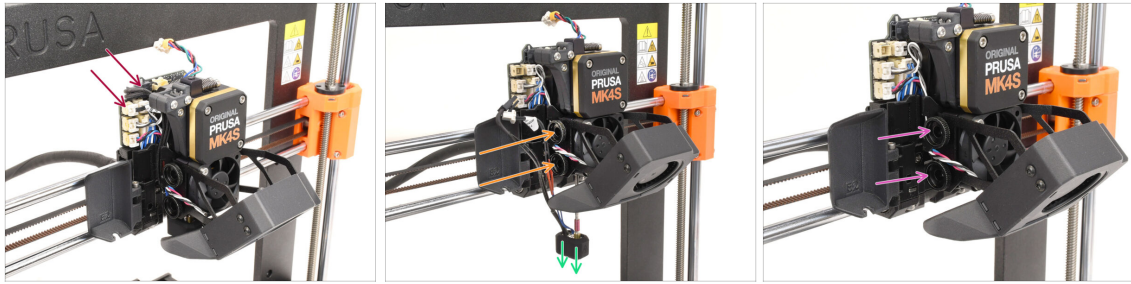


- On the opposite side, disconnect the nozzle thermistor and nozzle heater cables.
- Release the two thumb screws, until the hotend assembly drops.
- Remove the hotend assembly and **save it for later use**.
- Remove the two thumb screws and save them for later use.

PASO 23 Extracción Ventilador de Impresión

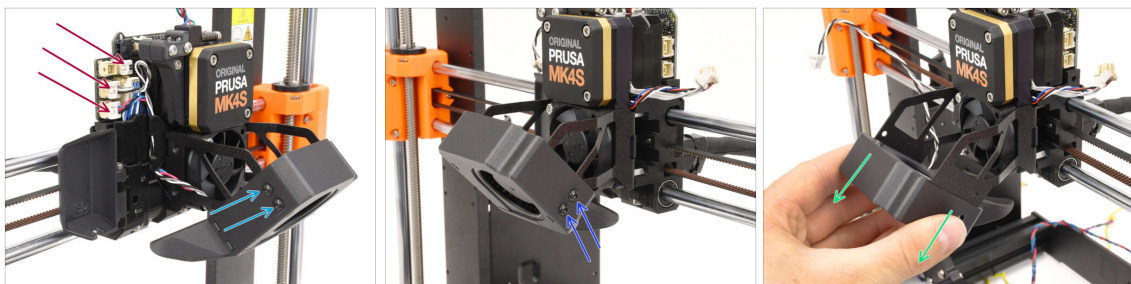

- Desconecta los cables en el lado izquierdo del Nextruder.
- Using the T10 screwdriver, remove the two screws holding the print fan on the left side.
- Remove the two screws on the right.
- Remove the print fan assembly by sliding it out. Proceed carefully to prevent damaging the cable going through the metal holder. **Save the fan assembly for later use!**

PASO 24 Extracción Ventilador Disipador

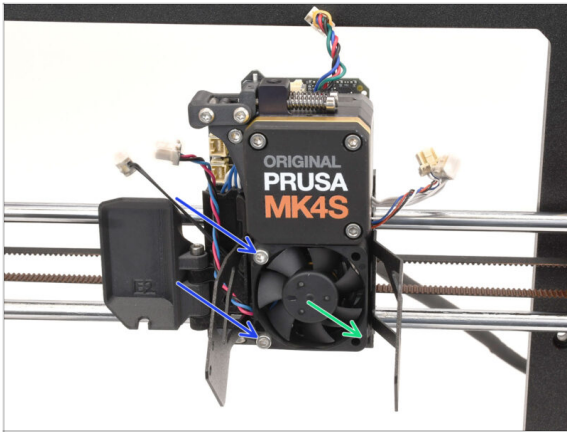


Retira los dos tornillos que sujetan el ventilador del hotend al disipador.

Remove the fan and **save it for later use.**



Proceed carefully to prevent damaging the cable.

PASO 25 Extracción Nextruder

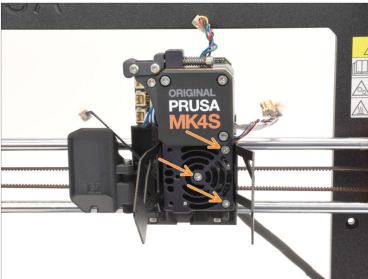

Remove the three screws holding the Nextruder to the X-carriage.


⚠ Watch out! The Nextruder might fall out!

Remove the Nextruder from the printer.

Remove the Print fan support and a plastic spacer (if present). Proceed carefully to prevent damaging the heatsink thermistor cable.


Save the Nextruder for later use.

PASO 26 Extracción LoveBoard

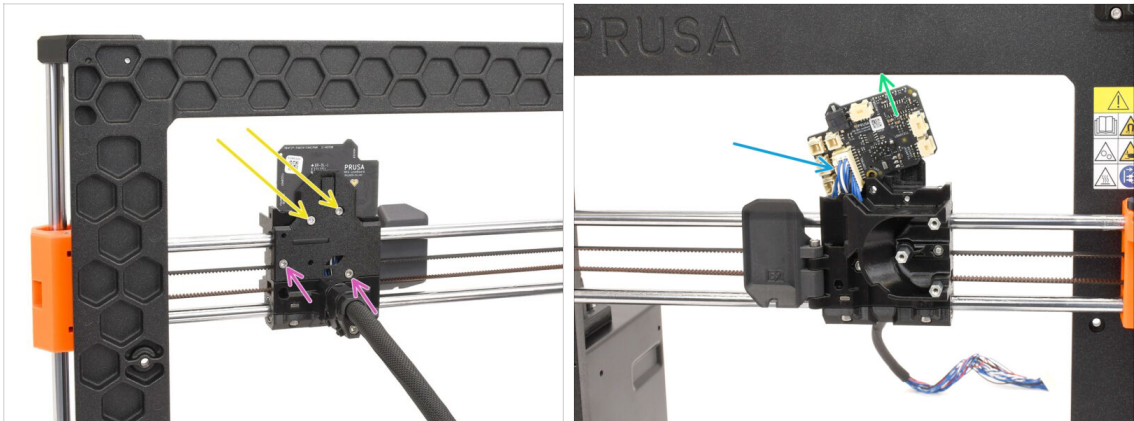


- Move onto the back of the X-carriage.
- Remove the two marked screws on top of the backing plate.
- Loosen the two remaining screws, but do not remove them entirely yet.
- Lift the Loveboard slightly to disconnect it from the main cable. Proceed carefully to prevent any damage to the Loveboard.
- **Remove the Loveboard and save it for later use.**

PASO 27 Extracción Motores Z

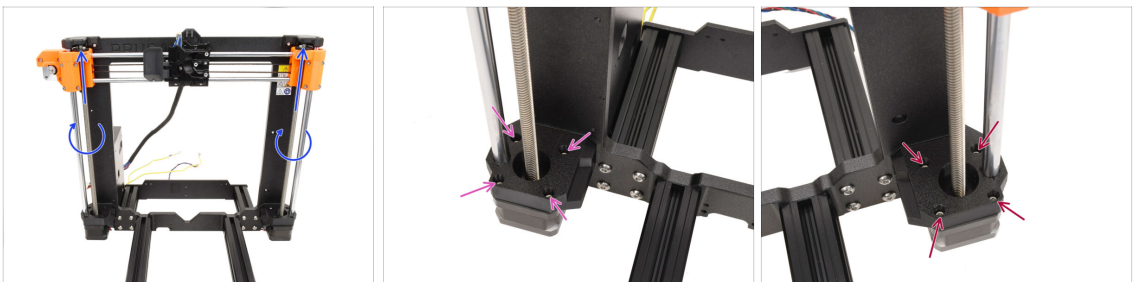


- Gira ambas varillas roscadas con la mano para desplazar el conjunto del eje X hasta la parte superior.
- Using a ball-end 2.5mm Allen key, remove all 4 screws securing the left Z motor.
- Remove the 4 screws holding the right Z motor as well.

PASO 28 Z Motors Removal 2

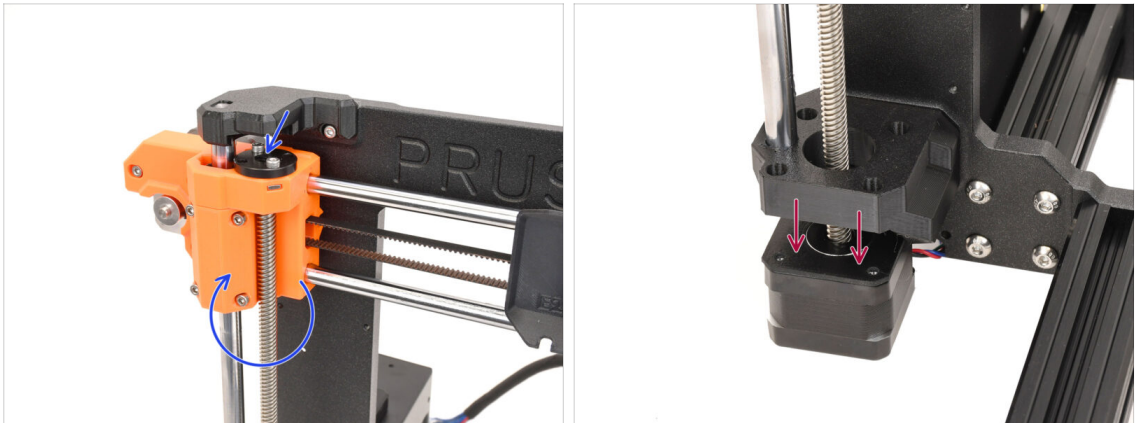


- Rotate the threaded rods on both sides to disengage both the motors from the trapezoid nuts on the X-End parts.
- Disengage the motors on both sides from the holders. The X-axis will drop slightly.

PASO 29 Z Motors Removal 3

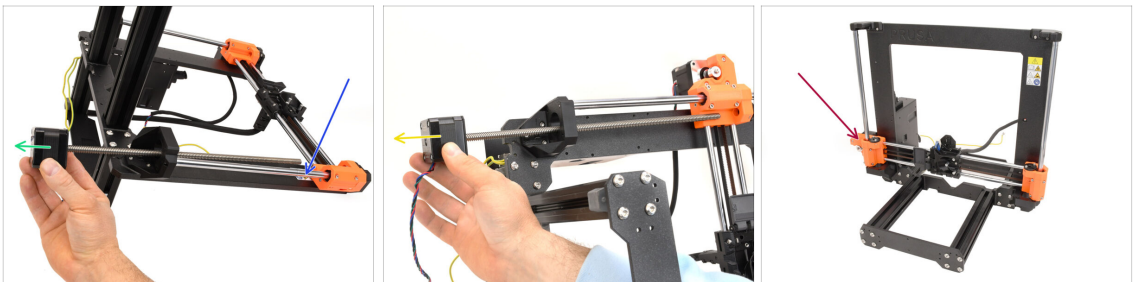


- Lay the frame onto its back part.
- Remove the right Z motor by sliding it out. **Save it for later use.**
- Remove the left Z motor. **Save it for later use.**
- Move the frame back to the original position. **Expect that the X-axis now moves freely and may fall rapidly.**

PASO 30 Extracción Varillas Z

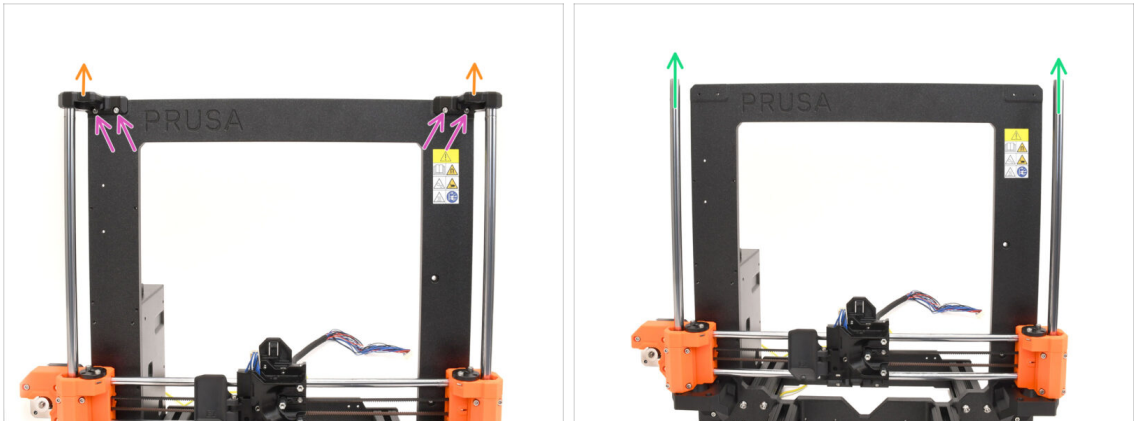


- ✿ Remove the four screws holding the Z-top parts on both sides.
 - 🟠 Remove both Z-tops by pulling them up and disengaging from the rods.
 - 🟢 Pull up both Z rods and remove them from the printer.
Save both rods for later use.
- 📌 A slight wiggling motion may help to disengage them from the plastic part.

PASO 31 Extracción Tuerca Trapezoidal

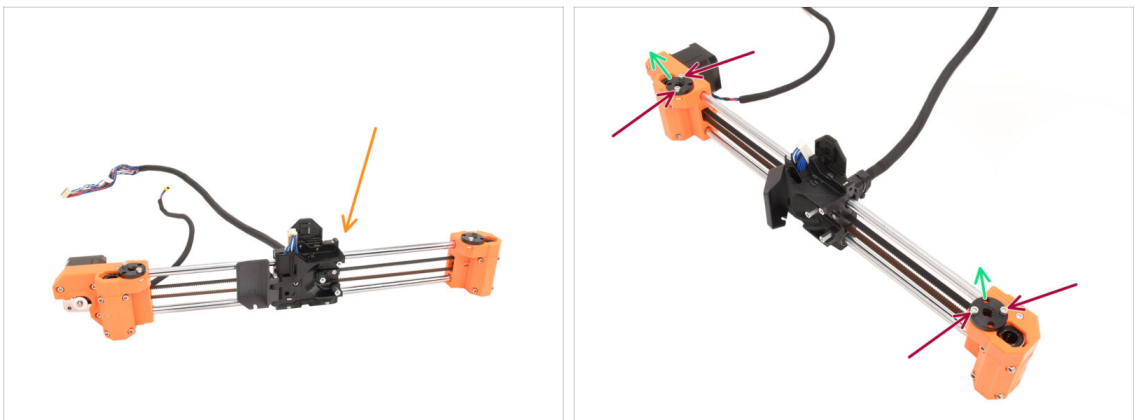


- 🟠 Remove the X-axis assembly from the printer's frame.
 - 🔴 Remove the four screws holding the trapezoid nuts on top of both sides of the assembly.
 - 🟢 Remove both the trapezoid nuts and **save them for later use.**
- 📌 If the nuts are hard to remove, try rotating them, while pulling them up. If that doesn't help, carefully use the threaded rod on one of the Z-motors, to pry them out.

PASO 32 Extracción Motor X

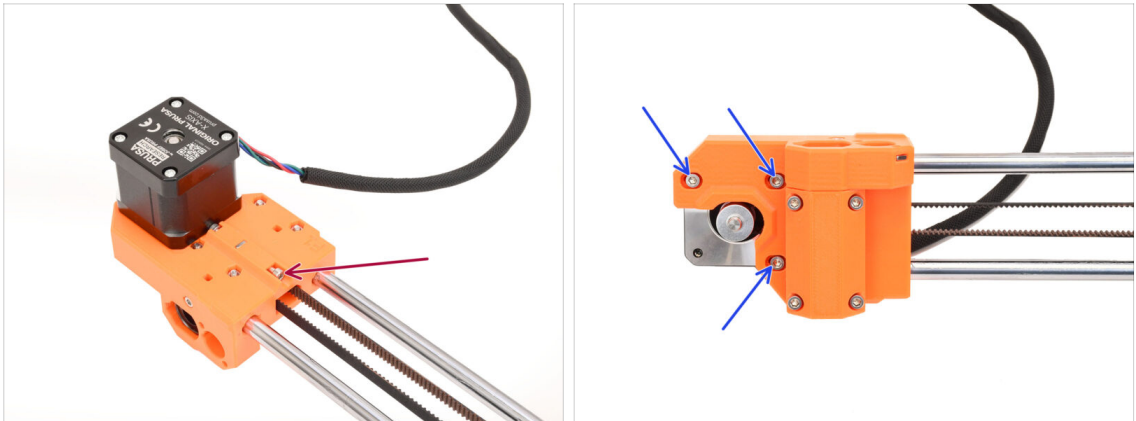

- On the back of the assembly, remove the belt tensioning screw
- Loosen the three screws holding the motor on the front.
- ⓘ We need to release the belt tension, in order to release the belt in the upcoming step.

PASO 33 Extracción Correa X

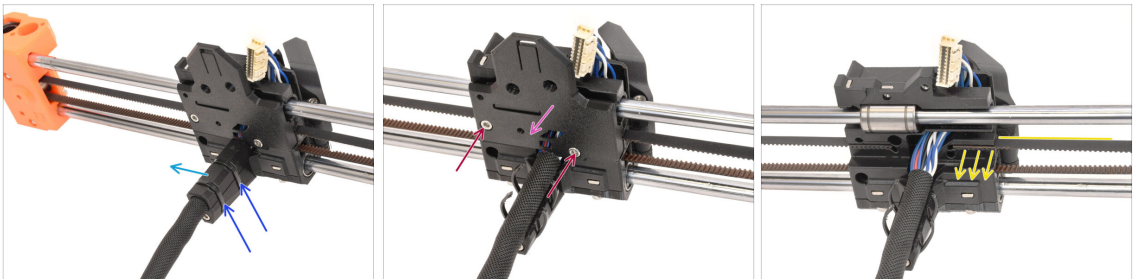


- On the back of the assembly, cut both the zip-ties holding the cable cover.
- Remove the cable cover.
- Remove both screws on the back of the X-carriage.
- Remove the cover on the back of the X-carriage.
- Pull out the end of the belt on the motor side, to disengage it.

PASO 34 Extracción Motor X



- Remove the three screws holding the X-motor at the front of the assembly.
- Remove the X-Axis motor and **save it for later use**.

PASO 35 X Idler Shaft Removal

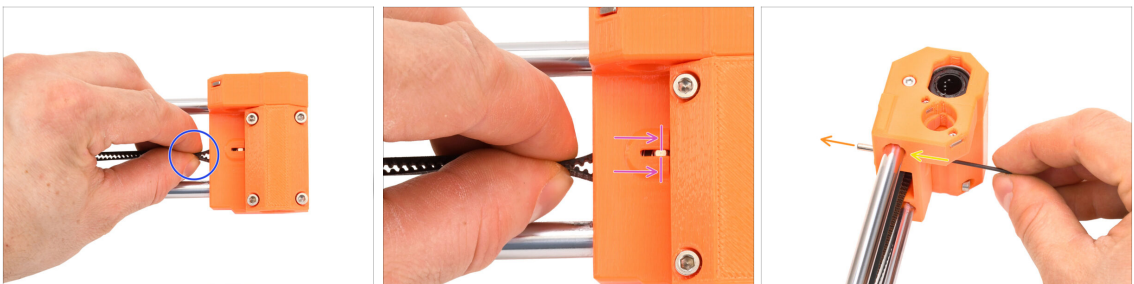

- Let's move onto the right X-end part.
- Use the belt as a handle for the Idler pulley inside the plastic part.
- Move the Idler **all the way inward**.

On the front, there is a small window where you can observe the idler shaft movement.


- While keeping the idler pushed all the way in, use the thinnest 1.5mm Allen key to push the shaft out of the part.
- The Idler shaft should exit the plastic part at the back. Remove it.

PASO 36 Desmontaje Tensor X



- Pull out the Idler pulley.
- Save the pulley for later use.

PASO 37 Extracción xBuddy

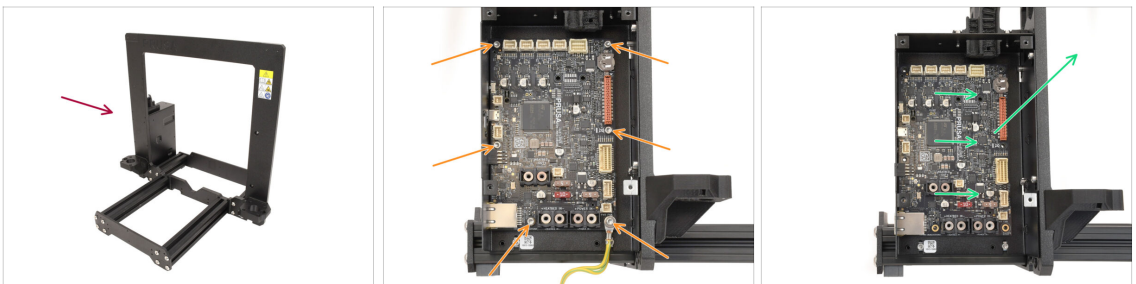

- Let's move back to the printer's frame.
- Remove the six screws holding the xBuddy board in place.
- Release the xBuddy by sliding it towards the frame, then lifting it. **Save it for later use.**

2. Montaje de la base




PASO 1 Tools necessary for this chapter




- For this chapter, please prepare:
- Llave plana 13-16
- Llave Allen de 2.5mm
- T10 torx key / T10 torx screwdriver

PASO 2 Base assembly: parts preparation

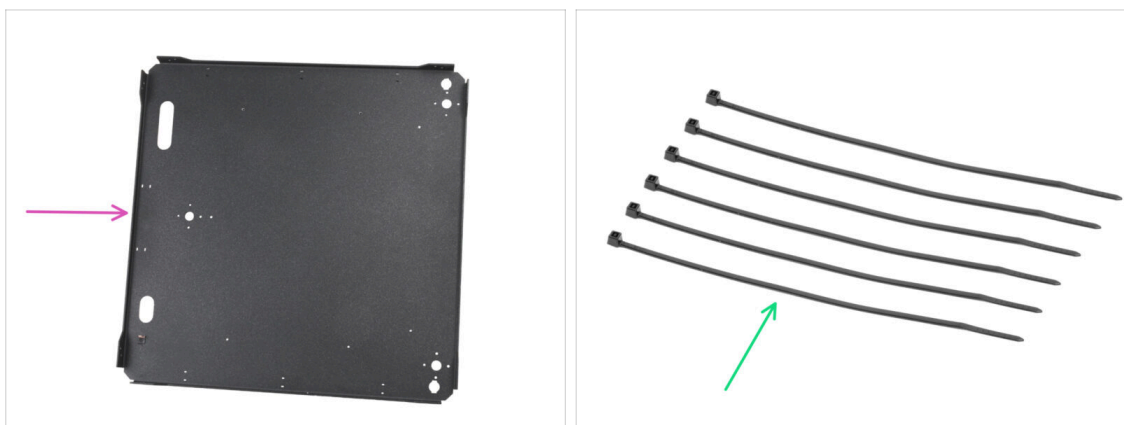

- For the following steps, please prepare:
- Bottom panel (1x) found in the Metal parts 1/3 package
- Zip tie (6x) found in the Electronics & Fasteners package

PASO 3 Inserting the zip ties

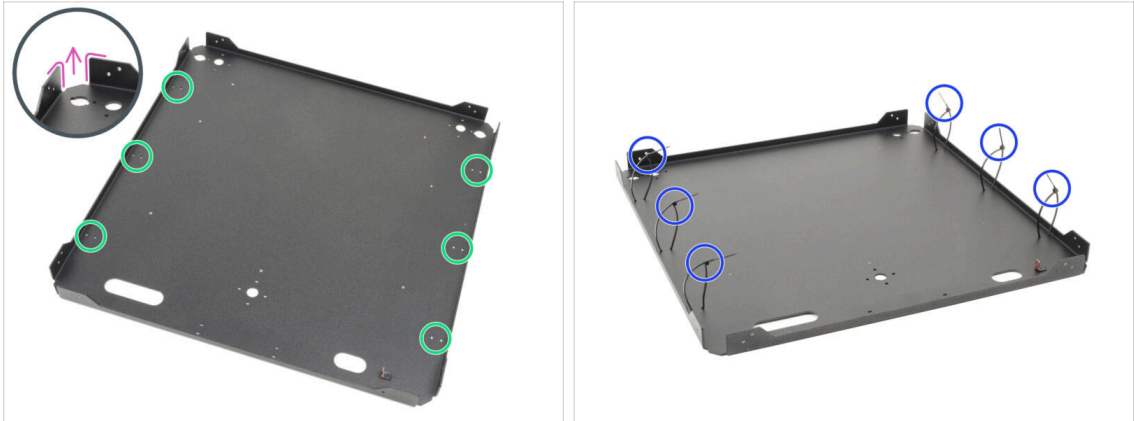


- ✦ Turn the bottom panel so that the bends of the plate are facing upwards.
- ✦ Note the twin holes for the zip ties around the perimeter of the panel.
- ✦ Insert six zip ties through the holes, placing them along both sides and partially tightening them, engaging only the first few teeth.
- ⚠ **Do not fully secure them yet, as we will route cables through them later.**
- ℹ Note: The orientation of the zip tie heads (inside or outside the metal sheet) doesn't matter.

PASO 4 Base assembly: parts preparation



- ✦ **For the following steps, please prepare:**
- ✦ Z-axis left motor (2x)
 - 📌 One of these motors is in the electronics & chamber parts box.
- ✦ Z-axis right motor (1x)
- ✦ Z-motor-mount (3x) *found in the Printed parts package*
- ✦ Motor washer (3x) *found in the Electronics & Chamber parts package*
- ✦ Z-rod-mount (2x) *found in the Printed parts package*
- ✦ M3x8 screw (24x) *found in the Electronics & Fasteners package.*

PASO 5 Installing the motor mounts

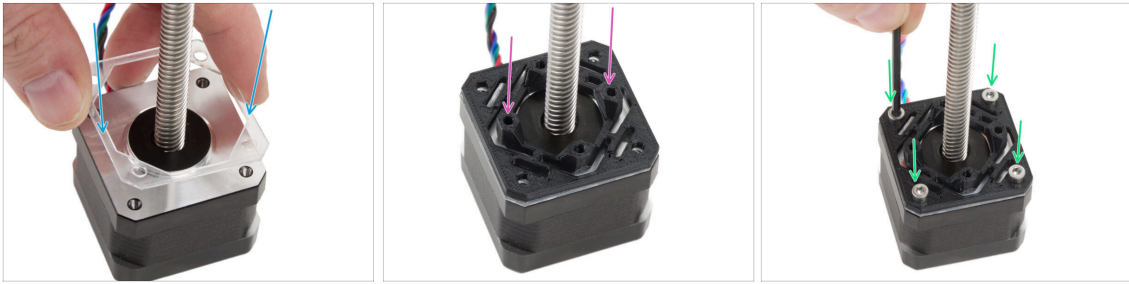


- Attach one transparent motor washer pad on each Z motor.
- Place one Z-motor-mount on each motor washer. **The protrusions on the part must be facing upwards.**
- Align holes with all the parts.
- Join all parts together with four M3x8 screws.
- Follow the same procedure for all motors.

PASO 6 Installing the rear motor



- Turn the bottom panel upside down.
- Locate the circle hole in the middle of the panel back side.
- Take the **Z motor right** - the motor with the longest cable. Labeled ZR on the cable.
- Push the motor threaded rod through the panel and align the holes in the panel with the holes in the motor assembly.
- ⚠ **The motor cable must point outwards (towards you).**
- Push both Z-axis motor left through the bottom panel.
- **The motor cables must point to the rear motor side.**
- ❗ In the following instructions, we will refer to the **front** and **rear** sides of the assembly. The **front side** has **TWO** motors, while the **rear side** has **ONE** motor. We will remind you along the way, but it's good to keep this in mind :).

PASO 7 Securing the rear motor

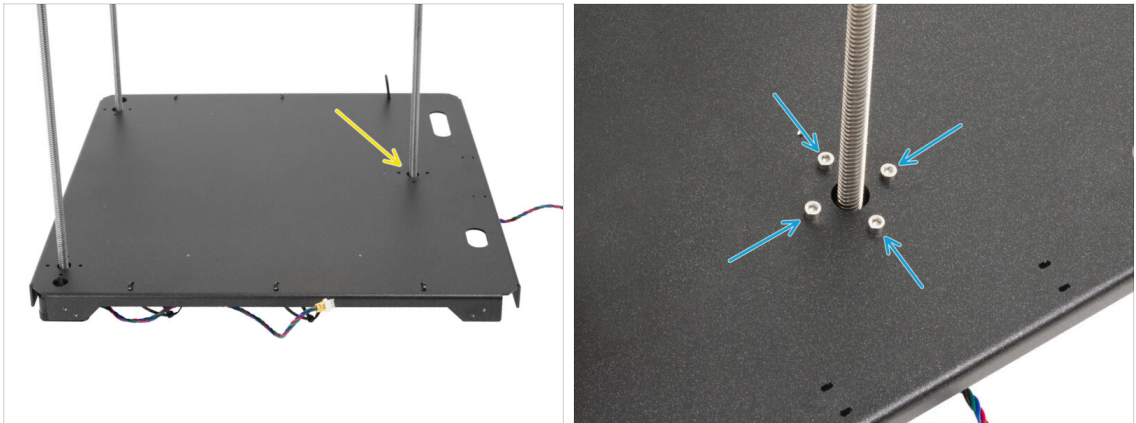


- ✦ Begin securing the motors, starting from the rear motor.
- ✦ Insert and fully tighten four M3x8 screws into the **rear motor**.
 - ⚠ Make sure the screws stay straight and do not tilt as you tighten them.
 - ⚠ Do not overtighten the screws, as they thread directly into the plastic part. For a final tightening, use the shorter part of the key as a handle to apply the correct amount of torque.

PASO 8 Installing the front motor right



- ✦ First, insert the rod-mount into the opening next to the front right Z motor.
- ✦ Use the 13-16 wrench to rotate the rod mount 90 degrees, locking it into place.
- ✦ Secure the motor using four M3x8 screws. Tighten them completely.
 - ⚠ Make sure the screws stay straight and do not tilt as you tighten them.

PASO 9 Installing the front motor left

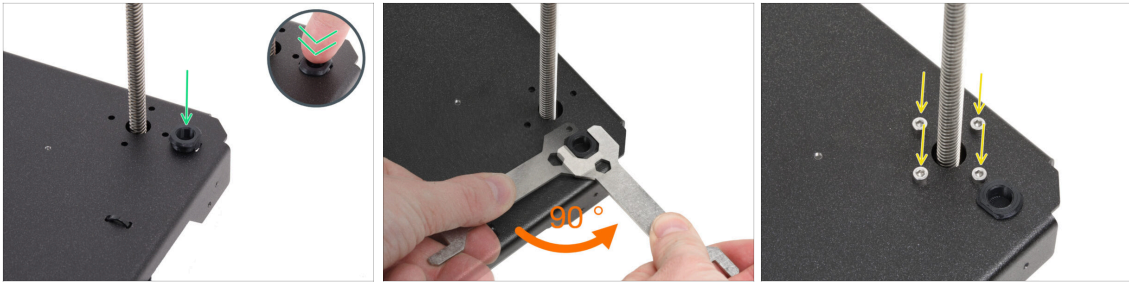


- Let's move to the front left motor (from the front view).
- ⚠ **Ensure, the motor cable still points to the rear side.**
- Insert the rod-mount into the opening next to the front right Z motor.
- Use the 13-16 wrench to rotate the rod mount 90 degrees, locking it into place.
- Secure the motor using four M3x8 screws. Tighten them completely.
- ⚠ **Make sure the screws stay straight and do not tilt as you tighten them.**
- Place the whole assembly aside for a while.

PASO 10 Bottom frame: parts preparation



- **For the following steps, please prepare:**
- ⚠ **Be very careful when handling sharp sheet metal parts to avoid injury or damage.**
- ⚠ **Metal sheet profiles may look identical at first glance, but there are some differences. DOUBLE-CHECK to pick the correct ones.**
- Front profile (1x) **notice the cutouts** - found in the Metal parts 1/3 package
- Rear profile (1x) **with two holes on the flat side** - found in the Metal parts 1/3 package
- Universal profile (2x) **no holes on the flat side** - found in the Metal parts 1/3 package
- Spacer pin (2x) found in the Electronics & Fasteners package
- Tornillo M3x4rT (4x)

PASO 11 Assembling the bottom profile: front + left

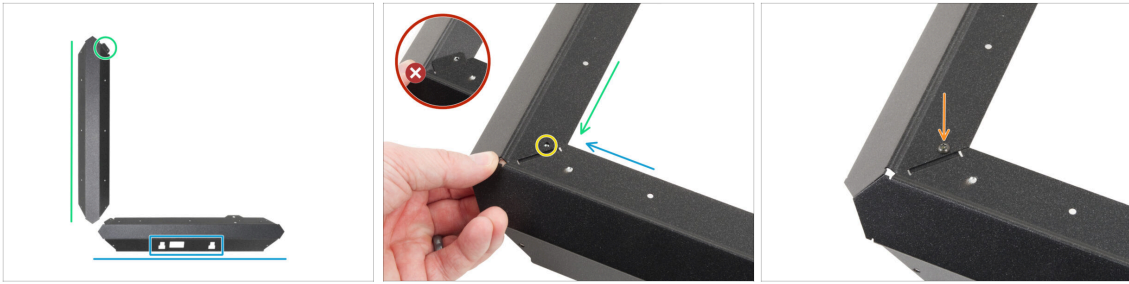

 Be very careful when handling sharp sheet metal parts to avoid injury or damage.


-  Place the front profile according to the picture. The cutouts must be facing you.
-  Place one of the universal profiles on the left side. Orient the part according to the picture. **Use the flange as a guide.**
-  Attach the two profiles together.
-  The flange of the front plate (blue arrow) must be inserted **under** the left universal profile (green arrow), not on top of it.
-  Align the holes in both parts.
-  Join both parts together with the M3x4rT screw.

PASO 12 Assembling the bottom profile: left + rear



-  According to the picture, place the rear profile (with two holes on the flat side) to the universal left profile. Orient the part according to the picture. **Use the flange as a guide.**
-  Join the rear profile with the universal left profile together.
-  Make sure the flange is under the rear profile, not on top.
-  Align the holes in both parts.
-  Join both parts together with the M3x4rT screw.

PASO 13 Assembling the bottom profile: right

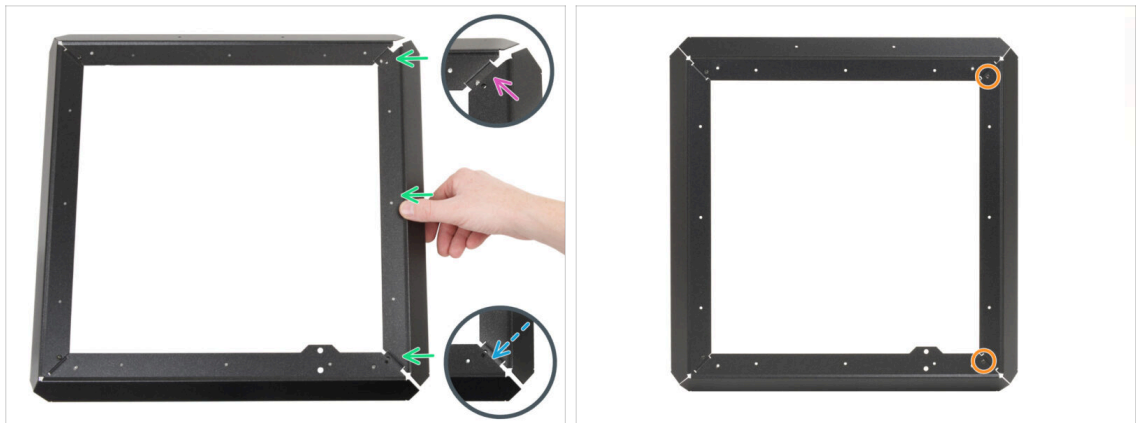


- Attach the universal right profile between the rear and front profile. **Ensure that:**
 - The **rear** end is **above** the rear profile flange.
 - The **front** flange is inserted **under** the front profile.
- Secure the left profile with M3x4rT on both ends.

PASO 14 Inserting the spacer pins



- Insert the spacer pin into the hole in the front profile protrusion.
- Push firmly on the spacer pin so that it fits perfectly into the hole.
- Use the same procedure for the second spacer pin.

PASO 15 Anti-vibration feet: parts preparation

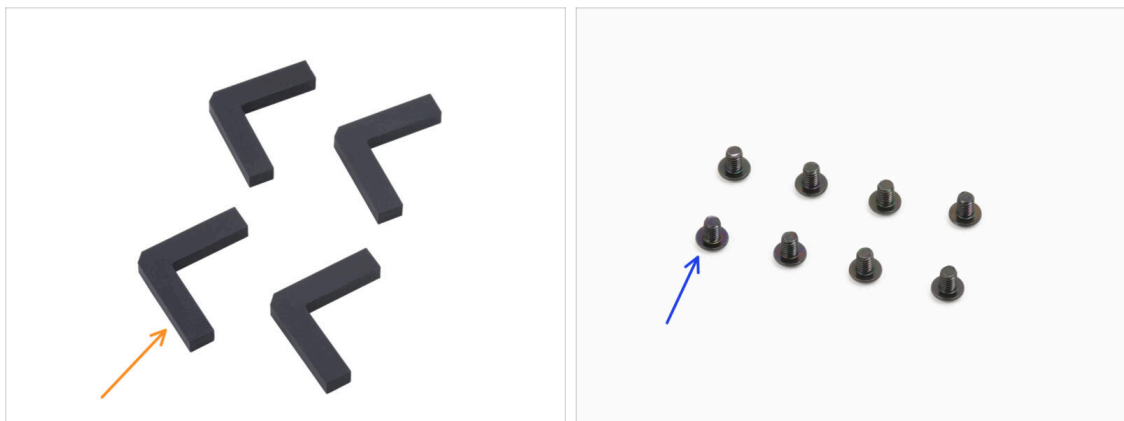

● For the following steps, please prepare:

- Anti-vibration foot (4x) found in the *Electronics & Chamber parts package*
- Tornillo M3x4rT (8x)

PASO 16 Installing the anti-vibration feet



- Place the bottom frame according to the picture. The front profile must be facing you.



Antes de colocar los pies antivibración, **limpia los perfiles metálicos con alcohol isopropílico** y déjalos secar. Esto garantiza una adhesión adecuada.

- Peel off the protective layer from all anti-vibration feet.

⚠ Retira con cuidado **solo la película protectora** de cada pie antivibración. Si la capa adhesiva comienza a desprenderse con la película, detente y retira la película desde otra esquina.

- Stick one anti-vibration foot in each corner of the frame. Align it with the outer edge of the flat side of the profile.

PASO 17 Installing the bottom frame




- 🔵 Turn the bottom frame upside down. **The front profile must be facing you.**
- 🟡 Attach the rear side of the bottom panel assembly to the rear side of the bottom frame.
- 🟠 Ensure that the front side of the bottom panel assembly (with two motors) aligns with the front profile of the bottom frame (with cutouts).
- 🟣 Place all the motor cables inside the center area of the bottom frame to prevent pinching.
- 🟢 Slowly and carefully lower the bottom panel assembly into the bottom profile.
 - ⬛ Ensure the assembly fits completely **inside the bottom profile.**
 - ⬛ Make sure no part of the bottom panel assembly extends outside the bottom frame
- ⚠️ **Double-check that no cables are pinched.**

PASO 18 Mounting the bottom frame: right side




- ⬛ Focus on the front right corner and right side.
- 🟡 Slightly lift one of the corners of the bottom panel assembly.
- 🟢 Align the threaded hole in the bottom panel with the hole in the profile.
- 🟢 Join both parts together with the M3x4rT screw.
- ⬛ Move to the rear corner of the right side.
- 🟣 Align the holes in the base and the profile and secure it with the M3x4rT screw.

PASO 19 Mounting the bottom frame: rear + left + front

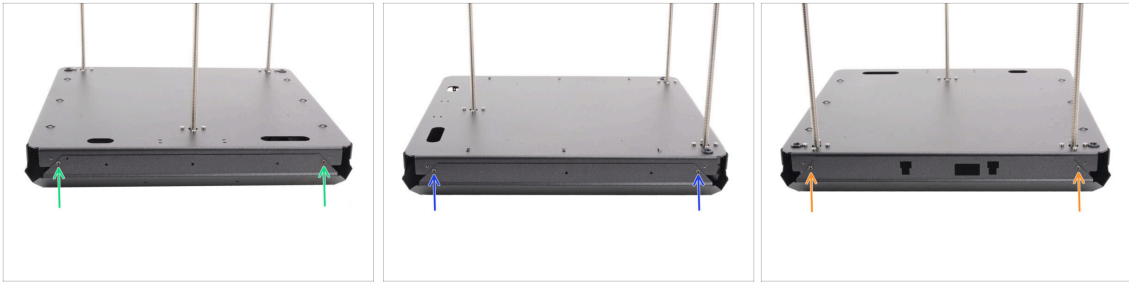

- Move to the rear side of the assembly (side with one Z motor).
- Align holes in the base assembly and the profile and secure it with two M3x4rT screws.
- Focus on the left side of the assembly.
- Align holes in the base assembly and the profile and secure it with two M3x4rT screws.
- Turn the assembly with the front profile facing you (profile with cutouts).
- Align holes in the base assembly with the profile and secure them using two M3x4rT screws.

PASO 20 Memento Haribo

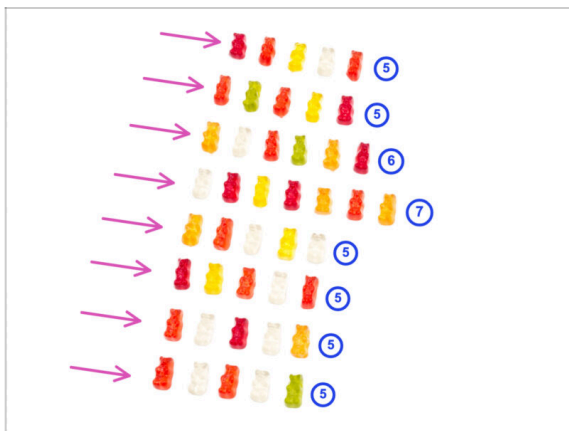

- It's time to reward yourself!
- Stack your gummy bears in eight rows.
- Arrange the number of gummy bears in each row as shown in the picture.
- ① If you don't get the exact number in the last row, we recommend finding the nearest candy store and buying the missing ones.
- Eat the first row.

PASO 21 Listo




- **Congratulations!** You just assembled the **base assembly**.
- Set the assembly aside for now and let's move to the next chapter.

3. Montaje trasera




PASO 1 Herramientas necesarias para este capítulo

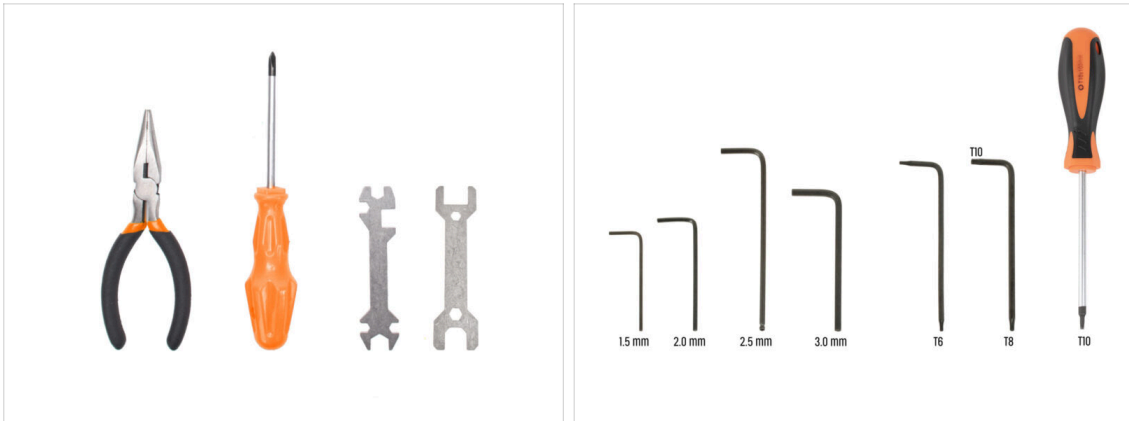


- **For this chapter, please prepare:**
- Philips (PH2) screwdriver
- Needle-nose pliers
- 2.5mm Allen key
- T10 torx key / T10 torx screwdriver

PASO 2 xBuddy: preparación de piezas I.

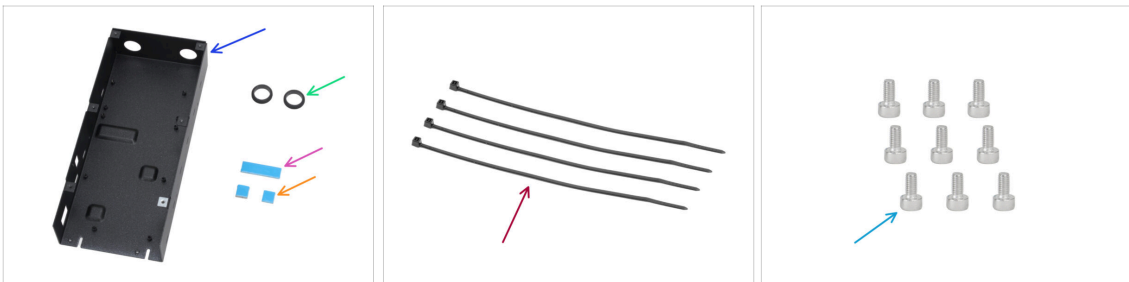


- **For the following steps, please prepare:**
- CORE One xBuddy box (1x) found in the Metal parts 3/3 package
- Grommet 19/16 mm (2x) found in the Electronics & Fasteners package
- Thermal pad 40x12x2.2 mm (1x) found in the Electronics & Fasteners package
- Thermal pad 12x12x2.2 mm (2x) found in the Electronics & Fasteners package
- Zip tie (4x)
- M3x6 screw (9x)
- **i** La lista continúa en el siguiente paso...

PASO 3 xBuddy: preparación de piezas II.

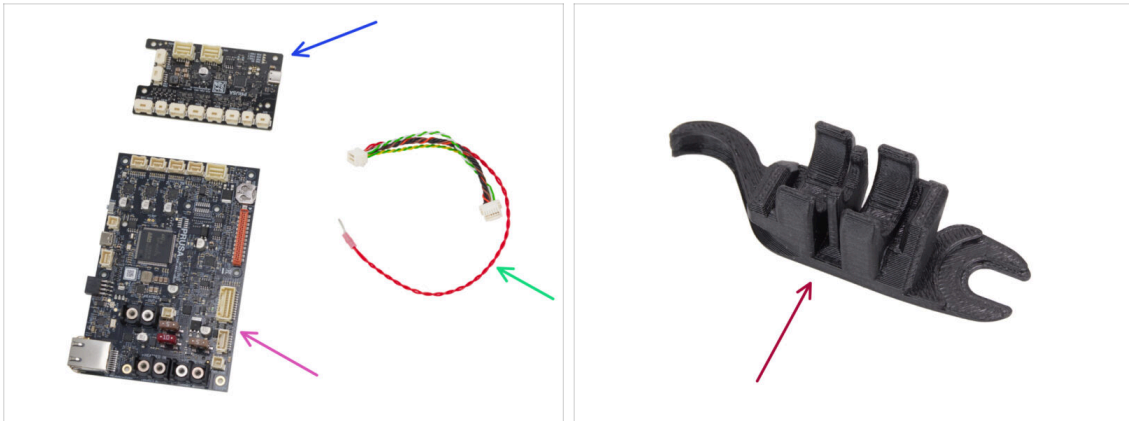


- xBuddy extension board (1x) *found in the Electronics & chamber package*
- xBuddy board (1x)
- xBuddy extension cable (1x) *found in the Electronics & Fasteners package*
- Assembly-multi-tool (1x) *found in the Printed parts package*

PASO 4 Applying the thermal pads

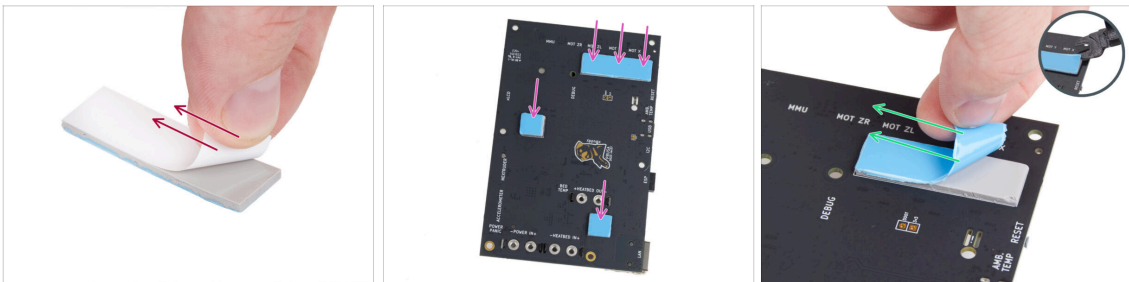

- Peel off the white protective layer from all thermal pads.
- ⚠ **Always touch the sides of the electronics board while manipulating it. Avoid touching the chips, capacitors and other parts of the electronics.**
- Attach the pads onto the back of the xBuddy board. There are markings that indicate the correct size and positions.
- ⓘ Ensure the pad attachment surface is clean and degreased.
- ⚠ **For the protection of the board's electronic components, we strongly recommend placing the xBuddy board on the soft pad. You can use the original xBuddy bubble wrap package.**
- Peel off the blue protective layer from all thermal pads.
- ⓘ Consejo pro: Si el borde de la capa es difícil de levantar, puedes utilizar el lado fino de la Assembly-multi-tool para ayudar a separar la capa protectora.


PASO 5 Installing the xBuddy

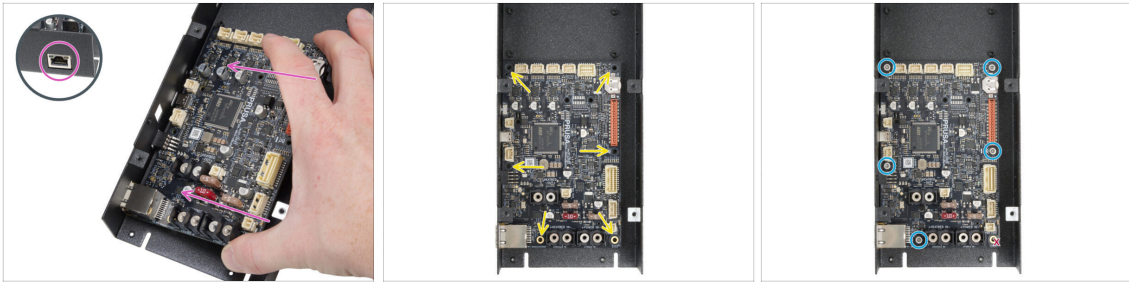

⚠ Always touch the sides of the electronics board while manipulating it. Avoid touching the chips, capacitors and other parts of the electronics.


- ✿ Insert the xBuddy board to the xBuddy box.
 - Make sure the Ethernet connector is properly inserted into the hole in the xBuddy box.
- ✿ **Before fully securing, align the board's holes with the xBuddy box's threaded standoffs.**
- ✿ Fix the position of the xBuddy board by inserting five M3x6 screws. Do not fully tighten the screws. A few turns are enough for now.
- ⚠ **Put aside your instinct and leave the hole on the bottom right empty.**
- **Aprieta a fondo los cinco tornillos. Pero con mucho cuidado, de lo contrario puedes dañar la placa de la electrónica.**

PASO 6 Installing the xBuddy extension

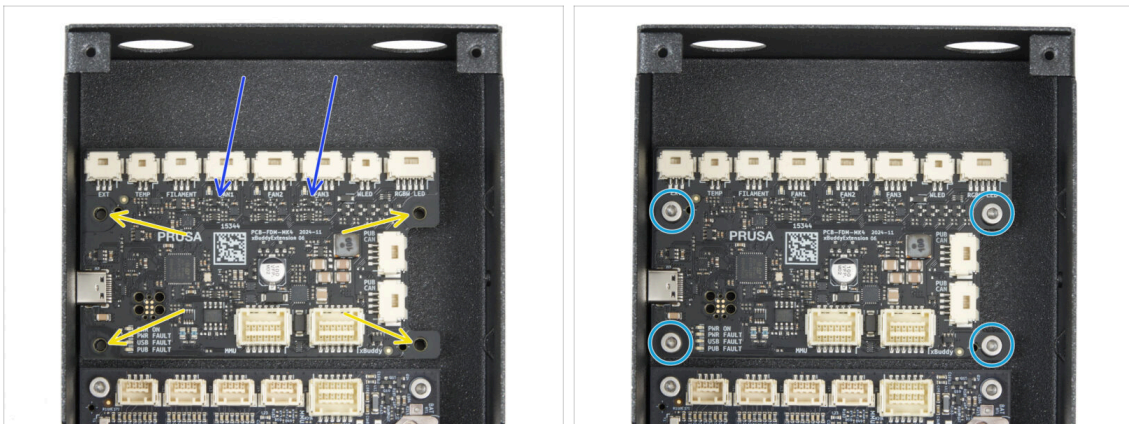


- ✿ Insert the xBuddy extension board to the xBuddy box above the xBuddy board. Notice the part orientation.
- ✿ Before fully attaching it completely, center the holes in the board with the holes (columns) in the xBuddy box.
- ✿ Fix the position of the xBuddy extension board by inserting four M3x6 screws. Tighten them completely.

PASO 7 Instalando las bridas

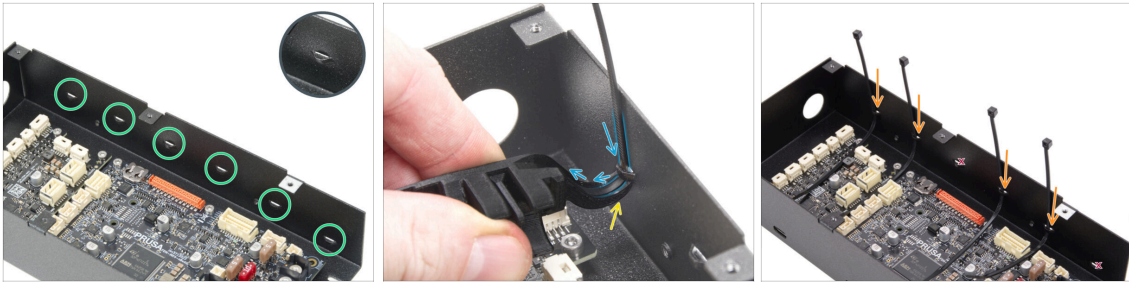

- Take a closer look at the xBuddy box. There are six perforations on the metal case.
- ⚠ Proceed very carefully. Be careful not to damage the connectors or capacitors on the xBuddy board.**
- Attach the hook on the Assembly-multi-tool below the first perforation on the left.
- Push the zip tie through the perforation and into the Assembly-multi-tool. It will guide the zip tie into the electronics box.
- ⚠ Note the correct orientation of the zip tie. The teeth on the zip tie must be on the visible side.**
- Repeat the process at the indicated perforations.
- Omite la tercera y sexta perforaciones.

PASO 8 Connecting the xBuddy extension board

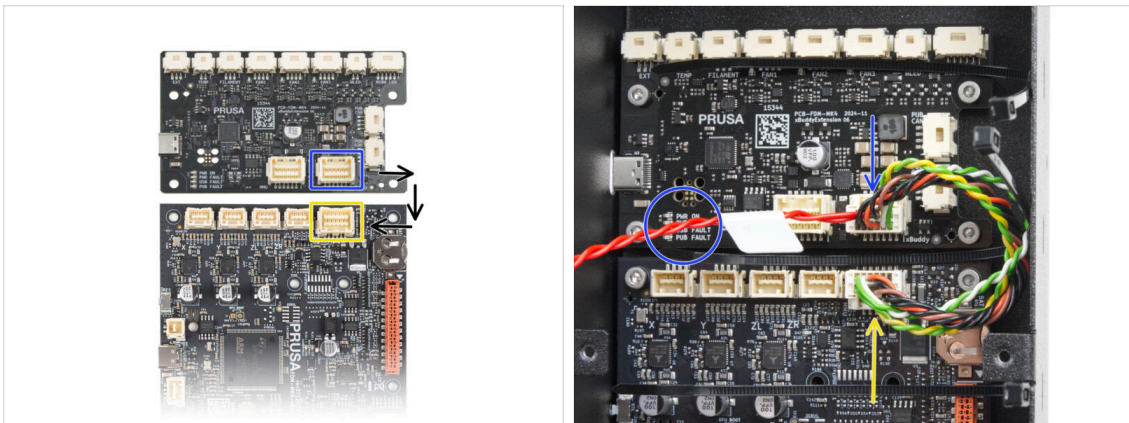

- Plug the xBuddy extension connector with the free red cable to the xBuddy extension board.
- Leave the red cable free for now.
- Plug the other end of the xBuddy extension cable to the xBuddy board.

PASO 9 Inserting grommets: xBuddy box




- Insert both grommets into both circle holes in the xBuddy box.
- Gently compress the grommet and fit it into the metal sheet, ensuring the groove locks into place

PASO 10 Wi-Fi: parts preparation




- For the following steps, please prepare:
- ESP-WiFi (1x) reused from the MK4S
- CORE-One-Wifi-cover (1x) found in the Printed parts package
- M3x12 screw (1x)
- Tornillo M3x6 (2x)

PASO 11 Assembling the Wi-Fi

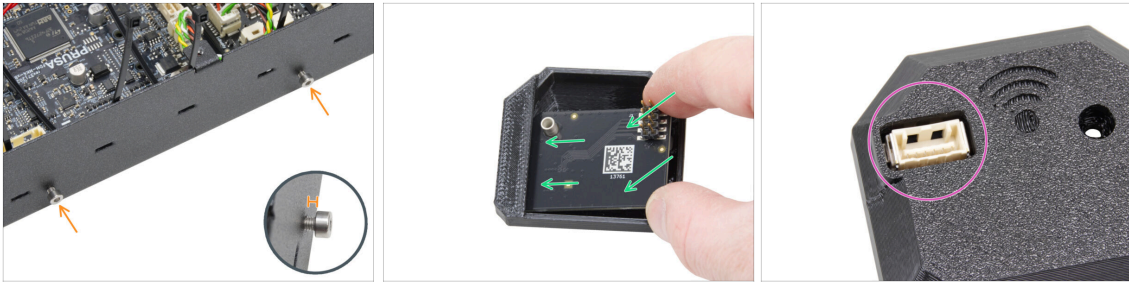


- ✚ Insert two M3x6 screw to the xBuddy box assembly from the right side. **Do not tighten them completely.** Leave at least a 4 mm (0.16 in) gap.
- ✚ Insert the ESP-WiFi module into the WiFi-cover, positioning it just below the bridge on the left side.
- ✚ On the other side, ensure the connector fits correctly into the hole in the cover.

PASO 12 Installing the Wi-Fi assembly

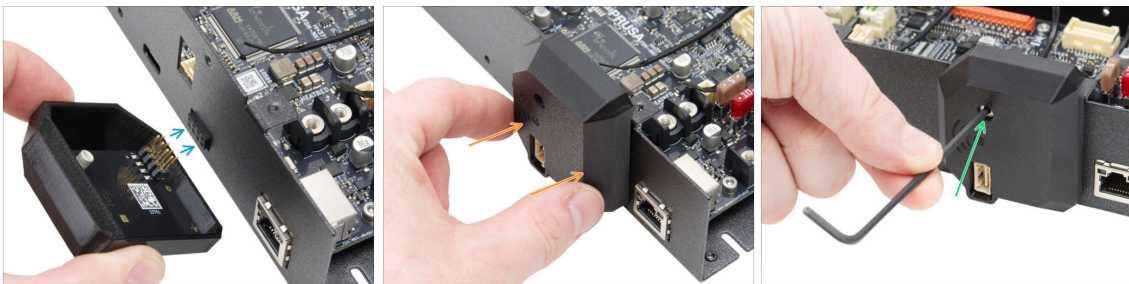

- ⚠ **Be very careful when handling and connecting the ESP module to avoid bending and damaging the pins.**
- ✚ Take the WiFi cover assembly and connect the ESP module pins to the connector in the xBuddy.
- ✚ Close the WiFi cover carefully, ensuring the pins of the ESP module are properly engaged in the connector on the xBuddy.
- ✚ Secure the cover with the M3x12 screw.
- ⬛ Put the assembly aside for a while.

PASO 13 PSU assembly: parts preparation

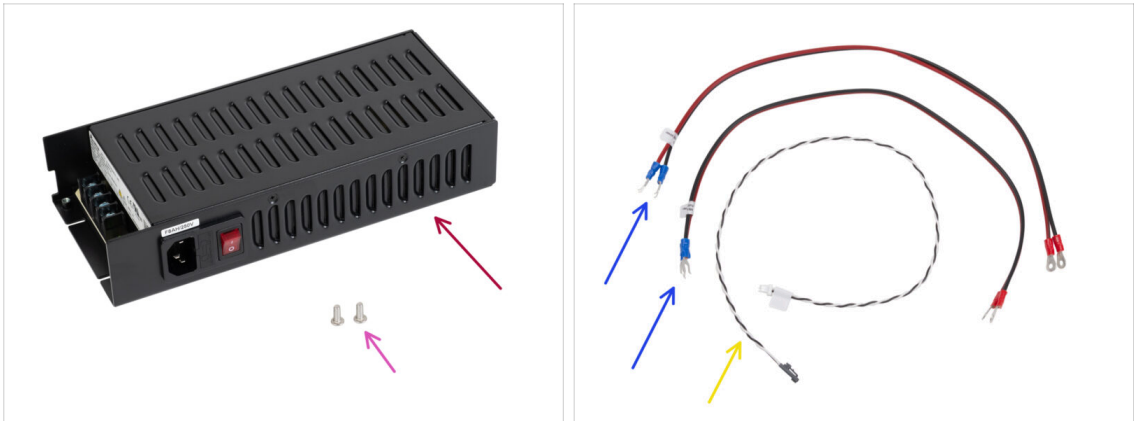


For the following steps, please prepare:

- Delta PSU 240 W 24 V (1x) power supply
- M4x6r screw (2x)
- xBuddy power cables (2x)
- Power panic cable (1x)


i El cable de alimentación puede tener un aspecto diferente, dependiendo de la versión de tu impresora MK4S / placa xBuddy.

PASO 14 Preparing the PSU

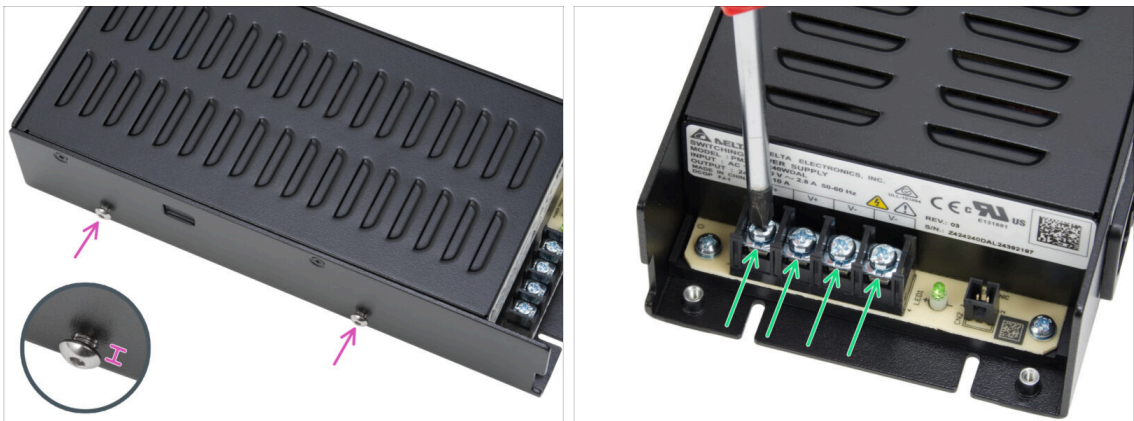

- Insert two M4x6r screws into the left side of the PSU. **Do not tighten them completely.** Leave at least a 4 mm (0.16 in) gap between the screw head and the PSU.
- Slightly loosen all four power terminal screws on the PSU. **Do not remove them.** 3-4 turns are enough.


PASO 15 Power cables info

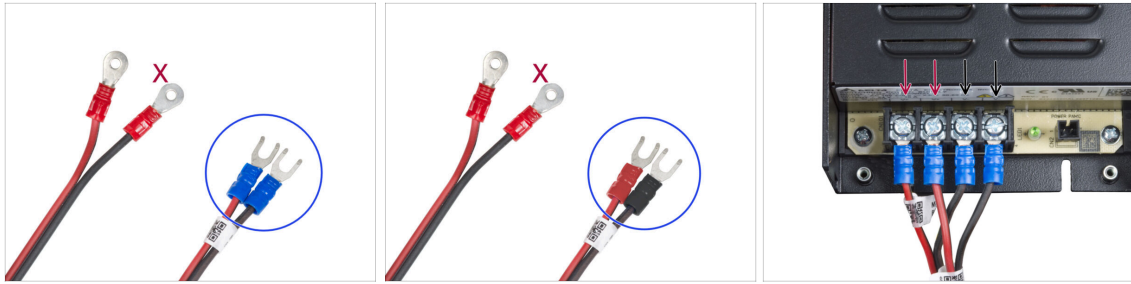

- ⓘ In the following steps, we will be connecting the power cables one by one. The terminal screws are installed on the PSU already. Loosen them but **don't remove them completely** so they don't get mixed up with the other type of screws used on the xBuddy board side of the cable. Each of the two power cables has two leads. One has a prevailing **red color = positive / +**
One has a prevailing **black color = negative / -**
- 🔵 Note that the power cables have different connectors on each end. For now, prepare the U-shaped connectors (crimping tube color may vary).
- ⬛ **Note that the polarity of the terminals on the PSU is:**
- 🔴 Positivo (V+)
 - 🔴 Positivo (V+)
 - ⬛ Negativo (V-)
 - ⬛ Negativo (V-)
- ⓘ El cable rojo (positivo) puede tener una raya negra. Del mismo modo, el cable negro (negativo) puede tener una raya roja.


⚠ **No conectes ningún cable todavía, espera hasta que se te haya indicado.**

PASO 16 Conectando la fuente de alimentación

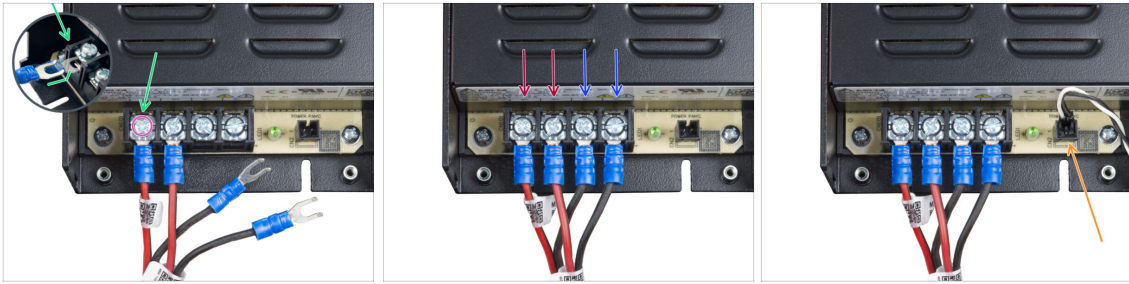

- Take the RED wire and slide the fork connector all the way into the first (positive) terminal from the left on the bottom of the PSU. Make sure the steel washer is above the "fork" connector.
- Tighten the terminal screw firmly.
- Use the same procedure to connect the second red wire to the second terminal slot from the left.
- Connect two black wires to the third and fourth terminal slots using the same procedure.
- Plug the black connector of the power panic cable to the right most connector.
- Aparta el conjunto durante un rato.

PASO 17 Back panel: parts preparation

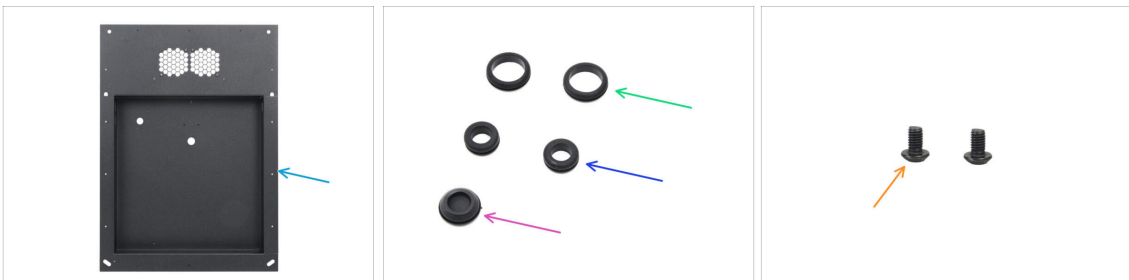


- **For the following steps, please prepare:**
- Back panel (1x) *found in the Metal parts 1/3 package*
- Grommet 19/16 mm (2x) *large one - found in the Electronics & Fasteners package*
- Grommet 13.5/10 mm (2x) *small one - found in the Electronics & Fasteners package*
- Sealing plug 15.5 mm (1x) *found in the Electronics & Fasteners package*
- M3x4T screw (2x)

PASO 18 Installing grommets: back panel top




- Position the back panel as shown in the first image. Use the two oval holes as a reference.
- Insert the sealing plug into the center hole.
 - The sealing plug is not symmetrical.** Insert the side with the smaller diameter facing downward.
- Insert one small grommet to the left circle hole.
- Insert one small grommet into the oval hole.

PASO 19 Installing grommets: sides

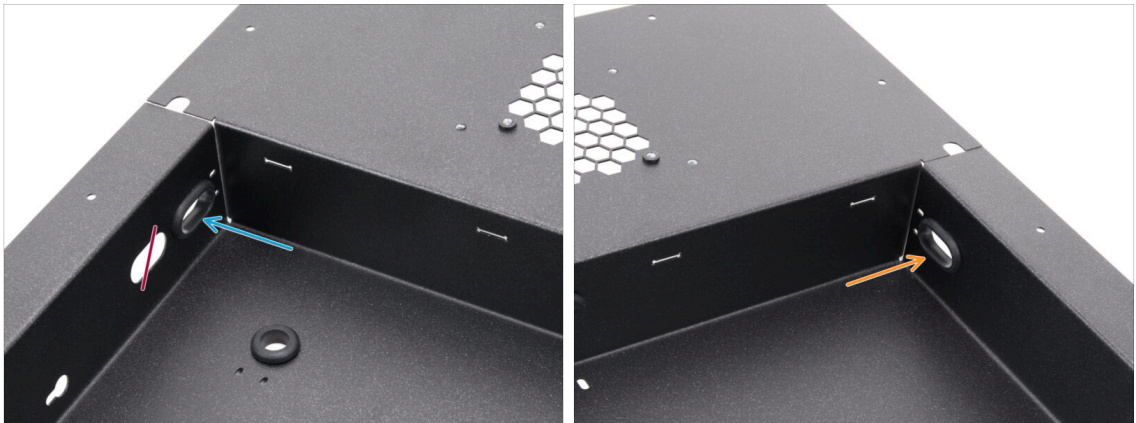


- Focus on the left top side of the back panel and locate two oval holes.
- Insert one large grommet into the oval hole closest to the corner.
- Move to the right top side of the back panel and insert one large grommet to the oval hole.

PASO 20 Aligning the PSU

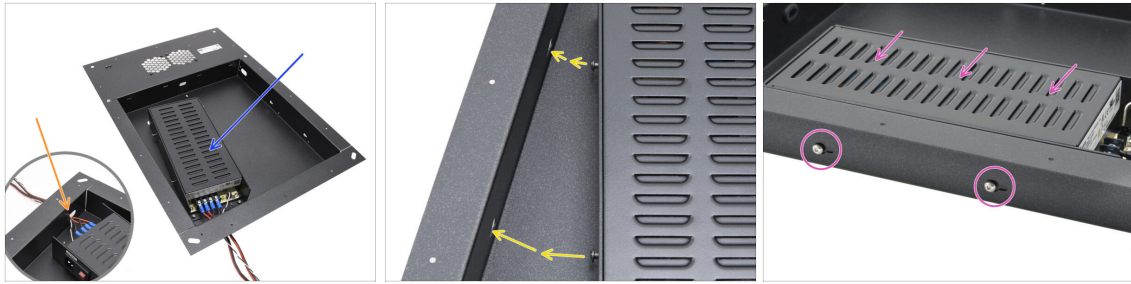


- Carefully insert the PSU into the rear panel pocket.
- Push the cable bundle through the opening on the bottom of the panel.
- Align the screws on the PSU to the holes on the left side of the back panel.
- Slide the PSU so that the screws go through the holes.

PASO 21 Mounting the PSU

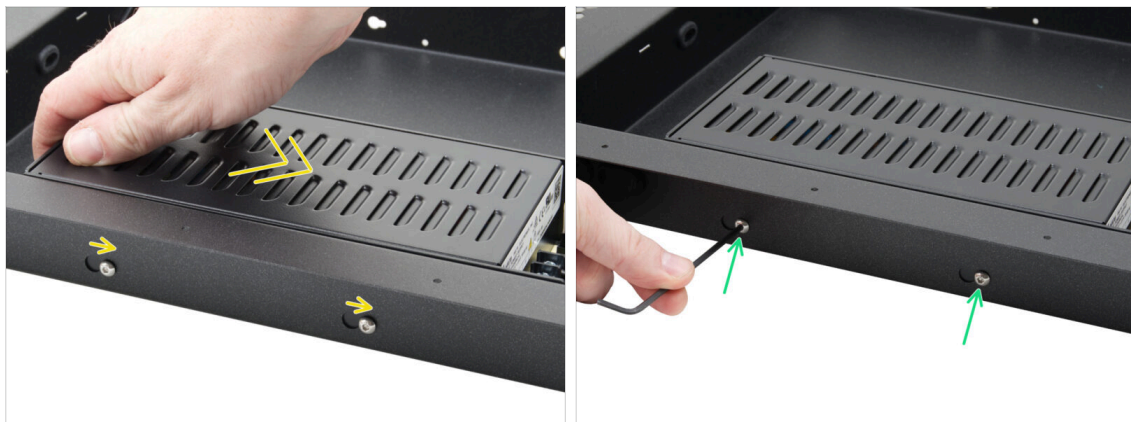


- Gently slide the PSU so that the position of the screws moves to the end position of the keyhole-shaped holes.
- Maintain the PSU position and fully tighten both screws.

PASO 22 Aligning the xBuddy box assembly

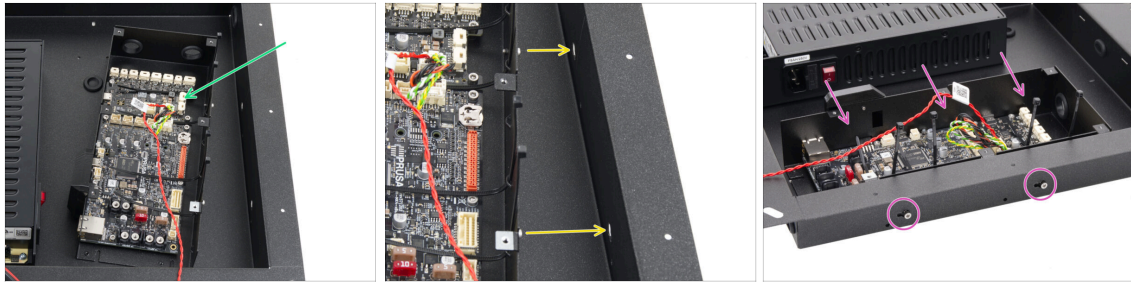


- Carefully insert the xBuddy box assembly into the rear panel pocket.
- Align the screws on the xBuddy box to the holes on the right side of the back panel.
- Slide the xBuddy box so that the screws go through the holes.

PASO 23 Mounting the xBuddy box

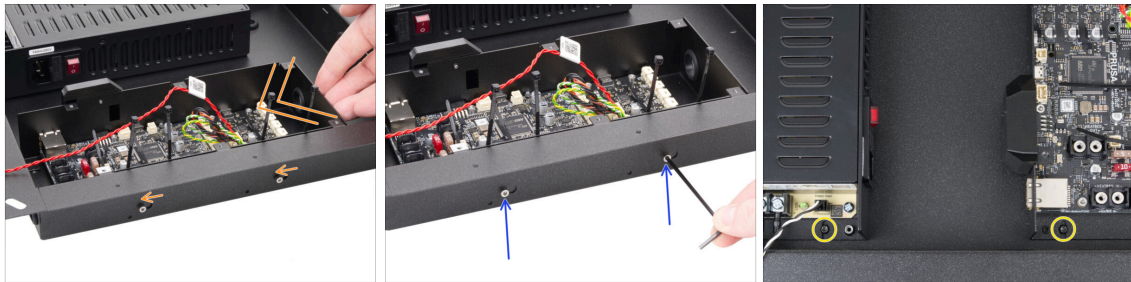

- Gently slide the xBuddy box assembly so that the position of the screws moves to the end position of the keyhole-shaped holes.
- Maintain the xBuddy box position and fully tighten both screws.
- Fix the PSU and xBuddy box assembly to the back panel by tightening the two M3x4rT screws.

PASO 24 PSU-cable-cover: preparación de las piezas

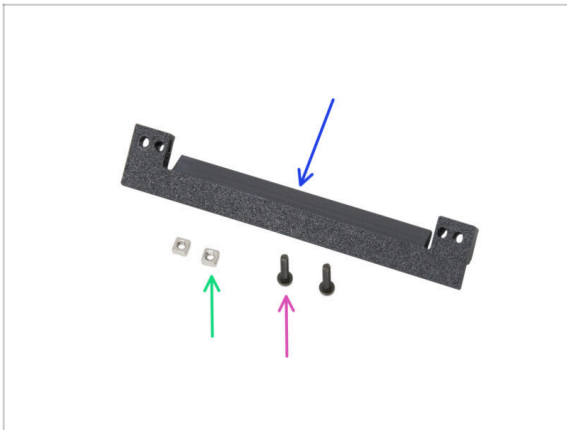

- For the following steps, please prepare:
- PSU-cable-cover (1x) *found in the Printed parts package*
- Tuerca M3nS (2x)
- M3x10rT screw (2x)

PASO 25 Preparing the PSU-cable-cover





- Insert one M3nS nut into the hole on each end of the PSU-cable-cover.
- Ensure the holes are aligned.

PASO 26 PSU-cable-cover installation



- Attach the PSU-cable-cover inbetween the PSU and the xBuddy box.
- Secure the cover with two M3x10rT screws in the outermost holes of the part.


PASO 27 Chamber fans: parts preparation

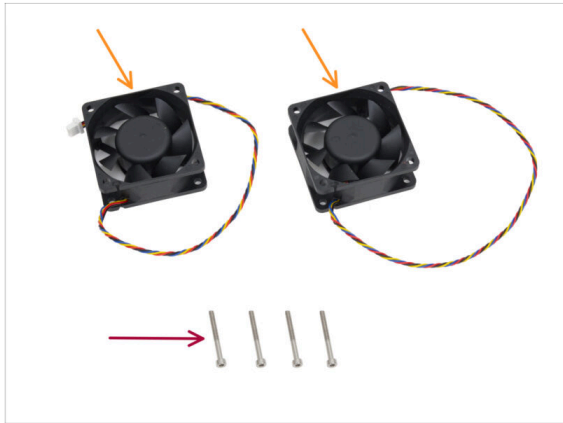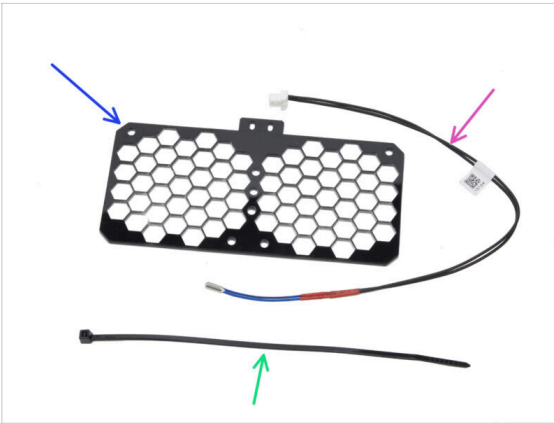

For the following steps, please prepare:

- Fan grid (1x) found in the Electronics & Chamber parts package
- Chamber thermistor 260 mm (1x) found in the Electronics & Chamber parts package
- Brida (1x)
- Cooling fan (2x) found in the Electronics & Chamber parts package
- M3x30 screw (4x)

PASO 28 Assembling the fan grid

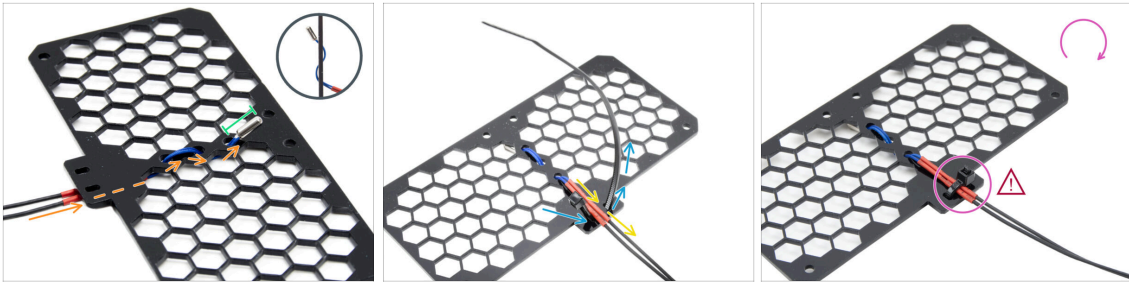


- Guide the thermistor cable under the grid. Thread it in the direction shown in the picture.

ⓘ The grid has both sides the same.


- Leave the whole thermistor part sticking out.
- Turn the grid over and push the zip tie through the pair of holes on the grid's protrusion.
- Route the thermistor cable in between the zip tie parts.
- Asegura con cuidado el cable del termistor apretando la brida. **No lo aprietes demasiado**, podrías dañar el cable.
- ⚠ **Asegúrate de que el cabezal de la brida está orientado en el mismo sentido que en la imagen. Debe estar en el mismo lado en el que empieza el cable.**
- Aparta el conjunto durante un rato.

PASO 29 Colocando los ventiladores

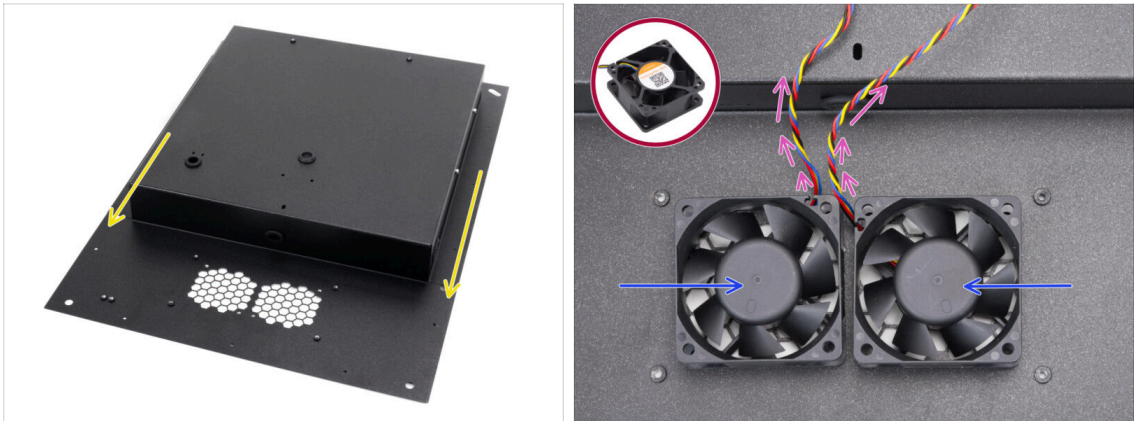

- ✦ Place and orient the back panel according to the picture. The grid cutouts must be facing you.
- ✦ Attach both fans to the grid in the back panel.
 - ⚠ **The side of the fan without the sticker must be facing up.**
 - ✦ Orient the fans so that the cables run from the corners in the centre.
 - ✦ Let the cables hang freely for now, ensuring they are not pinched during handling.

PASO 30 Covering the cooling fans

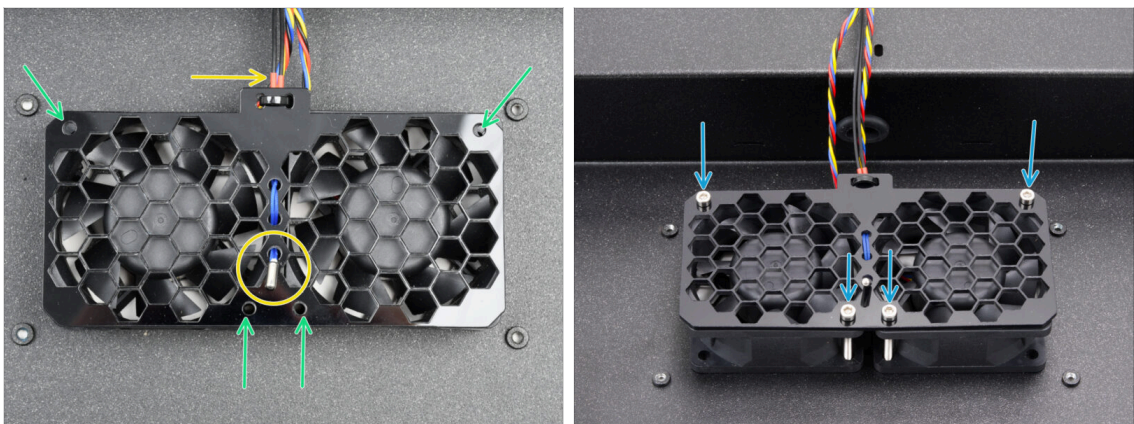

- ✦ Place the fan grid assembly on the cooling fans.
 - ⚠ **Make sure that the thermistor is pointing up and its cable runs under the grid.**
- ✦ Align holes in the fans, fan grid and the back panel.
- ✦ Secure the fan assembly to the back panel with four M3x30 screws.
 - ⚠ **Do not overtighten the screws to avoid damaging the grid.**

PASO 31 Rear profiles: parts preparation



● For the following steps, please prepare:

● Rear profile (2x) found in the Metal parts 1/3 package

① Take two of the longer ones.

Note that the other two longer ones differ by having cutouts.

● Remache de nylon (11x)

● M3x4rT screw (4x)

● Tornillo autorroscante 2.9x6.5sT (1x)

PASO 32 Installing the rear profiles



● Take the bottom assembly and turn it so the rear side (with one motor in the center) faces you.



Focus on the right rear corner—the side with the longest oval opening in the bottom panel.


● Attach the rear profile to the right corner, using the **end without flanges**.

● Align the hole on the rear side and secure it with the M3x4rT screw.

● Secure the corner on the other side with a second M3x4rT screw - each corner will be secured with two M3x4rT screws.

● Procede del mismo modo con el segundo perfil trasero en la esquina trasera izquierda.

PASO 33 Mounting the back panel

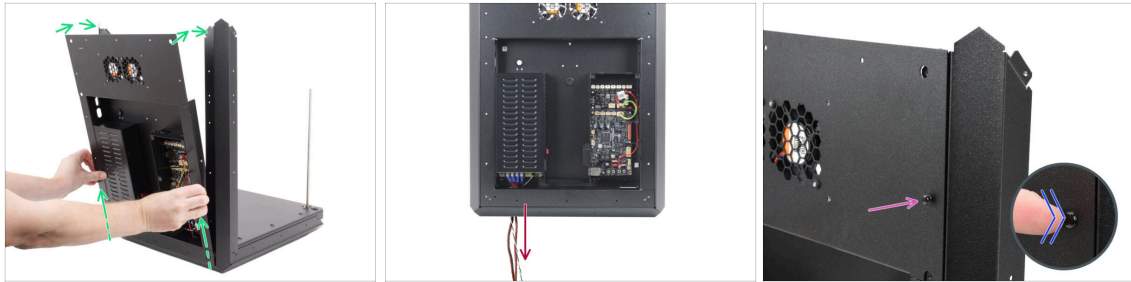

- ◆ Slightly lift the back assembly and gently place it on the base assembly and rear profiles.
- ◆ Pull the power cables through the opening in the bottom assembly.
- ◆ Insert one nylon rivet through the rear panel and rear profile on the top right side.
- ◆ Push the rivet head with your finger until it is fully seated.

PASO 34 Securing the Back panel



- ◆ Install all eleven nylon rivets around the back panel assembly to secure it.
 - ◆ Install the 2.9x6.5 self-tapping screw into the bottom left opening on the back panel.
- ⚠ Don't overtighten to avoid stripping the self-tapping thread.


PASO 35 Power Terminal Screws Preparation



For the following steps, prepare:


6-32 Power Terminal Screw (4x)

PASO 36 Connecting the power cables

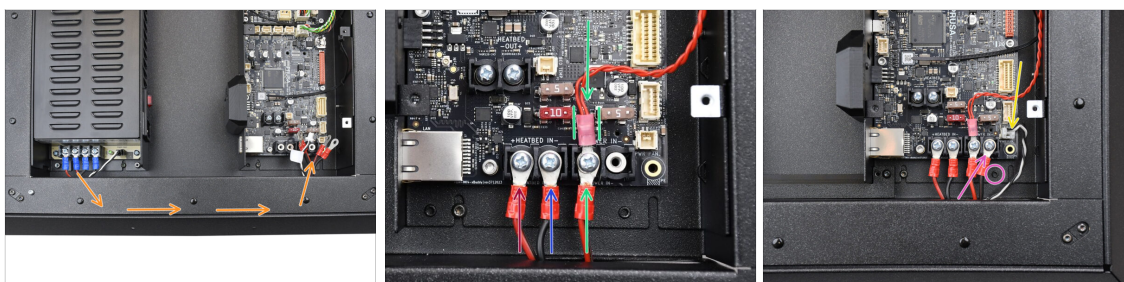

- Guide the power cable bundle through the rear panel, towards the xBuddy board.
- Take one red cable from the PSU and connect it to the leftmost terminal on the xBuddy board using the 6-32 terminal screw. Tighten it firmly but do not overtighten.
- Attach the black PSU cable to the second terminal. Tighten it firmly, but avoid overtightening.
- Take the second red cable from the PSU and stack it with the red cable from the extension board.
Secure **both cables together** in the third terminal using the terminal screw.
-  Carefully guide the xBuddy extension cable between the fuses, ensuring it does not press against any of them.
- Conecta el último cable negro de la fuente de alimentación al xBuddy, **asegurándote de que no obstruye el orificio roscado que hay debajo.**
- Conecta el cable de alimentación del modo pánico al conector inferior derecho de la placa xBuddy.

PASO 37 Stepper splitter: parts preparation

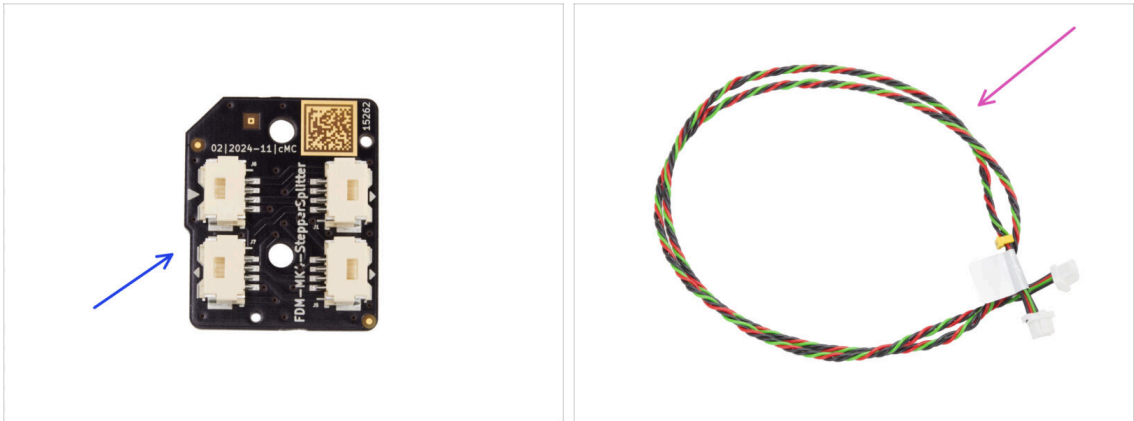

● For the following steps, please prepare:

- Stepper splitter (1x) found in the *Electronics & Chamber parts package*
- Stepper splitter cable (1x) found in the *Electronics & Fasteners package*

PASO 38 Guiding the Stepper splitter cable



● Very carefully turn the assembly on its back (back panel).

● **It is recommended to support the rear of the assembly** with a soft, raised pad to prevent it from resting on the protruding Wi-Fi module.

① Tip: Use the foam padding from the sheet metal parts package or an empty cardboard box.


● Guide the Stepper splitter cable through the three zip ties on the left side.

● For now, leave the side with the label hanging freely outside.

● Pasa el cable R del motor del eje Z a través de las tres bridas del lado izquierdo.

⚠ **¡No aprietes las bridas en este momento!**


PASO 39 Connecting the Stepper splitter

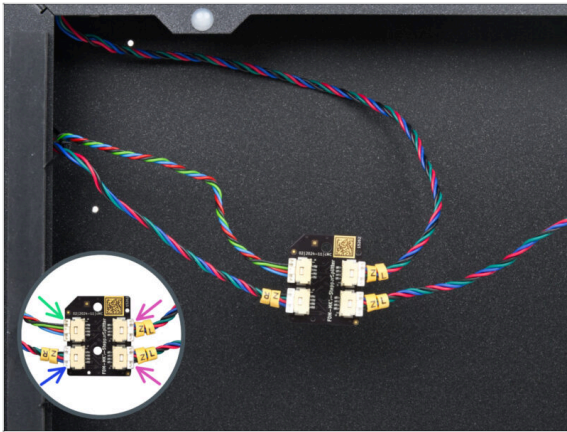

● Connect the Z motor cables to the stepper splitter:


- Cable Stepper splitter
- Z-axis motor R
- Motor L eje Z
- Motor L eje Z

PASO 40 Mounting the Stepper Splitter

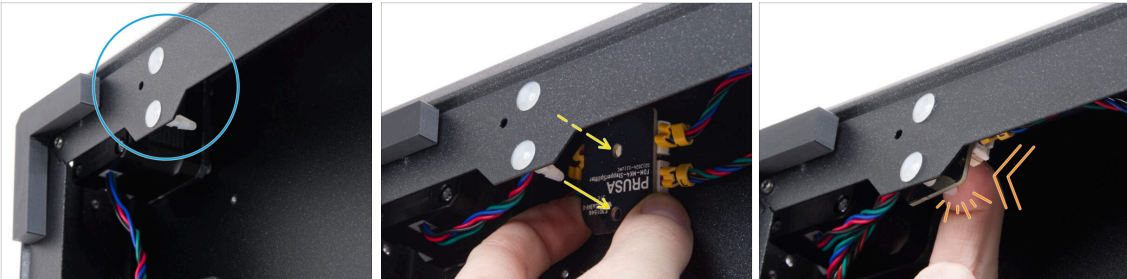

- Locate two spacer pins in the bottom frame.
- From the inside of the frame, prepare the Stepper splitter and attach its holes opposite the pins.
 - Check the correct orientation of the part by the logo on the board. **The logo is upside down.**
- Push the aligned Stepper Splitter onto the pins until you feel a click - this secures the Stepper Splitter. Push in the center of the board.
- ⓘ It is necessary to apply a significant pressure to seat the part in. Yet, be very careful not to damage the components.


PASO 41 LCD cable: parts preparation

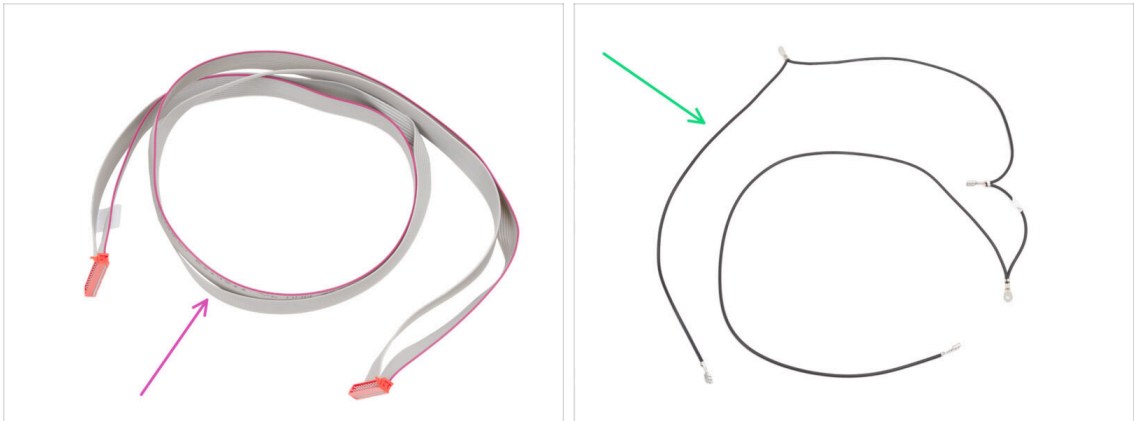

● For the following steps, please prepare:


- xLCD cable (1x) found in the *Electronics & Fasteners* package
- Main FE cable (1x) found in the *Electronics & Fasteners* package

PASO 42 Guiding the LCD cable

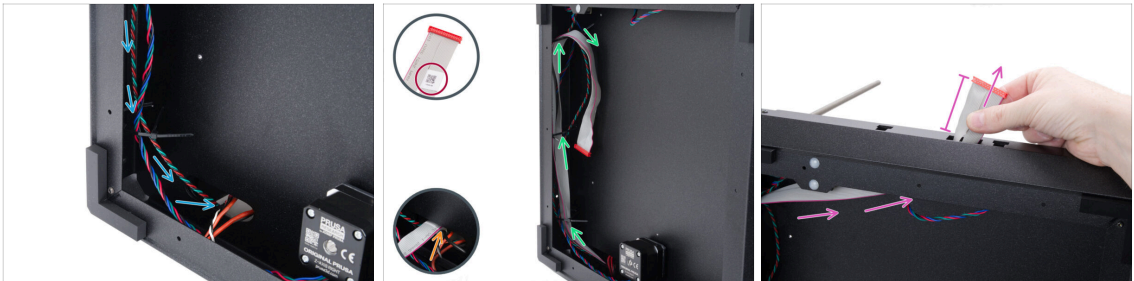


- Guide the Stepper splitter cable through the oval hole to the electronics.
- Take the end of the xLCD cable with the QR code label.
- Push a few centimeters of the xLCD cable (the end with the QR code label) through the oval hole in the bottom panel.
 - ⓘ The cable must be slightly folded to pass through the hole.
- Guide the xLCD cable through the zip ties on the left side of the frame.
- Guía el cable xLCD a través de la abertura rectangular del perfil frontal. Que sobresalga unos 6 cm (2.36 in).
- Deja que el cable cuelgue libremente por ahora.

PASO 43 Main FE cable INFO

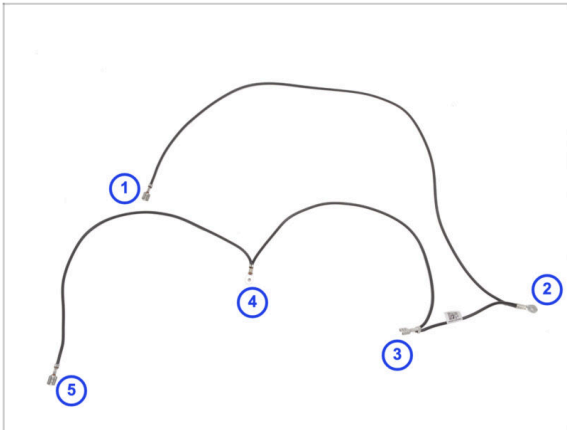


- Lay out the Main FE cable as shown in the picture, ensuring each connector is positioned accordingly.
- The connectors are numbered in the picture for reference only. This numbering will be used in the following steps to help with proper connections.
- ⓘ Note: We will always indicate which connector to use in the following steps. However, it's a good idea to remember this overview for easier assembly.

PASO 44 Connecting the FE cable (no 3.)

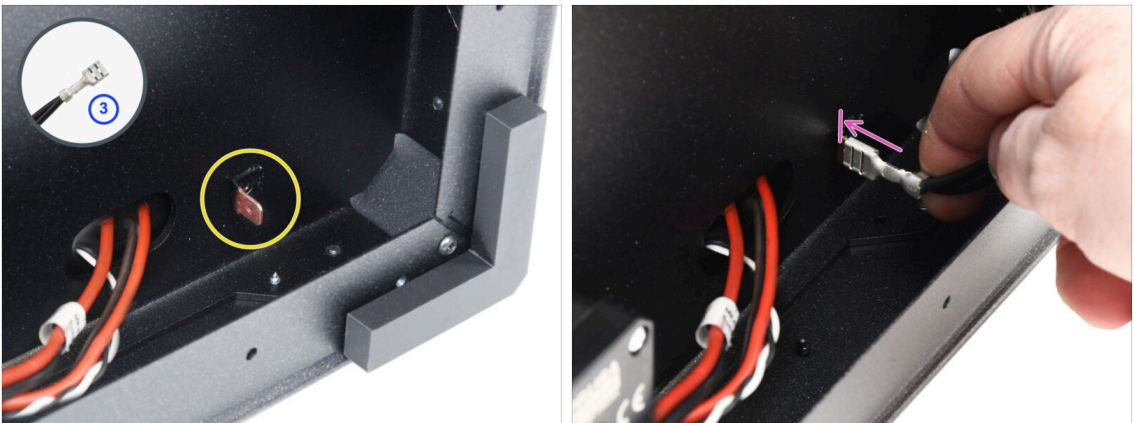


- Prepare the connector number 3.
- ⓘ That's the female faston connector in the middle of the cable.
- Locate the male Faston connector in the bottom right corner.
- Slide the FE cable connector completely onto the Faston connector.

PASO 45 Guiding the FE cable (no. 2)

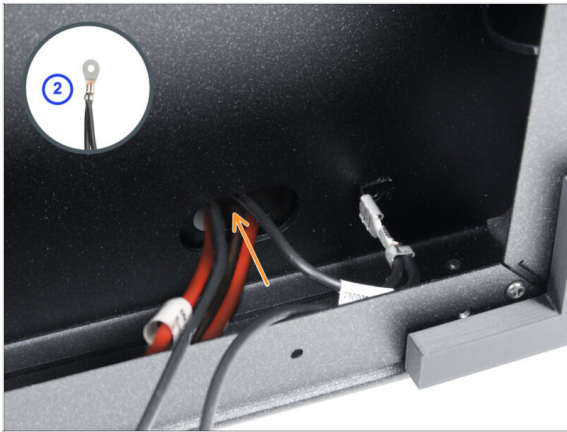


- Take the FE cable connector number 2.
- ⓘ The round connector nearby.
- Insert the connector loosely into the hole in the bottom panel.

PASO 46 Guiding the FE cable (no. 1)

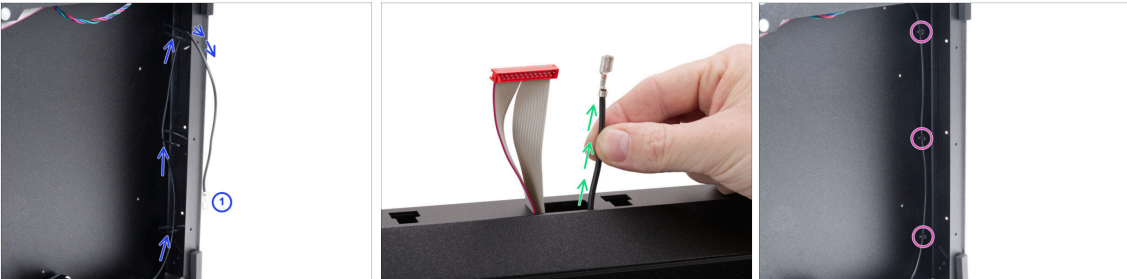


- Take the connector number 1 and guide it through the zip ties on the right side of the frame.
- ⓘ That is the long part with just one faston connector at the end.
- Push the connector through the rectangular opening in the front profile. Keep protruding approximately 6 cm (2.36 in).
- Leave the cable hang freely for now.
- Tighten all three zip ties. Cut off the excess.

PASO 47 Guiding the FE cable (no. 4 and 5)

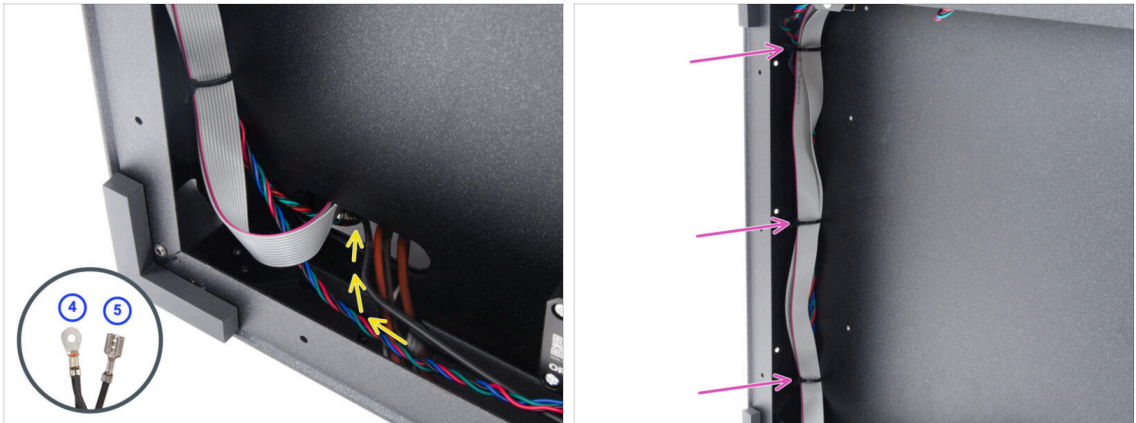


- Take the FE cable connectors number 4 and 5.
- Push both connectors through the leftmost hole in the bottom. Leave them free for now.
- Tighten all three zip ties on the left side of the frame. Cut off the excess.
 - There's no need to fully tighten the zip ties. However, the cables must still be easy to move for any necessary length adjustment during connection.

PASO 48 Cable Bundle Cleanup

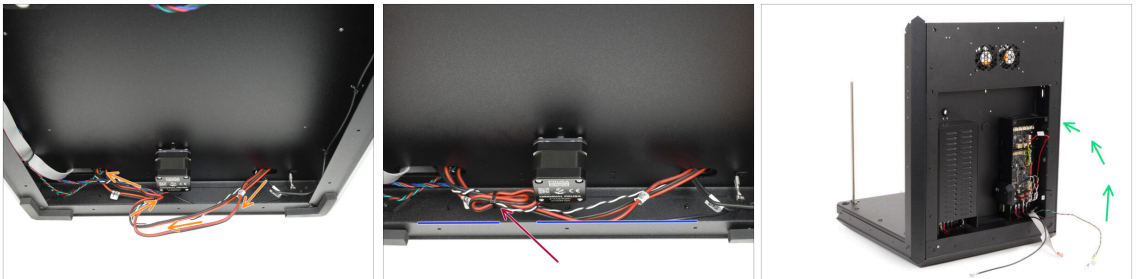

- On the bottom, loop the power cable bundle around the Z-motor cable to shorten it.
- Secure the loop to the Z-motor cable with a zip-tie.
 - Make sure the cables are kept at a reasonable distance from the metal profile, while also preventing them from being overly tight.
- ⚠ This prevents cables from hanging below the metal profiles, where they could get caught and damaged. High current flows through these cables, so damaging them might cause a serious harm to the printer and its surroundings!
- Carefully lift the printer upright.

PASO 49 FE cable - xBuddy: parts preparation

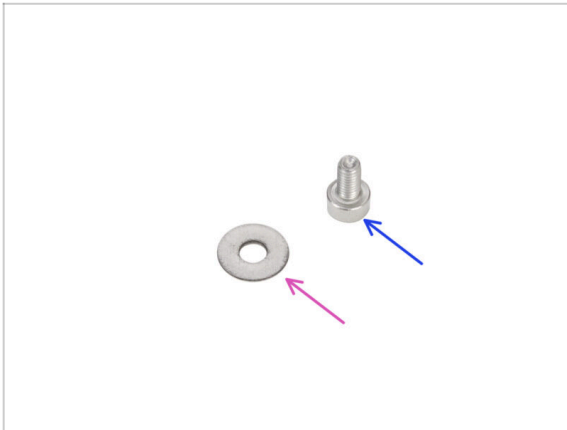

● For the following steps, please prepare:

● Arandela M3w (1x)

● M3x6 screw (1x)

PASO 50 Connecting the FE cable: xBuddy



● Put the printer back on its feet. And focus on the rear side.


● Take the connector number 4 and connect it to the xBuddy using the M3x6 screw and M3w washer.

⚠ The M3 washer must be between the screw head and the connector.

● Guide the FE cable (number 5) alongside the xBuddy box and pass it through the right-side holes out of the box.


● Guide the Stepper splitter cable alongside the xBuddy box and connect it to the second slot from the right in the top row on the xBuddy board (labeled ZR).

PASO 51 Plugging the xLCD cable

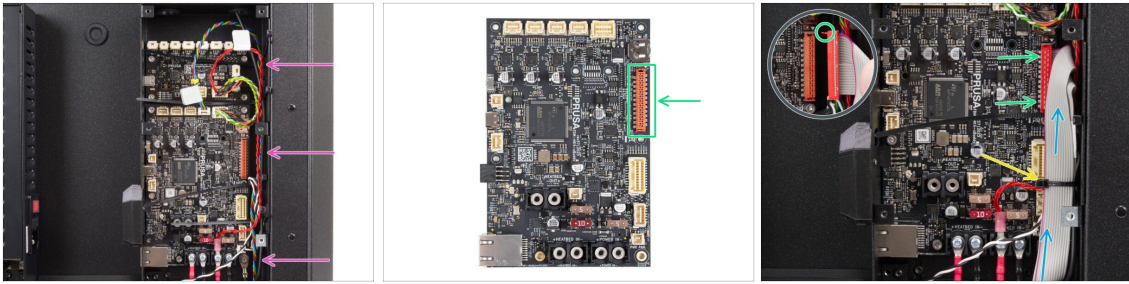

- ◆ Arrange the cables as shown - route all cables along the right side of the xBuddy box.
- ⚠ Make sure all the cables guide through the zip ties in the xBuddy box, not under them.
- ◆ Place the xLCD cable over the other cables and route it upwards.
- ◆ Connect the xLCD to the slot on the right side of the xBuddy. **Note the safety latch on the xLCD cable connector. The latch must fit into the upper side of the connector.**
- ◆ Secure the cable arrangement by tightening the bottom zip tie.
- ⚠ **No aprietes demasiado la abrazadera, puede dañar fatalmente los cables.**
- ◆ Corta con cuidado el sobrante de las bridas. ¡Evitan cortar los cables!

PASO 52 PSU-cover: parts preparation

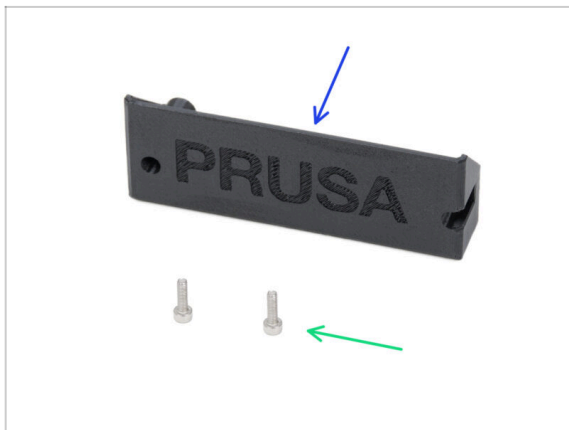

- ◆ For the following steps, please prepare:
- ◆ CORE-One-PSU-cover (1x) found in the Printed parts package
- ◆ M3x10 screw (2x)

PASO 53 Connecting the FE cable: PSU



- Remove the screw from the PSU board. **Do not discard it!**
- Ensure the FE connector (number 2) is routed into the PSU compartment.
- Insert the removed screw through the FE cable connector and screw it back to the PSU board.
- Note the correct orientation of the connector.
- Rotate the connector counter-clockwise, positioning it so it doesn't block the threaded hole underneath.
- Coloca la PSU-cover sobre los conectores de la fuente y fíjala con dos tornillos M3x10.

PASO 54 Momento Haribo



- Time to recharge for the next chapter!
- Eat the second row.
- ⚠ No cheating—eat only the number shown!**

PASO 55 Listo



- Congratulations! The back assembly is installed.
- Now continue to the next chapter.

4. Heatbed assembly




PASO 1 Tools necessary for this chapter



● **For this chapter, please prepare:**

- Needle-nose pliers
- Universal wrench
- Wrench 13-16
- Philips (PH2) screwdriver
- 2.5mm Allen key
- 2.0mm Allen key
- T10 torx key / T10 torx screwdriver


PASO 2 Heatbed: parts preparation

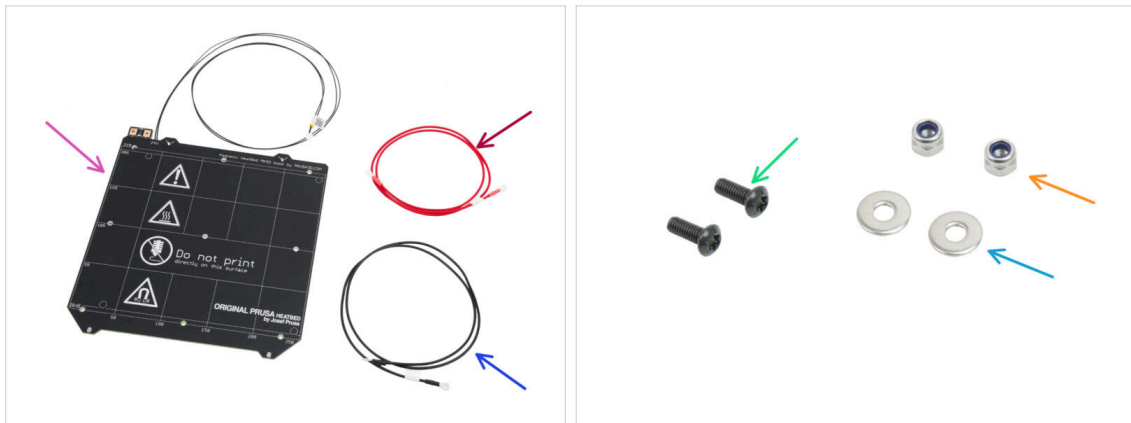

For the following step please prepare:

- Heatbed MK52 24V (1x)
- Heatbed cable red (1x) *found in the Electronics & Fasteners package*
- Heatbed cable black (1x) *found in the Electronics & Fasteners package*
- M3x10rT screw (2x)
- M3nN nut (2x)
- M3w washer (2x)

PASO 3 Heatbed Cable Assembly 1

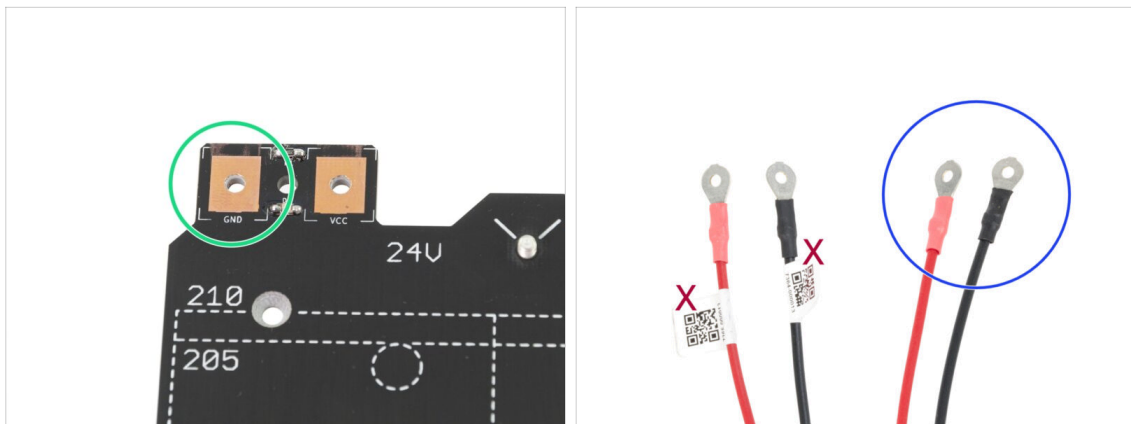


- Follow the polarity markings on the heatbed:

The pad labeled **GND** should be coupled with the **BLACK WIRE**.


- Take both power cables. Note the labels on each. Use the unlabeled ends for the heatbed connection.

PASO 4 Heatbed Cable Assembly 2

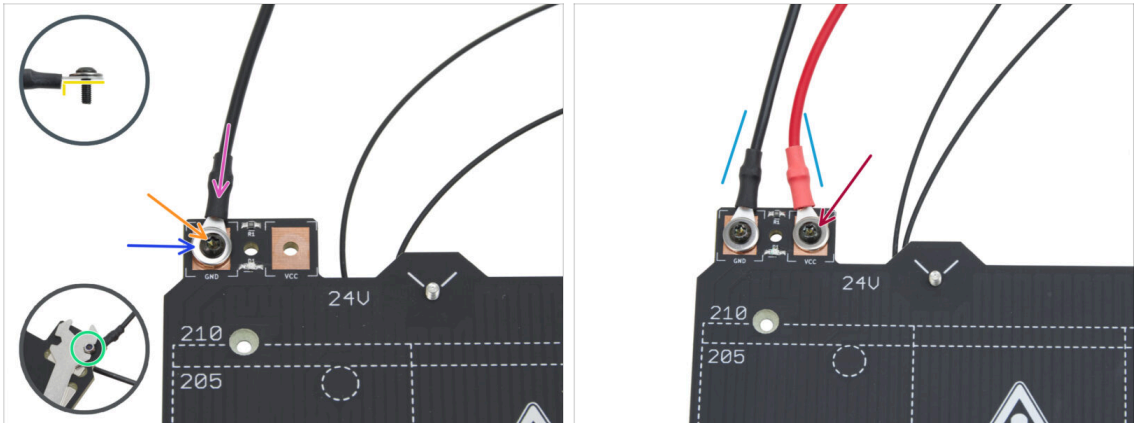


- Place the black cable onto the "GND" pad.
- Orient the lug connector with the thicker part facing downward.
- Place the M3w washer on top of the connector.
- Insert the M3x10rT screw through all the components.
- Attach the M3nN nut onto the M3x10rT screw from below and tighten it slightly.
- Using the same technique, attach the red cable to the "VCC" pad.
- Guide the heatbed cables slightly inward in a "V" shape, **then fully tighten the nuts from below.**

PASO 5 Bed-cable-cover-bottom: parts preparation

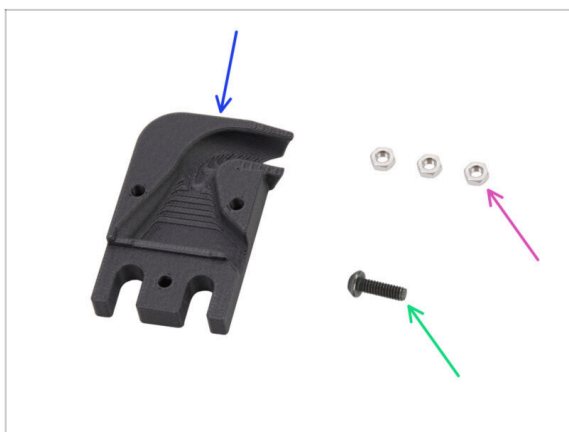

- **For the following steps, please prepare:**
- Bed-cable-cover-bottom (1x)
- M3n nut (3x)
- M3x10rT screw (1x)

PASO 6 Attaching the cable cover

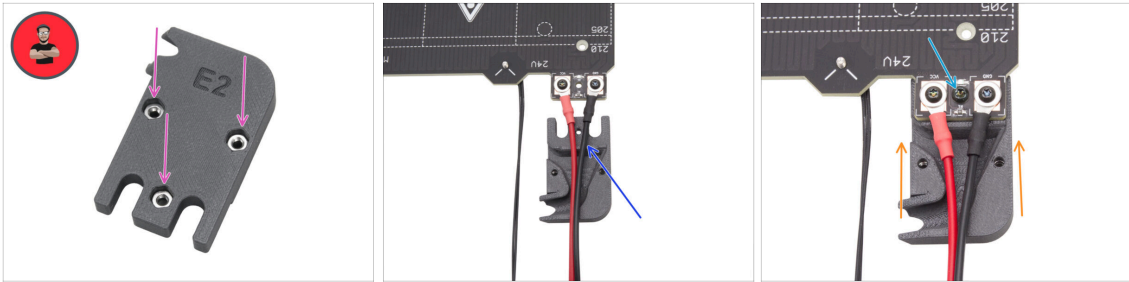


- ✦ Insert three M3n nuts into the Bed-cable-cover-bottom part.
- ❗ Pro tip: Use the screw-pulling technique.
- ⬛ Make sure the nuts are fully inserted and held in place.
- ✦ Insert the Bed-cable-cover-bottom under the heatbed cables. Note the orientation of the part.
- ✦ Slide the Bed-cable-cover-bottom under the cable joint of the heatbed.
- ✦ Line up the hole in the heatbed with the cable cover and secure it with the M3x10rT screw.

PASO 7 Heatbed carriage: parts preparation



- ⬛ **For the following steps, please prepare:**
- ✦ Heatbed carriage (1x) *found in the Metal parts 1/3 package*
- ✦ Expansion joint (8x)
- ✦ M3x4r screw (8x)
- 🔧 The Fasteners package includes both M3x4r and M3x4rT screws. Make sure you have the correct type prepared.

PASO 8 Preparing the heatbed carriage

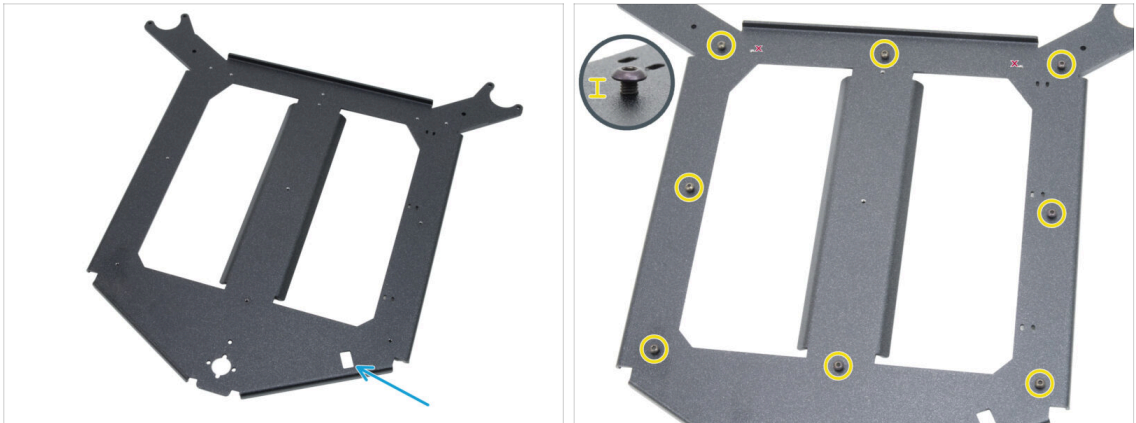


- Place the heatbed carriage in front of you in the same orientation as in the picture.
- Make sure the **rectangular cutout is facing you on the right side**.
- Insert eight M3x4r screws around the heatbed carriage.
- ⚠ **Do not tighten completely, leave a gap of approximately 3 mm (0.12 in).**

PASO 9 Installing the expansion joints



- Attach one expansion joint to any M3x4 screw in the same orientation as shown.
- Note the U-shaped "groove" for the screw inside the expansion joint - point it towards the screw.
- Slide the expansion joint onto the screw.
- Grasp the expansion joint in the rectangular cutout of the universal wrench.
- Position the key with the expansion joint in its correct orientation as shown in the illustration.
- **Maintain the expansion joint in the correct position** and firmly tighten the M3x4r screw through the expansion joint with a 2.0 mm Allen key.
- ⚠ **Repeat this procedure for all other expansion joints. Follow their correct position!**

PASO 10 RGB LED strip: parts preparation

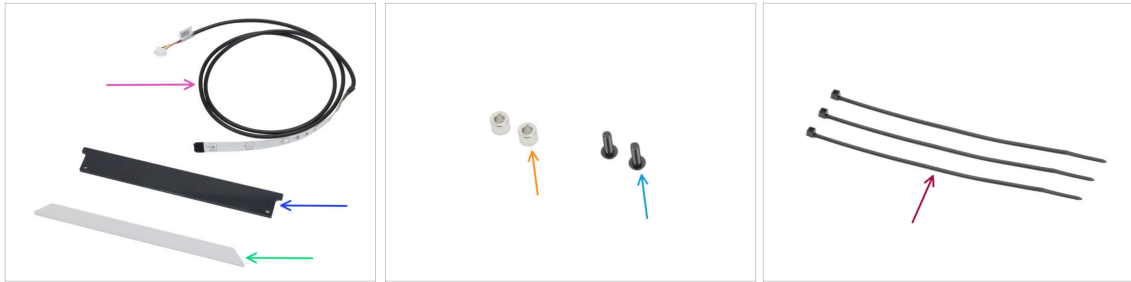

● For the following steps, please prepare:

● RGB LED strip 166 mm (1x) *found in the Electronics & Fasteners package*

⚠️ **Avoid direct contact with the LED and resistors on the LED strip.**

● LED status cover (1x) *found in the Electronics & Chamber parts package*


● LED strip diffuser (1x) *found in the CoreXY parts + Hinges set package*

● Spacer 3.2/6x5 mm (2x) *found in the Electronics & Fasteners package*

● M3x10rT screw (2x)

● Zip tie (3x)

PASO 11 Installing the LED strip

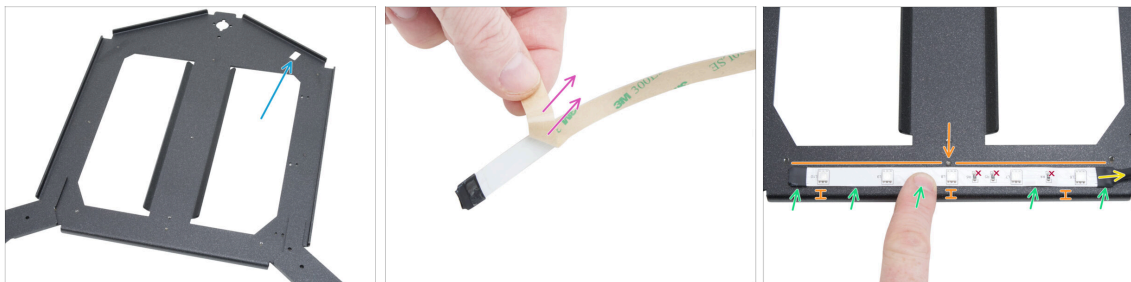

● Place the heatbed carriage in front of you in the same orientation as in the picture.

● Make sure the **rectangular cutout is far from you and on the right side**.

● Carefully peel off the protective (paper) layer from the RGB LED strip.


⚠️ **After removing the protective layer, the RGB LED strip is adhesive.**

● Stick the RGB LED strip evenly to the front of the heatbed carriage, approximately 3 mm (0.12 in) from the folded edge.
Align the middle LED with the screw on the carriage.

● The RGB LED strip **must point to the right**.


● After sticking, press lightly on the blank areas of the strip to ensure adhesion. **Do not touch LEDs and resistors!**

PASO 12 Attaching the LED strip diffuser

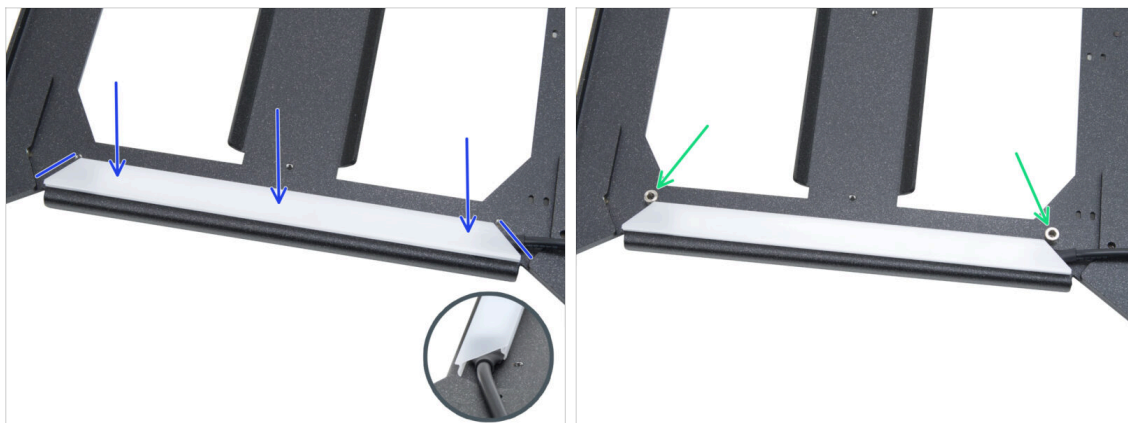


- Place the LED strip diffuser over the RGB LED strip. Note the orientation of the part - according to the beveled edges.
- Place two spacers 3.2/6x5 mm on the holes in the edges of the LED assembly.

PASO 13 Covering the RGB LED strip

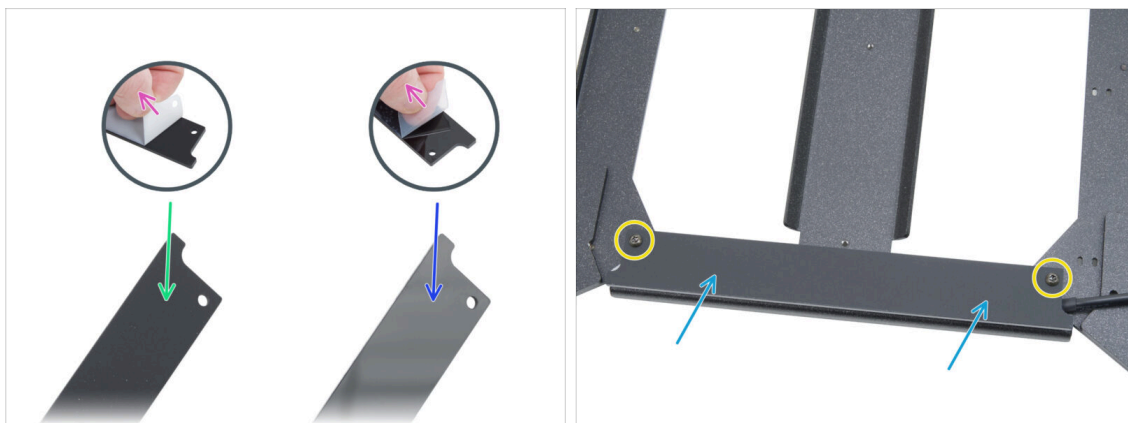

- From both sides of the LED strip cover, peel off the protective layers.
- Note that one side of the cover is matte.
- The other side of the cover is glossy.
- Attach the LED strip cover to the assembly, **matte side up**.
- Secure all parts together by inserting and tightening two M3x10rT screws. **Do not overtighten the screws**, as it may crack the cover.

PASO 14 Guiding the RGB LED strip cable

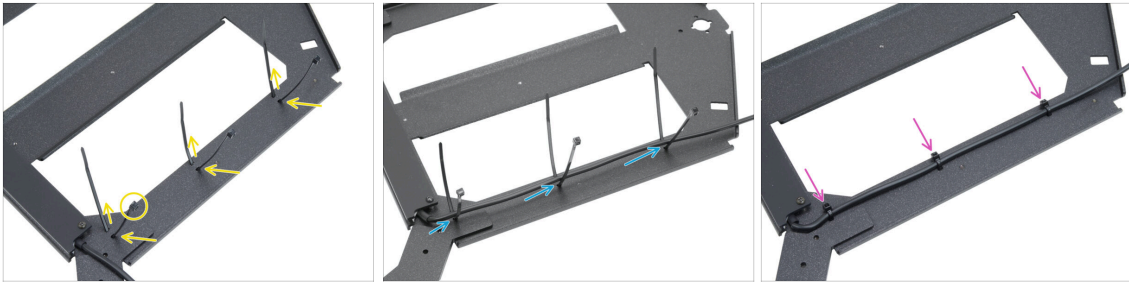

- ✦ Thread the three zip ties along the **RIGHT SIDE** of the heatbed carriage. Make sure the zip tie heads are facing outward.
- ✦ Guide the RGB LED strip cable through all zip ties.
- ✦ Then tighten all three zip ties. Cut off excess zip ties.

PASO 15 Bearing Lubrication Preparation



- ✦ **For the following steps, prepare:**
 - ✦ LM8UU Bearing (2x) *removed from the MK4S printer*
 - ✦ Prusa lubricant applicator 8mm (1x)
 - ✦ Prusa lubricant (1x)
 - ✦ Several paper towels to wipe oil and grease from the bearing surface.
- ⚠ **Use the lubricant wisely, less is better! Using too much of the lubricant may cause issues.**

PASO 16 Bearing Lubrication




i Use any piece of fabric as a pad to protect your working surface from grease.

⚠ Make sure the bearing is clean inside.

- Wipe the preservative oil off the bearing surface with a paper towel.
- It is necessary to lubricate all 4 rows of balls inside the bearing.
- Screw the tube into the applicator.
- Carefully slide the entire bearing onto the applicator.

PASO 17 Bed mounts: parts preparation

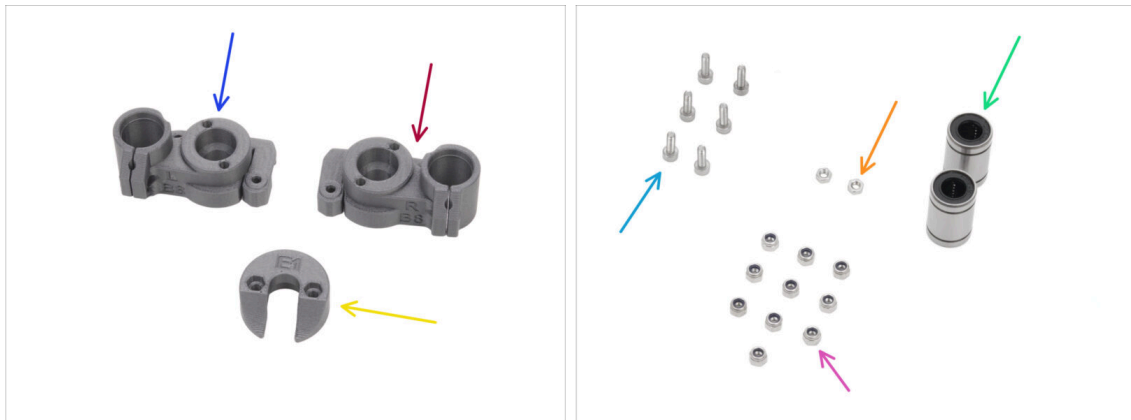

■ **For the following steps, please prepare:**

- CORE-One-bed-mount-left (1x) *found in the Printed parts package*
- CORE-One-bed-mount-right (1x) *found in the Printed parts package*
- CORE-One-bed-spacer-rear (1x) *found in the Printed parts package*
- LM8UU bearing (2x) *freshly lubricated*
- M3x10 screw (6x)
- M3n nut (2x)
- M3nN nut (10x)

PASO 18 Assembling the bed mounts



- Place the CORE-One-bed-mount-left onto the bearing, ensuring the correct orientation.
- Press the part onto the bearing, applying more force to ensure it moves all the way down. You will feel a click, indicating that the plastic part and bearing are correctly seated.
- ⚠ The bearing must be fully enclosed within the part and must not protrude.
- Follow the same procedure with CORE-One-bed-mount-right.

PASO 19 Securing the bed mounts



- Insert one M3n nut into the CORE-One-bed-mount-left.
- Position the CORE-One-bed-mount-left according to the picture:
 - Position the bearing so that two ball rows face the bottom of the part, not just one.
- Keep the bearing in the position and secure it by inserting and tightening one M3x10 screw.
- ⚠ Ensure that the top surface of the bearing is flush with the top surface of the plastic part.
- Follow the same procedure with CORE-One-bed-mount-right.

PASO 20 Bed mounts: inserting the nuts



- Insert four M3nN nuts into both bed mounts.
- Make sure they are inserted completely inside.

PASO 21 Assembling the CORE-One-bed-spacer-rear



- Insert two M3nN nuts into the CORE-One-bed-spacer-rear.
- Insert the nuts down as much as possible.

PASO 22 Installing the bed-mount-right




- Turn the heatbed carriage piece with the "forks" facing you and with the **expansion joints facing up**.
- Take the CORE-One-bed-mount-**right** part and slide it **under the right fork** - with the bearing on the right.
- Fix it with two M3x10 screws.

PASO 23 Installing the bed-mount-left




- Take the One-bed-mount-**left** part and slide it **under** the **left** fork - with the bearing on the left.
- Fix it with two M3x10 screws.

PASO 24 Mounting the heatbed: parts preparation

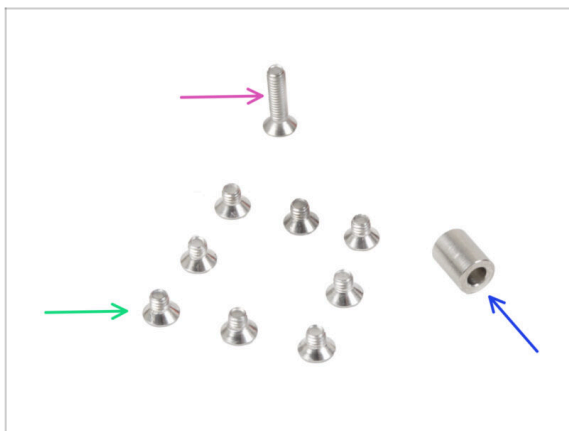


- **For the following steps, please prepare:**
- M3x12bT screw (1x)
 - i The screw may also be labeled M3x12cT.
- Spacer 6x3.1x8 mm (1x) *from the disassembled printer*
- M3x4bT screw (8x)
 - i The screw may also be labeled M3x4cT.

PASO 25 Mounting the heatbed

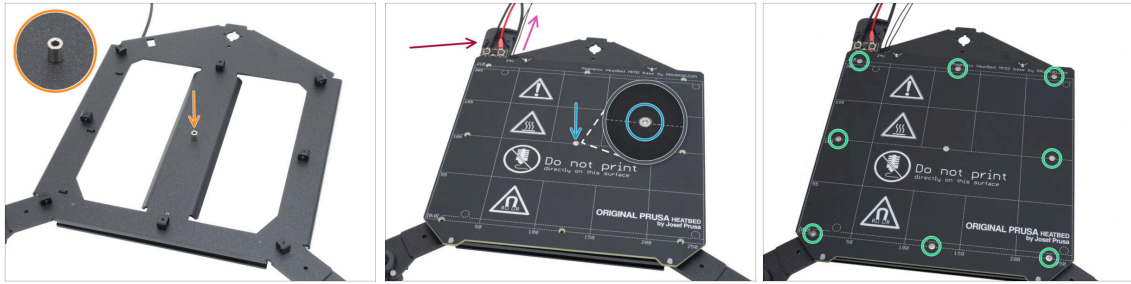


- Place the spacer onto the heatbed carriage on the side with the expansion joints and align it with the hole in the center.
- Put the heatbed on the heatbed carriage and secure it by the M3x12bT. **Do not fully tighten the screw yet.**
 - Make sure the heatbed thermistor cable (the thinnest pair) is routed alongside the heatbed power cables. Do not route it around or across any expansion joints.
- ⚠ **Ensure the correct orientation of the part. Use the heatbed cables as a guide.**
- Insert the M3x4bT screws into the remaining holes in the heatbed. **Do not fully tighten the screws yet.**

PASO 26 Tightening the heatbed

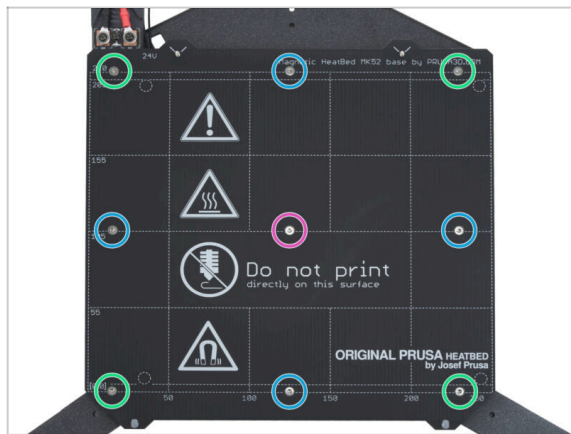

- ⚠ **IMPORTANT:** The heatbed must be tightened in a specific order. Repeat the sequence multiple times, ensuring the final tightening after at least two rounds.
- After all screws are in place, tighten them in the following sequence:
 - Center screw
 - First four screws (edges)
 - Last four screws (corners)
- ⚠ Tighten the screws gently, but firmly.


PASO 27 Covering the cables: parts preparation

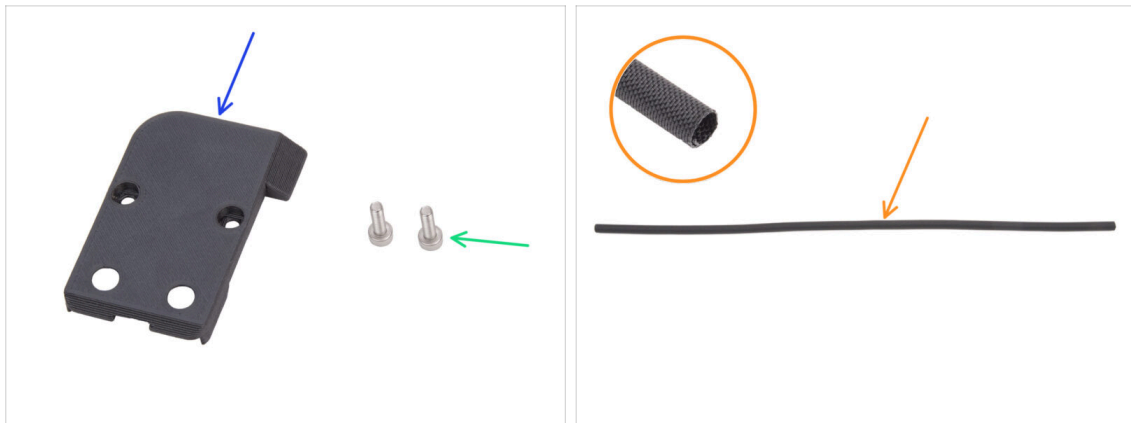

■ For the following steps, please prepare:


- CORE-One-bed-cable-cover-top (1x) found in the Printed parts package
- M3x10 screw (2x)
- Textile sleeve 520 x 8 mm (1x) found in the Electronics & Chamber parts package

PASO 28 Guiding the heatbed cables

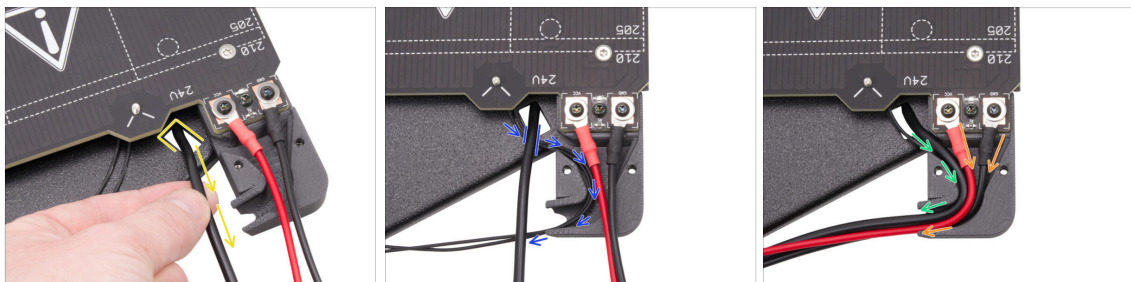

- Pull the RGB LED strip cable from the bottom through the rectangular cutout to the top.
- Guide the heatbed thermistor cable under the RGB LED cable, and insert the heatbed thermistor cable into the cable channel in the cable cover.
- Route the RGB LED strip cable through the cable channel.
- Guide the heatbed power cables through the cable channel.

PASO 29 Covering the heatbed cables

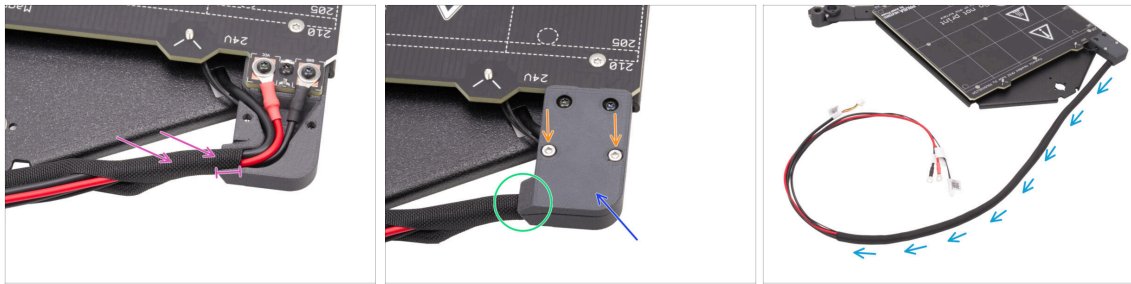


- ◆ Thread approximately 5 cm (2 in) of the textile sleeve onto the heatbed cable bundle and slide the textile sleeve 1 cm (0.39 in) into the cable channel.
- ◆ Attach the CORE-One-bed-cable-cover-top on the heatbed cables.
- ◆ Make sure the textile sleeve is still in place - inside the cable cover. **Do not pull on the textile sleeve.**
- ◆ Secure the top cover with two M3x10 screws.
- ◆ Wrap the rest of the textile sleeve around the cable bundle.

PASO 30 Mounting the heatbed: parts preparation




- ◆ **For the following steps, please prepare:**
 - ◆ Trapezoidal nut (3x)
 - ① *Two of these trapezoidal nuts are from the disassembled printer. The last one is in the Electronics and Chamber parts package.*
 - ◆ M3x18 screw (6x)

PASO 31 Attaching the heatbed assembly

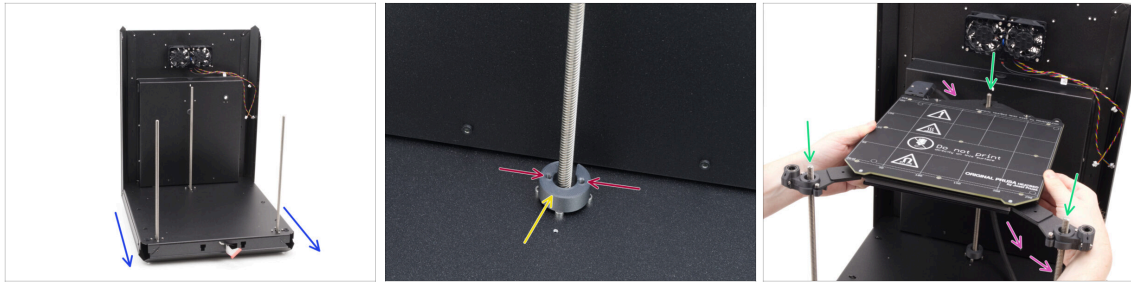

- Take the back and base assembly and orient the front side towards you.
- Place the CORE-One-bed-spacer-rear onto the rear motor screw heads, making sure it stays in place.
 - ⚠ Note the orientation of the part and holes as shown. The holes must be parallel to the motor screw heads.
- Very carefully thread the heatbed assembly onto the threaded rods of the Z motors, then gently lay it down onto the base.
 - ⚠ Keep in mind that there is a spacer on the rear motor. Avoid the spacer by the heatbed cable.
- The heatbed cable must run **under the heatbed** and **behind the rear motor**.

PASO 32 Mounting the heatbed assembly: rear motor

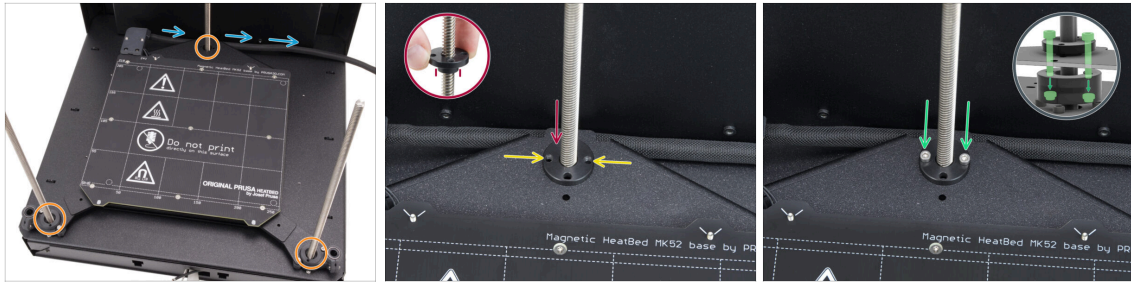

- ✦ Ensure the heatbed assembly is seated correctly—all threaded rods pass through the correct holes.
- ✦ Double-check that the heatbed cable bundle (textile sleeve) runs properly—it **must go under the heatbed assembly** and **behind the threaded rod** of the rear motor.
- ✦ Manually thread the trapezoidal nut onto the rear Z motor. Screw the nut all the way down until it seats into the heatbed carriage.
 - ⚠ Ensure the correct orientation of the part. **The protruding section must face downwards.**
- ✦ Align the holes in the trapezoidal nut, carriage and bed-spacer-rear.
 - ℹ It doesn't matter which holes you use in the trapezoidal nut.
 - ℹ Tip: You can push a 1.5 mm Allen key through the holes in all the parts to align them.
- ✦ Secure the trapezoidal nut, heatbed carriage and bed-spacer-rear together with two M3x18 screws.

PASO 33 Mounting the heatbed assembly: front motor left




- ✦ Manually thread the trapezoidal nut onto the **left** Z motor. Screw the nut all the way down until it seats into the plastic part.
 - ⚠ Ensure the correct orientation of the part. **The protruding section must face downwards.**
- ✦ Align the holes in the trapezoidal nut with those in the plastic part. Either pair of holes can be used.
- ✦ Secure all the part together with two M3x18 screws.

PASO 34 Mounting the heatbed assembly: front motor right




- Manually thread the trapezoidal nut onto the **right** Z motor. Screw the nut all the way down until it seats into the plastic part.
- ⚠ Ensure the correct orientation of the part. **The protruding section must face downwards.**
- Align the holes in the trapezoidal nut with those in the plastic part. Either pair of holes can be used.
- Secure all the part together with two M3x18 screws.

PASO 35 Attaching the heatbed cables I.

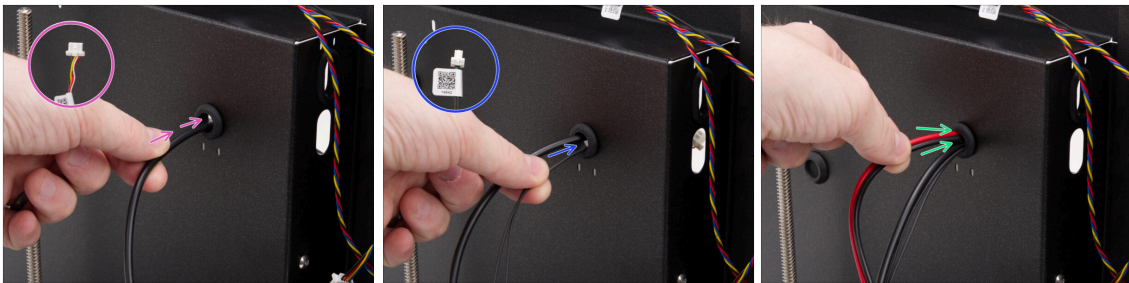


- Locate the grommet hole at the top right of the rear assembly and push the heatbed cables through in the following order:
 - Guide the RGB LED strip cable through the hole first.
 - Route the thermistor cable through.
 - Finally, insert both power cables through the hole.

PASO 36 Attaching the heatbed cables II.

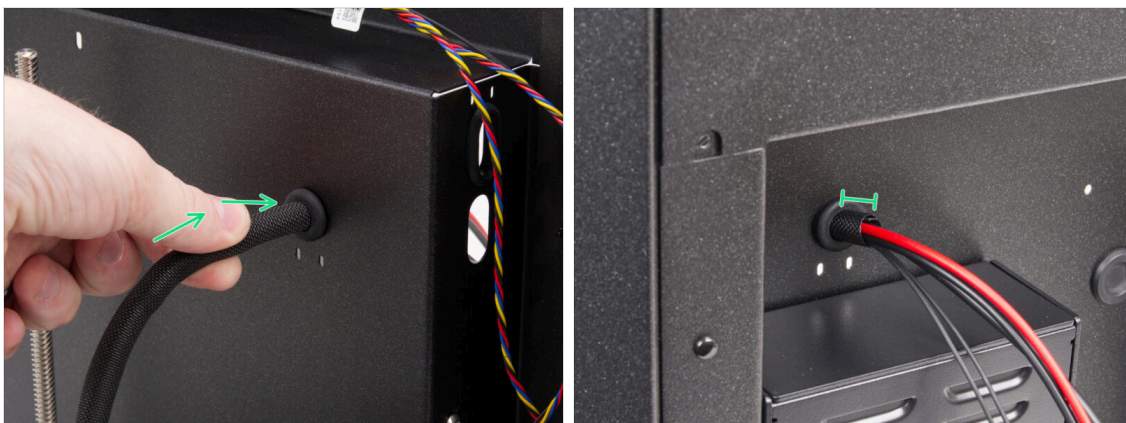


- Push the heatbed cables and the textile sleeve through the grommet hole.
- No more than 1 cm (0.39 in) of the textile sleeve should protrude from the back side.

PASO 37 Securing the heatbed cables: parts preparation

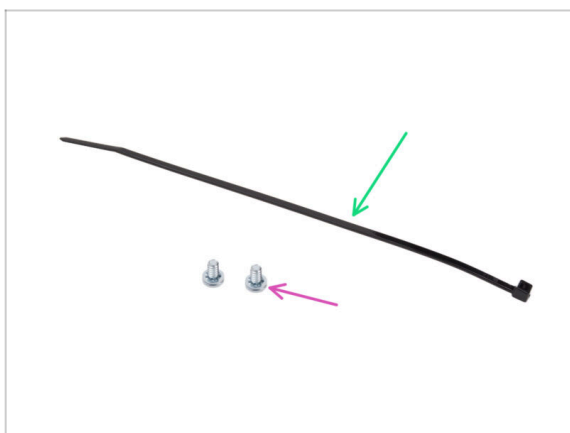


- For the following steps, please prepare:
- Zip tie (1x)
- 6/32" terminal screw (2x)

PASO 38 Securing the textile sleeve

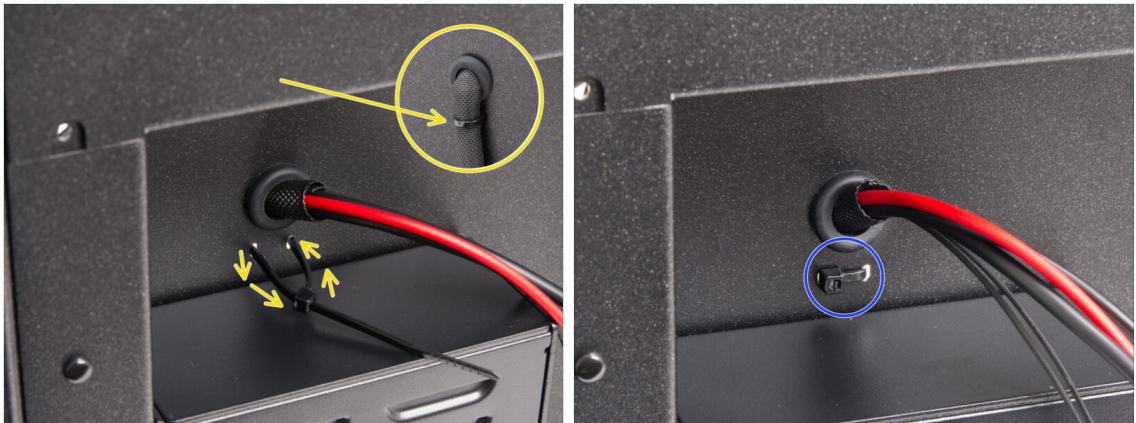


- Guide the zip tie through the two holes under the heatbed cables and make a loop around the heatbed cable bundle (textile sleeve) on the inside.
- Tighten the zip tie firmly and cut off the excess.

PASO 39 Guiding the heatbed assembly cables

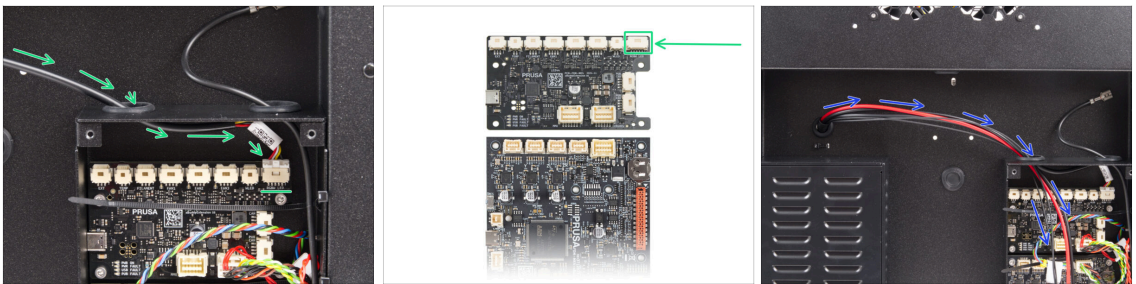


- Route the RGB LED strip cable through the left hole in the xBuddy box and connect it to the first slot on the xBuddy board labeled 'RGBW LED.'
- Connect it to the first slot from the right on the xBuddy extension board.
- Guide the heatbed power cables along with the thermistor through the left hole. Leave the cables hanging freely for now.

PASO 40 Connecting the heatbed power cables

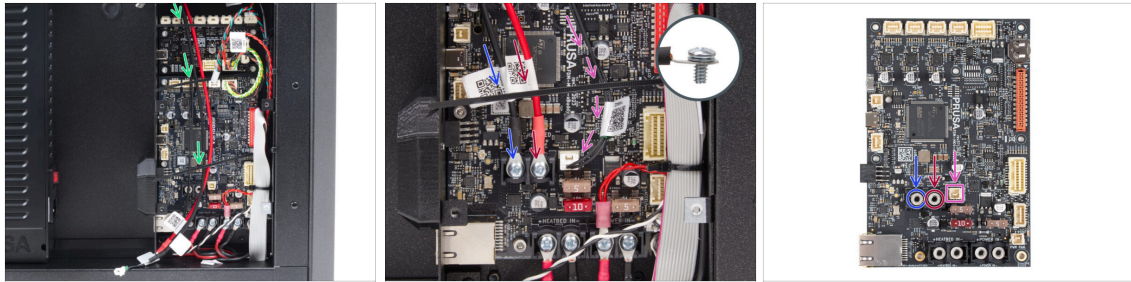

- Ensure that none of the heatbed cables run over the zip ties—they must be guided underneath.
- Using the 6-32 terminal screw, connect the **black** power cable to the **left** terminal on the xBuddy board. Tighten firmly.
- Using the 6-32 terminal screw, connect the **red** power cable to the **right** terminal. Tighten firmly.
- Plug the heatbed thermistor connector to the connector next to the power terminals.

PASO 41 Haribo time

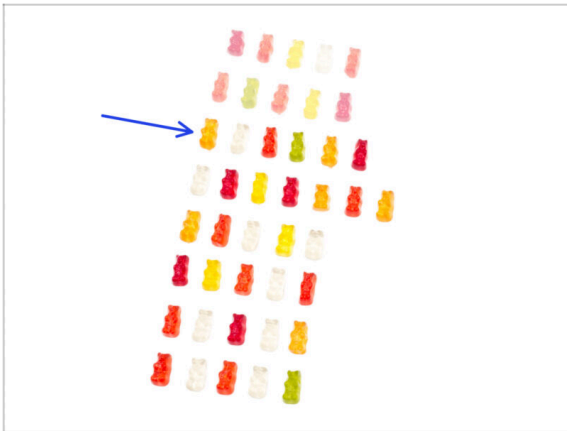


- Time for another quick energy boost!
- Eat the third row.
 - With one extra treat. You deserve it!

5. CoreXY assembly




PASO 1 Tools necessary for this chapter

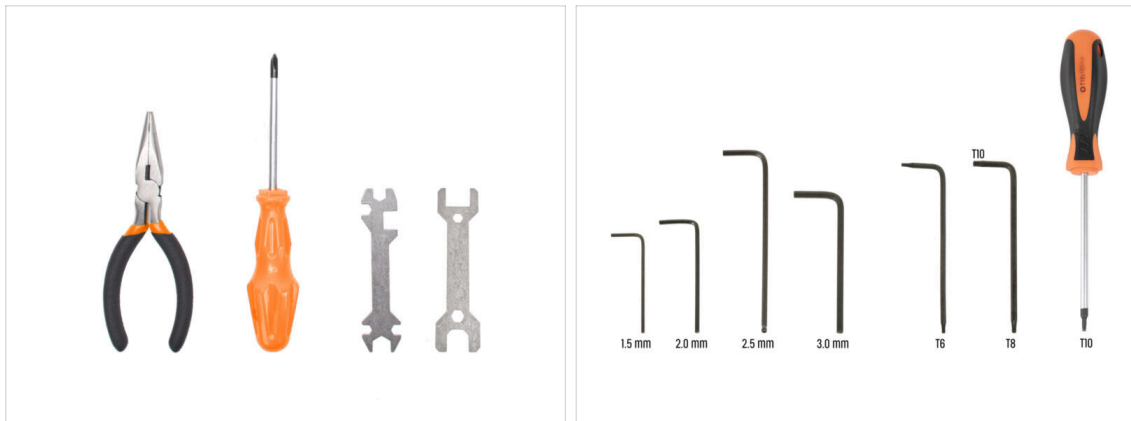


- **For this chapter, please prepare:**
- Needle-nose pliers
- 2.0mm Allen key
- 2.5mm Allen key
- T10 torx key / T10 torxy screwdriver

PASO 2 Rod holders: parts preparation

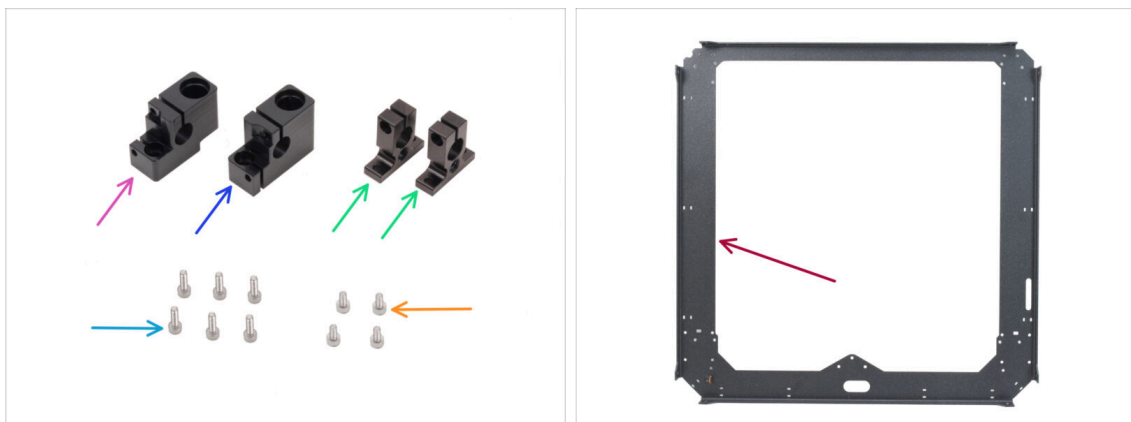


- **For the following steps, please prepare:**
- Rod holder left (1x) *found in the CORE XY parts + hinges + HB set package*
- Rod holder right (1x) *found in the CORE XY parts + hinges + HB set package*
- Rod holder rear (2x) *found in the CORE XY parts + hinges + HB set package*
- M3x10 screw (6x)
- M3x6 screw (4x)
- CoreXY plate (1x) *found in the Metal parts 1/3 package*

PASO 3 Assembling the rod holders

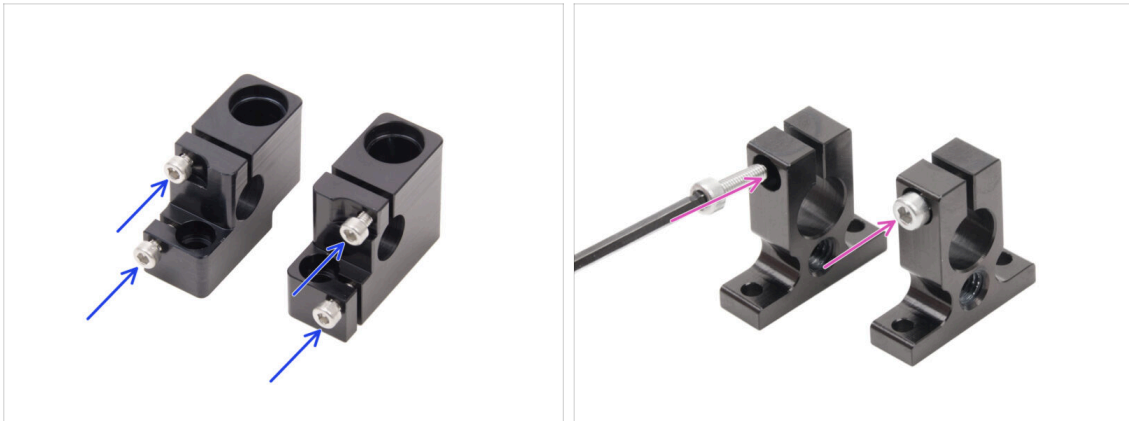


- Insert two M3x10 screws into the Rod holder left and two into the Rod holder right.
- **Do not tighten them completely**, a few turns are enough for now.
- Insert one M3x10 screw into each Rod holder rear. Insert from the **side with the screw head hole**.
- **Do not tighten them completely**, a few turns are enough for now.

PASO 4 Preparing the front rod holders

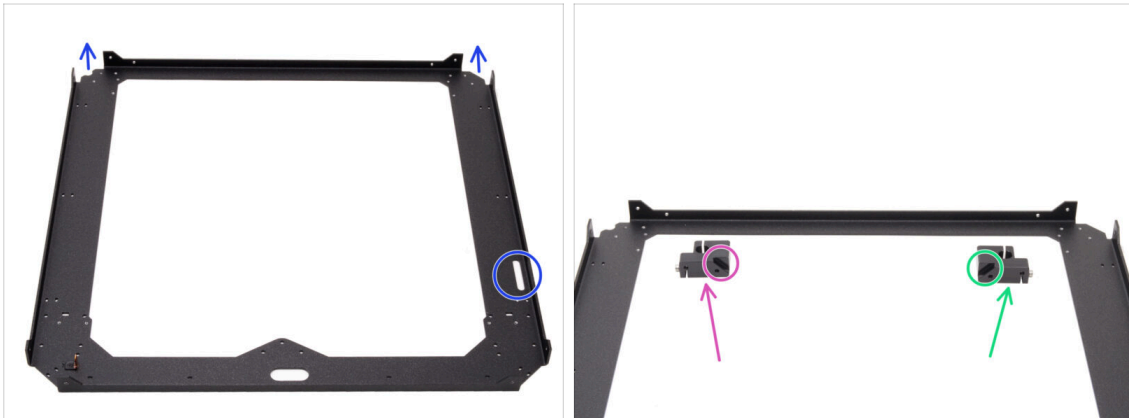

- Place the CoreXY plate as shown - the **bent parts of the plate must point upwards**.
- Divide the Rod holder left and the Rod holder right into the sides of the front:
 - ⚠ **Ensure you are preparing the correct part for the correct side. Use the chamfers on both parts as a reference for alignment.**
 - **Rod holder left**
 - **Rod holder right**

PASO 5 Installing the front rod holders

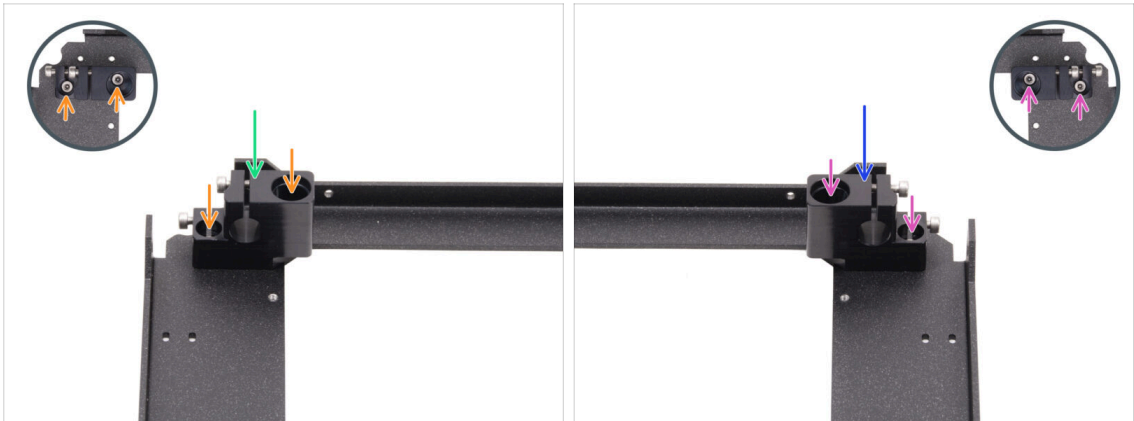


- Place the Rod holder left to the left front corner on the corresponding threaded holes.
- Secure it with two M3x6 screws.
- Place the Rod holder right to the right front corner on the corresponding threaded holes.
- Secure it with two M3x6 screws.

PASO 6 XY carriage: parts preparation




- For the following steps, please prepare:
- Linear holder left (1x) found in the Metal parts 1/3 package
 - Linear holder right (1x) found in the Metal parts 1/3 package
 - XY-carriage (2x) found in the Printed parts package
 - LM10LUU linear bearing (2x) found in the CORE XY parts + hinges + HB set package
 - GT2-20 Idler pulley (4x) found in the Electronics & Fasteners package
 - M3x8rT black screw (8x)
 - M3x18 screw (10x)

PASO 7 Assembling the XY-carriages

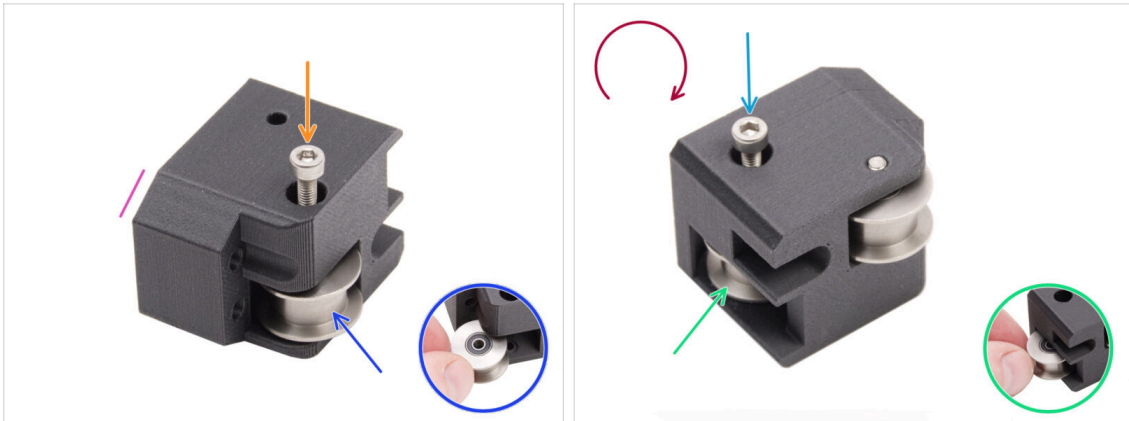


- ◆ Take one of the XY-carriage and orient it as shown. Use the beveled side as a guide.
- ◆ Insert the GT2-20 Idler pulley into the XY-carriage.
- ◆ Push one M3x18 screw through the pulley and tighten it completely down.
- ◆ Turn the part upside down.
- ◆ Insert another GT2-20 Idler pulley into the XY-carriage.
- ◆ Secure it with the M3x18 screw. Tighten it completely down.
- ◆ Repeat the same procedure with the second XY-carriage.

PASO 8 Assembling the linear holder left

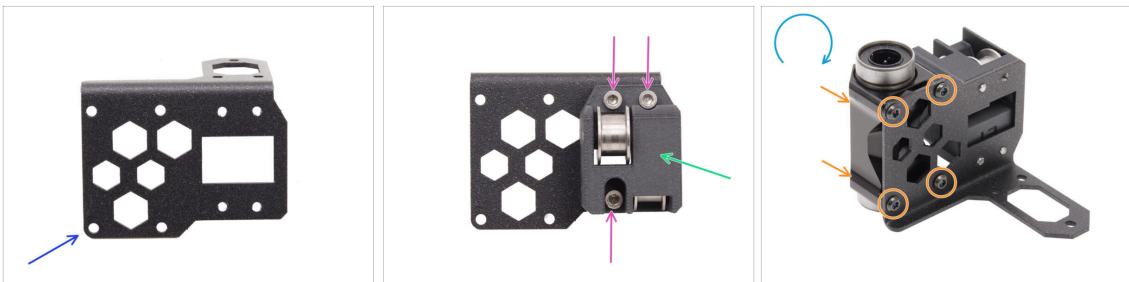


- ◆ Prepare the Linear holder **left** and position it as in the picture.
- ◆ Attach one of the XY-carriages to the Linear holder.
- ◆ Install it to the Linear holder with three M3x18 screws.
- ◆ Turn the Linear holder upside down.
- ◆ From the XY-carriage side, attach the LM10LUU linear bearing to the holder and secure it with four M3x8rT screws.

PASO 9 Assembling the linear holder right

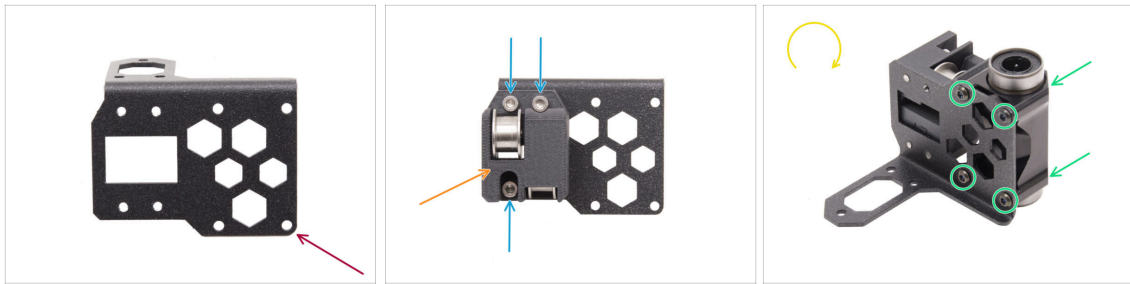


- Prepare the Linear holder **right** and position it as in the picture.
- Attach one of the XY-carriages to the Linear holder.
- Install it to the Linear holder with three M3x18 screws.
- Turn the Linear holder upside down.
- From the XY-carriage side, attach the LM10LUU linear bearing to the holder and secure it with four M3x8rT screws.

PASO 10 Attaching the linear holder assemblies

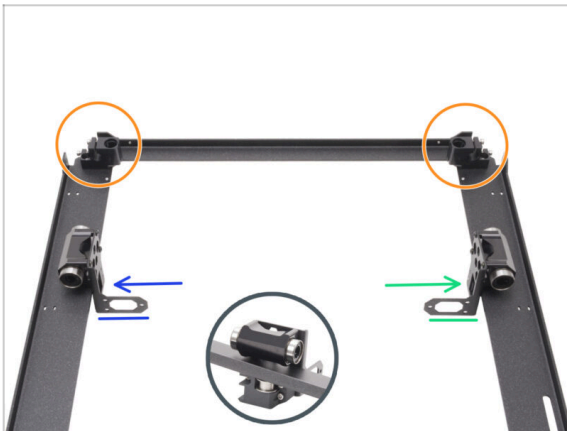


- Position the CoreXY plate as shown in the picture, ensuring the front rod holders are facing up.
- Slightly lift the CoreXY plate and from the plate's inner side loosely attach the Linear holder of the assemblies.
- **Linear holder left**
- **Linear holder right**
- ① The linear holders are now only loosely seated.

PASO 11 Smooth rods INFO

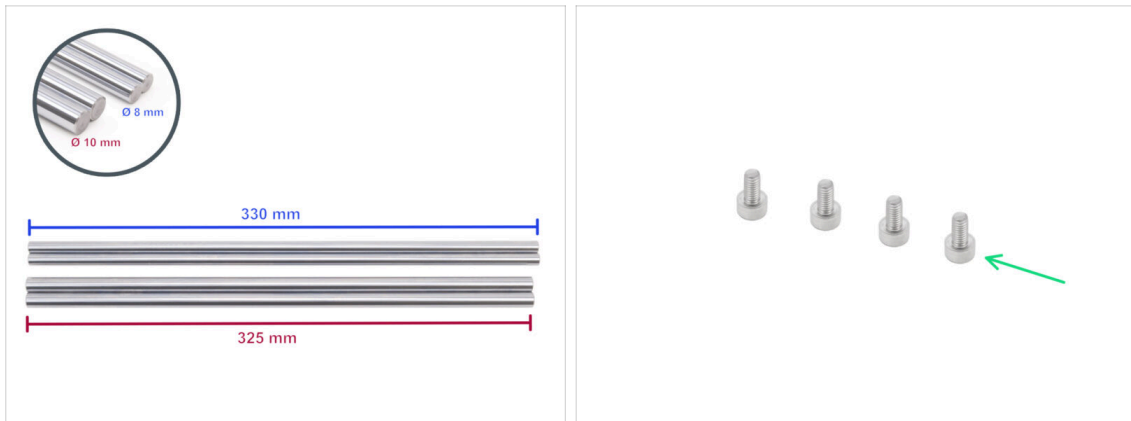


- The printer requires different smooth rod sizes. Ensure you have the correct ones:
 - Smooth rod 330 x 8 mm (2x)
 - Smooth rod 325 x 10 mm (2x)
originally from the Z-axis,
are needed for the following steps.
- Also prepare:
 - M3x6 screw (4x)

PASO 12 Mounting the smooth rods

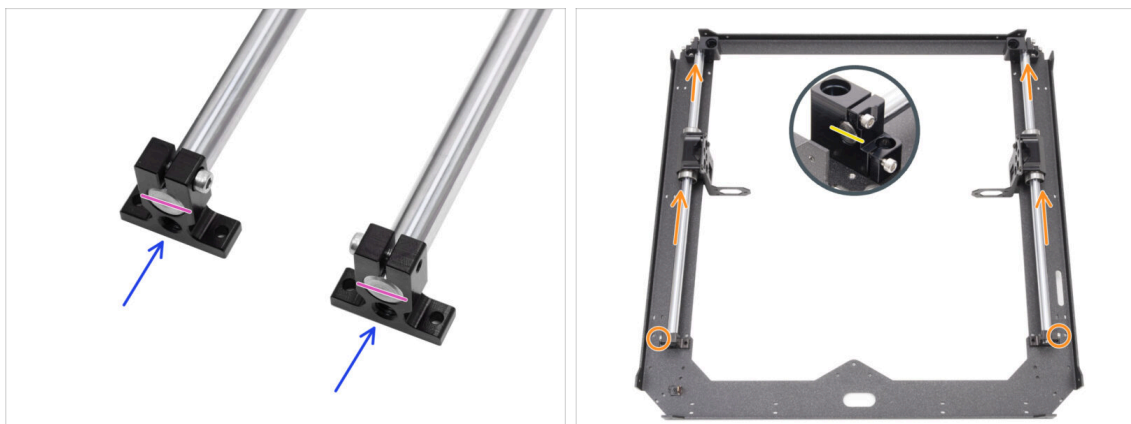


- Slide both rear rod holders onto both 10mm smooth rods.
- Line up the ends of the rods with the holders.
- Push both 10mm smooth rods through the LM10LUU bearing to the front rod holders.
- Make sure the screws on the rear rod holders are pointing out of the frame.
- Line up the front end of the 10mm smooth rods with the front rod holders.

PASO 13 Securing the rear rod holders

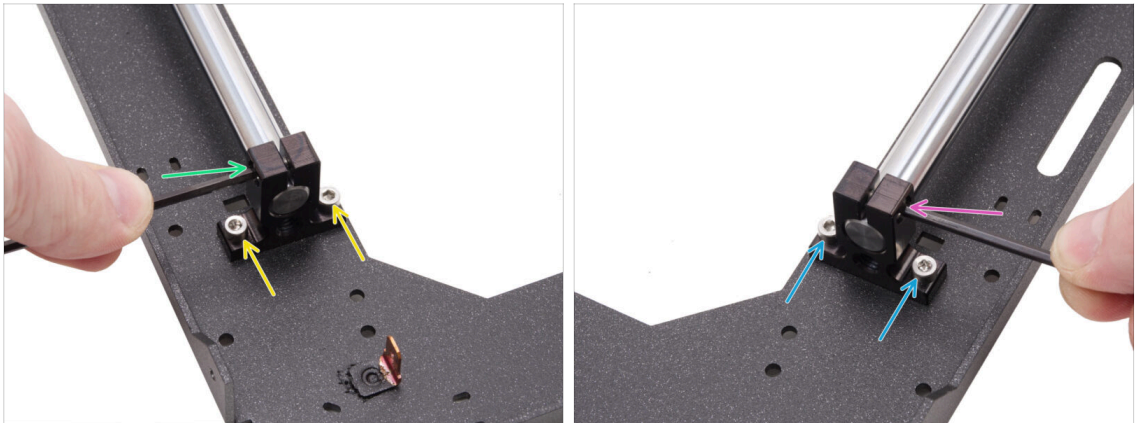


- Line up the left rear rod holder with the threaded holes in the plate.
- Fix it with two M3x6 screws.
- Firmly tighten the screw in the rod holder.
- Line up the right rear rod holder with the threaded holes in the plate.
- Fix it with two M3x6 screws.
- Firmly tighten the screw in the rod holder.

PASO 14 Securing the front rod holders

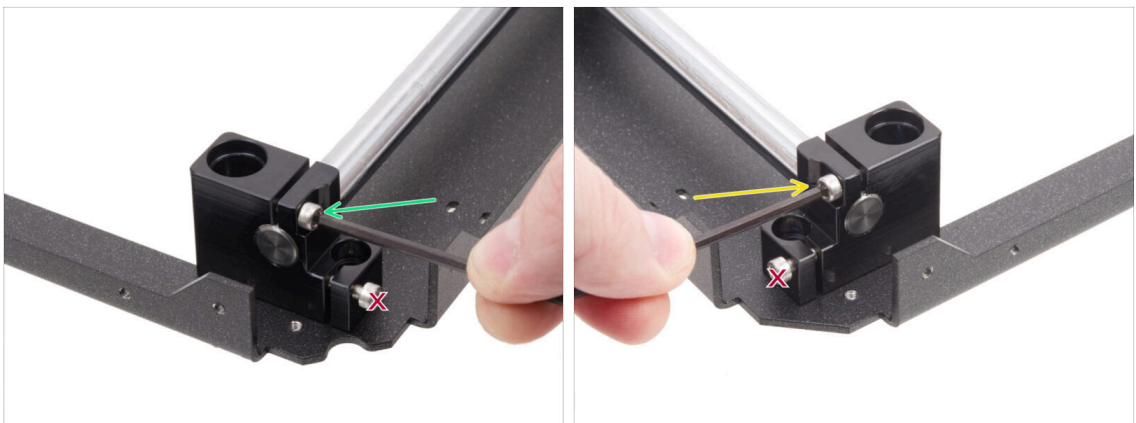

- Focus on the front left holder (now on the right) and secure the rod by tightening the screw in the holder.
- ⚠ **Do not tighten the bottom screw.**
- Focus on the front right holder (now on the left) and secure the rod by tightening the screw in the holder.
- ⚠ **Do not tighten the bottom screw.**


PASO 15 Motor mounts: parts preparation

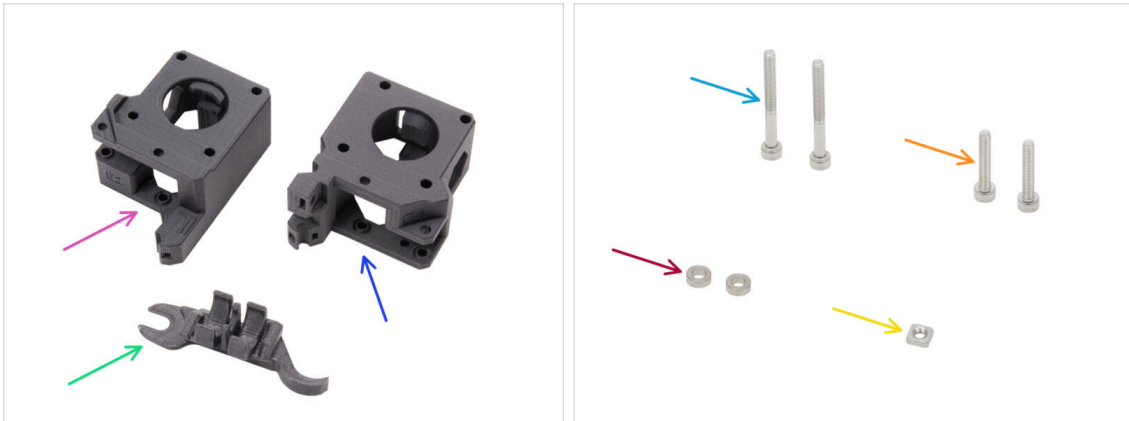

● **For the following steps, please prepare:**

- XY-motor-mount-left (1x) *found in the Printed parts package*
- XY-motor-mount-right (1x) *found in the Printed parts package*
- Assembly-multi-tool (1x) *you already used*
- M3x30 screw (2x)
- M3x18 screw (2x)
- Spacer 3.2/6x2 (2x) *found in the Electronics & Fasteners package*
- M3nS nut (1x)
- **i** The list continues in the next step...

PASO 16 Motor mounts: part preparation

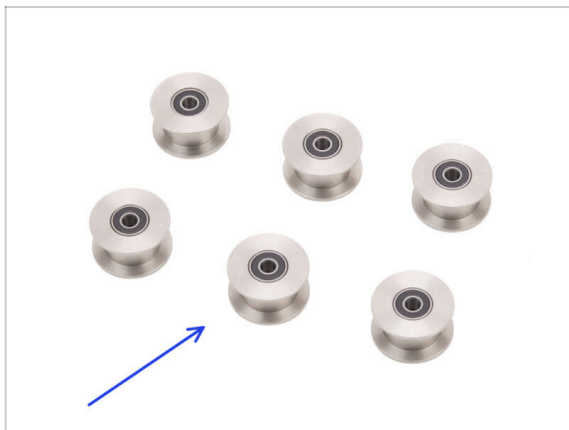


- GT2-20 Idler pulley (6x) *found in the Electronics & Fasteners package*

PASO 17 Assembling the XY-motor-mount-right I.



- ✿ Insert one pulley into the lower position in the Assembly-multi-tool.
- ✿ Insert the spacer 3.2 on the pulley.
- ✿ Insert the second pulley into the Assembly-multi-tool.
- ✿ Insert the whole assembly into the XY-motor-mount-right.
 - ⬛ Position the part according to the picture. Note the beveled corner.
- ✿ Align holes in both parts and secure it with the M3x30 screw.
 - 🔩 The plastic part has no pre-cut thread, so the screw will create it as you tighten. Slight resistance is expected.
- ✿ Remove the Assembly-multi-tool.

PASO 18 Assembling the XY-motor-mount-right II.

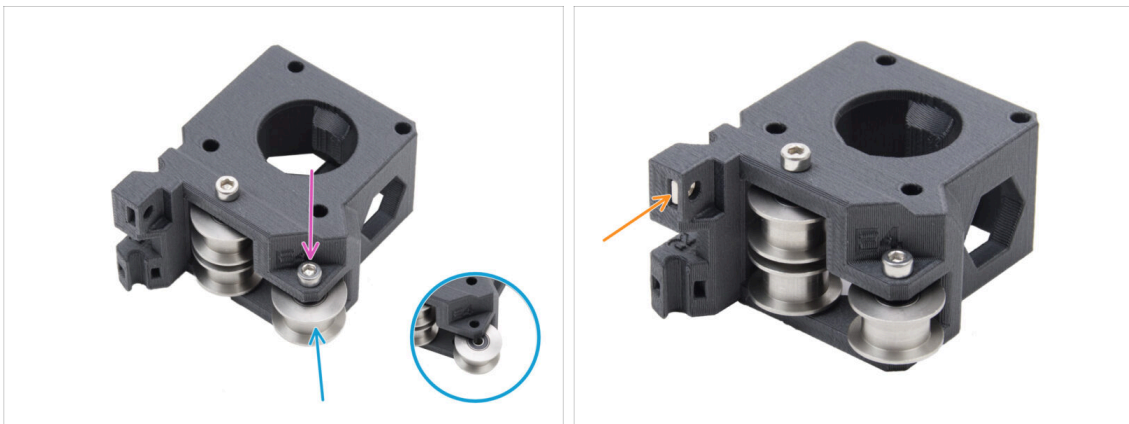

- ✿ Insert another pulley into the XY-motor-mount-right.
- ✿ Secure it with M3x18 screw.
 - ⓘ The plastic part has no pre-cut thread, so the screw will create it as you tighten. Slight resistance is expected.
- ✿ Insert the M3nS nut into the XY-motor-mount-right.

PASO 19 Assembling the XY-motor-mount-left I.




- ✿ Insert one pulley into the lower position in the Assembly-multi-tool.
- ✿ Insert the spacer 3.2 on the pulley.
- ✿ Insert the second pulley into the Assembly-multi-tool.
- ✿ Insert the whole assembly into the XY-motor-mount-left.
 - ⬛ Position the part according to the picture. Note the bevel next to the screw hole.
- ✿ Align holes in both parts and secure it with the M3x30 screw.
 - ⓘ The plastic part has no pre-cut thread, so the screw will create it as you tighten. Slight resistance is expected.
- ✿ Remove the Assembly-multi-tool.

PASO 20 Assembling the XY-motor-mount-left II.



- ✿ Insert another pulley into the part.
- ✿ Secure it with M3x18 screw. **Do not overtighten the screw.**
 - ⓘ The plastic part has no pre-cut thread, so the screw will create it as you tighten. Slight resistance is expected.

PASO 21 Belt tensioners: parts preparation I.

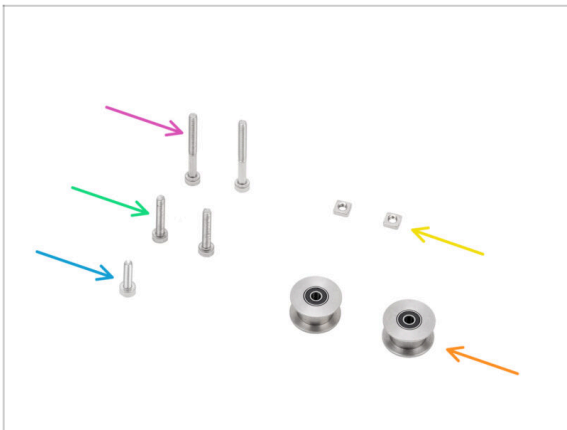

For the following steps, please prepare:

GT2-20 Idler pulley (2x) *you have removed from the MK4S*

M3x30 screw (2x)


M3x18 screw (2x)

M3x12 screw (1x)

M3nS nut (2x)

i The list continues in the next step...

PASO 22 Belt tensioners: parts preparation II.

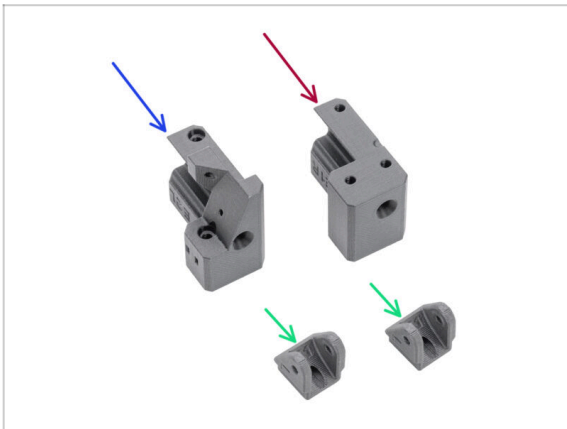


For the following steps, please prepare:

Belt-tensioner-left (1x) *found in the Printed parts package*

Belt-tensioner-right (1x) *found in the Printed parts package*

Belt-tensioner-pulley (2x) *found in the Printed parts package*

PASO 23 Preparing the tensioner pulleys

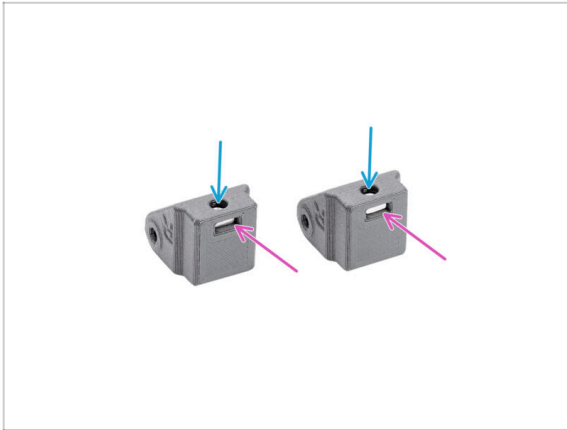

- ✦ Insert one M3nS nut into each Belt-tensioner-pulley.
- ✦ Make sure the nuts are correctly inserted into the parts. The holes in the nuts and the parts **must be aligned**.
- ✦ Keep both parts in this position.

PASO 24 Assembling the belt tensioner left I.



- ✦ Apply a small amount of Prusa lubricant to the tip of both M3x30 screws.
- ✦ Spread the lubricant evenly around the entire thread.
 - ⓘ Tip: Use the tip of a zip tie to spread the lubricant.
- ✦ Slide the Belt-tensioner-**left** onto the Belt-tensioner-pulley.
 - ✦ **Ensure the parts are oriented correctly**, as shown.
- ✦ Insert the M3x30 screw through the Belt-tensioner-left into the Belt-tensioner-pulley. **Do not tighten completely!** 3-4 turns are sufficient.

PASO 25 Assembling the belt tensioner left II.




- Insert the GT2-20 Idler pulley into the Belt-tensioner-pulley.
- Secure it with the M3x18 screw.
 - ⓘ The plastic part has no pre-cut thread, so the screw will create it as you tighten. Slight resistance is expected.
- Insert the M3x12 screw into the Belt-tensioner-left. Tighten slightly—five turns are enough. It must not protrude through the other side.
 - ⓘ Note: This screw, referred to as the tensioning screw, will later be used to adjust the door sensor.

PASO 26 Montaje del tensor derecho de la correa



- Slide the Belt-tensioner-**right** onto the Belt-tensioner-pulley.
 - **Ensure the parts are oriented correctly**, as shown.
- Insert the M3x30 screw through the Belt-tensioner-right into the Belt-tensioner-pulley. **Do not tighten completely!** 3-4 turns are sufficient.
- Insert the GT2-20 Idler pulley pulley into the Belt-tensioner-pulley-right.
- Secure it with the M3x18 screw.
 - ⓘ The plastic part has no pre-cut thread, so the screw will create it as you tighten. Slight resistance is expected.


PASO 27 Instalando los tensores de las correas: preparación de las piezas

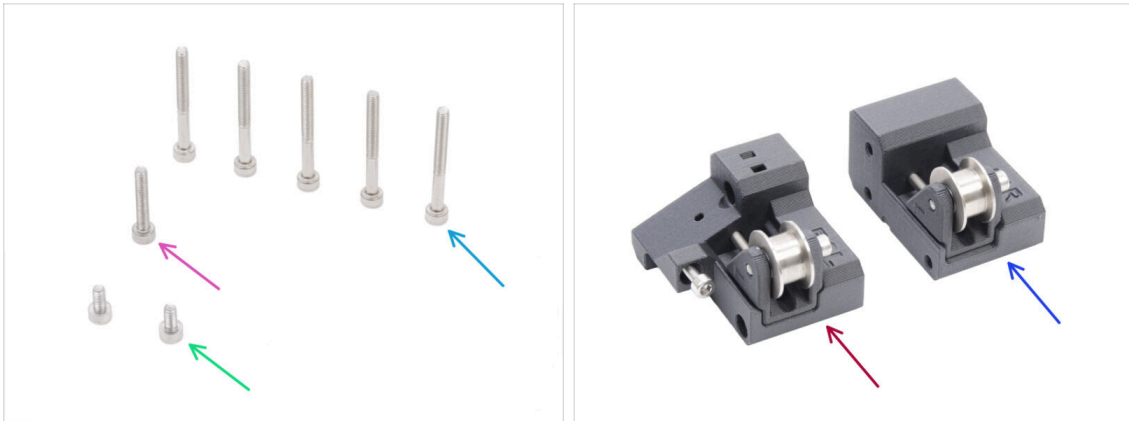

● For the following steps, please prepare:


- M3x30 screw (5x)
- M3x18 screw (1x)
- M3x6 screw (2x)
- Belt tensioner left assembly (1x) *you assembled earlier*
- Belt tensioner right assembly (1x) *you assembled earlier*

PASO 28 Installing the motor mount left

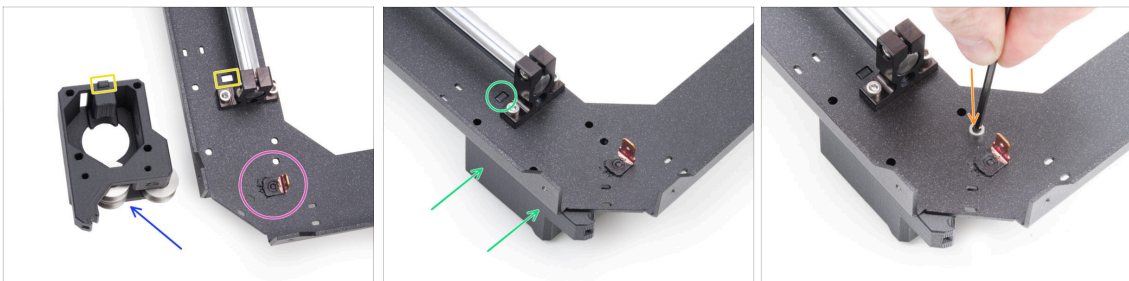


- Locate the corner of the CoreXY plate with the Faston connector on it. It is on the underside of the assembly.
- Position the motor-mount-**left** on the CoreXY plate as shown in the picture.
- Note the rectangular protrusion on the motor-mount-left and the rectangular cutout on the CoreXY plate.
- Slide the motor-mount-left under the CoreXY plate, ensuring the rectangular protrusion fits into the cutout.
- Align the holes in both parts and secure them with an M3x6 screw in the designated hole

PASO 29 Installing the motor mount right

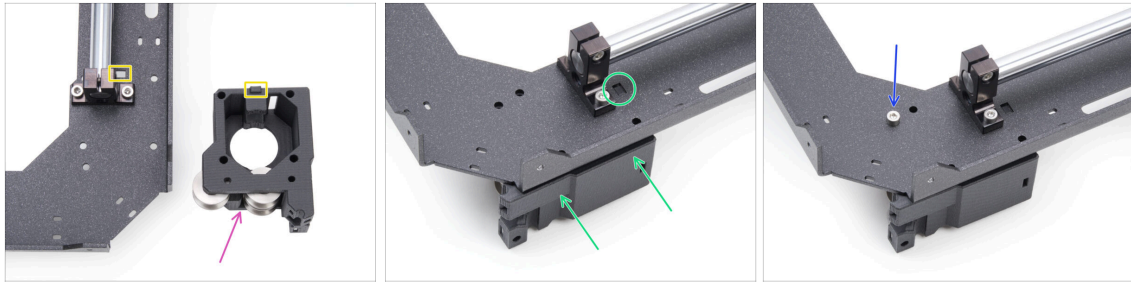


- ◆ Position the motor-mount-**right** on the CoreXY plate as shown in the picture.
- ◆ Note the rectangular protrusion on the motor-mount-right and the rectangular cutout on the CoreXY plate.
- ◆ Slide the motor-mount-right under the CoreXY plate, ensuring the rectangular protrusion fits into the cutout.
- ◆ Align the holes in both parts and secure them with an M3x6 screw in the designated hole

PASO 30 Installing the belt-tensioner-left

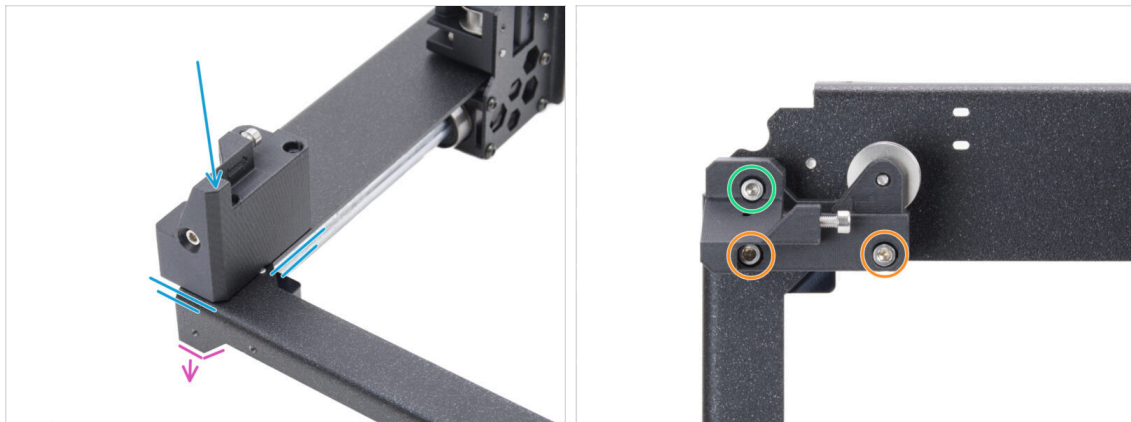


- ◆ Turn the CoreXY assembly upside down so that the bent parts face downward. Focus on the front left corner on the assembly.
- ◆ Place the belt-tensioner-**left** assembly in the front left corner of the CoreXY plate. Align it with the front and inner side edges.
 - ◆ Line up the holes in both parts.
 - ◆ Secure the part with two M3x30 screws.
 - ◆ Insert and tighten one M3x18 screw.

PASO 31 Installing the belt-tensioner-right

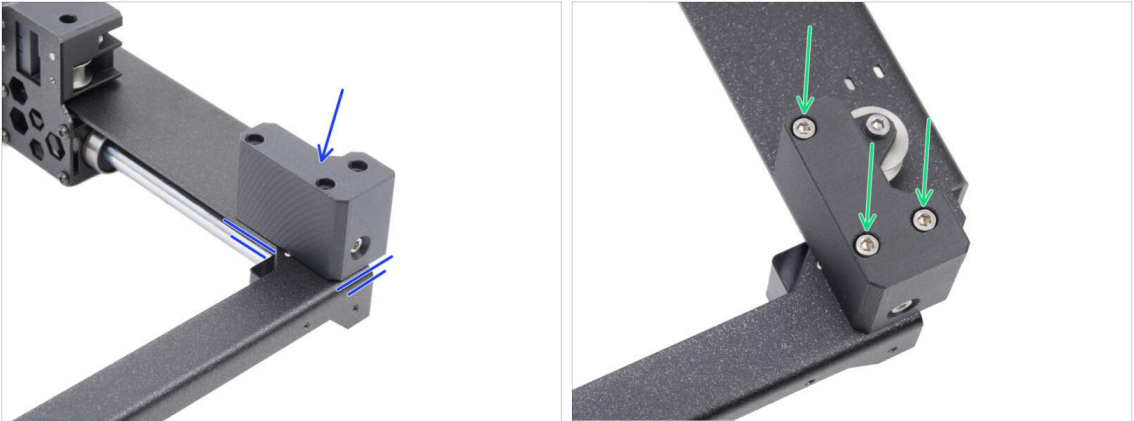


- Place the belt-tensioner-**right** assembly in the front right corner. Align it with the front and inner side edges.
- Line up the holes in both parts.
- Secure the part with three M3x30 screws.

PASO 32 Guías lineales: preparación de las piezas

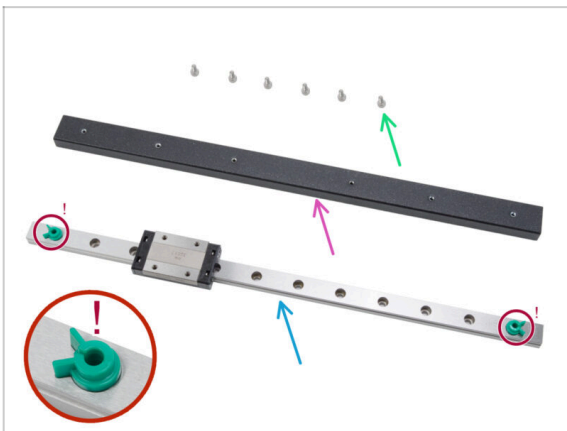

- For the following steps, please prepare:
 - M3x6 screw (6x)
 - Linear rail beam (1x) *found in the Metal parts 3/3 package*
 - Linear rail (1x) *found in the Electronics & Chamber parts package*
- ⚠ **Under no circumstances remove the green anti-ejection safety pins.** Wait for the prompt in the instructions.
- Piece of cloth or a paper towels to wipe the preservative lubricant from the linear guide.


PASO 33 Colocando la guía lineal

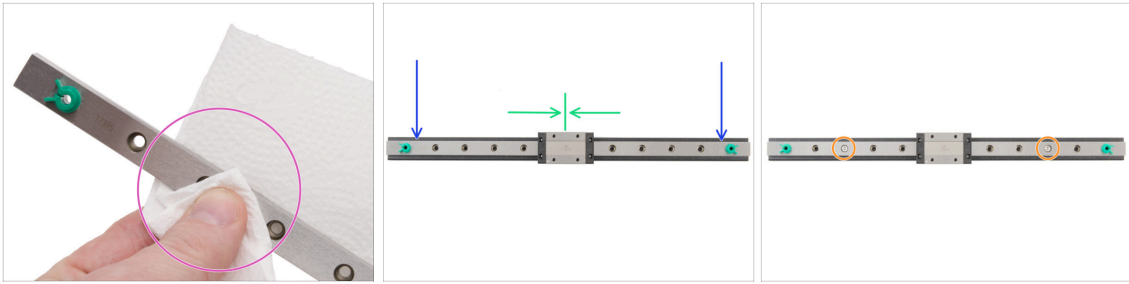

⚠ Under no circumstances remove the green anti-ejection safety pins. Wait for the prompt in the instructions.

- ✎ Immediately after removing the linear guide from the package, wipe off the preservative lubricant with a paper towel.
- ⬢ Attach the linear rail on the linear rail beam and line up the holes in both parts.
- 🟡 Insert and slightly tighten two M3x6 screws into the third holes from both ends.
- 🟢 Move the linear carriage approximately to the center of the rail.

PASO 34 Securing the linear rail

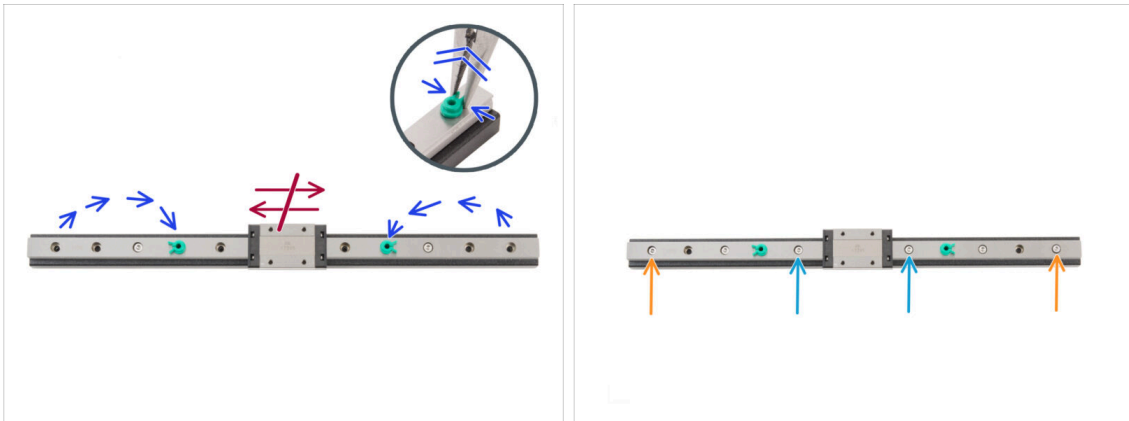


⚠ Do not move the linear carriage in any way in this step.

- ⬢ Relocate the safety pins from each end to the fourth holes from the ends of the linear rail.
- ⬢ Gently squeeze the safety pin with needle-nose pliers and pull it out.
- ⬢ Insert two M3x6 screws into the fifth holes from the ends of the rail. **Tighten just slightly.**
- 🟡 Insert two M3x6 screws into the first holes in the rail. **Tighten just slightly.**

⚠ Do not remove the safety pins from the rail.

PASO 35 Installing the linear rail: parts preparation

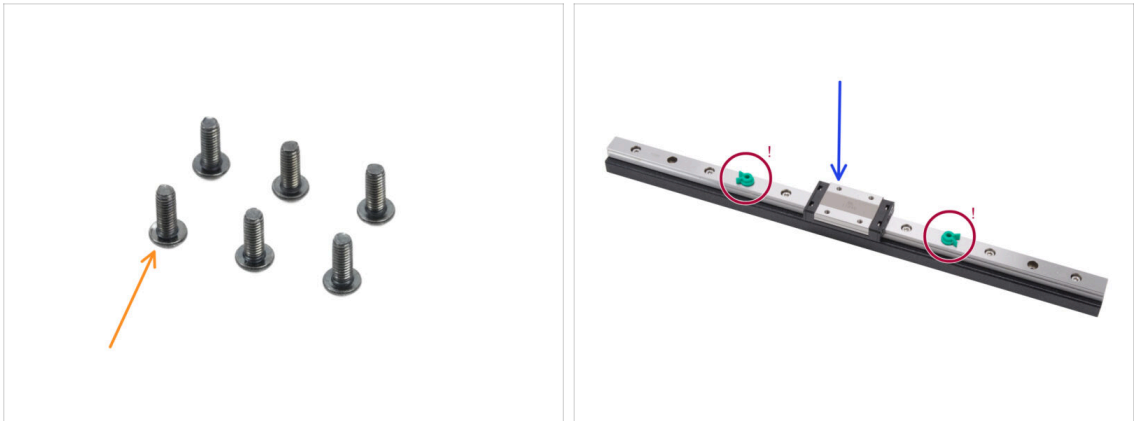

For the following steps, please prepare:

M3x8rT screw (6x)

i There are both M3x8rT and M3x8 screws in the kit. Make sure you have prepared the correct ones.

Linear rail assembly (1x) *you assembled earlier*

! Do not remove the safety pins.

PASO 36 Installing the linear rail assembly




Position the assembly with the motor mounts facing you.

Move both linear holders approximately to the center of the Y-axis.

Attach the linear rail assembly to the holders from the front side of the assembly.


Secure it with three M3x8rT screws from the back side on both the left and right sides.

PASO 37 Linear rail: removing the safety pins

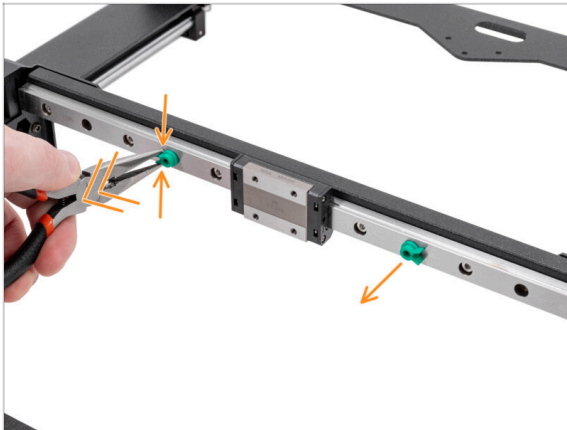

- Gently squeeze both safety pins with needle-nose pliers and pull them out of the linear rail.
- i You can discard the safety pins as they are no longer needed.

PASO 38 Bed-stop: parts preparation

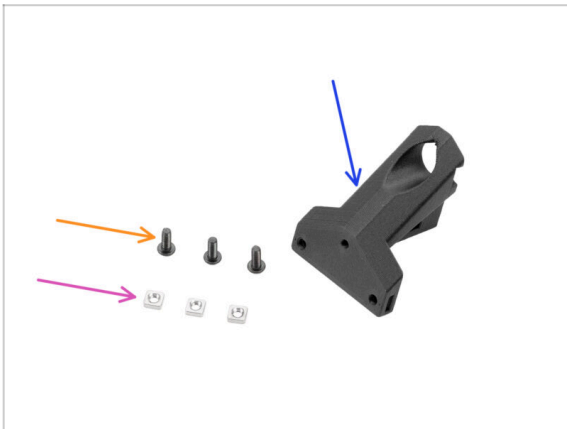

- **For the following steps, please prepare:**
- Bed-stop-rear (1x) *found in the Printed parts package*
- M3nS nut (3x)
- M3x8rT screw (3x)

PASO 39 Assembling the bed-stop




- Insert two M3nS nuts into the bed-stop from one side.
- Insert one M3nS nut into the bed-stop from the other side.

PASO 40 Mounting the bed-stop



- Position the CoreXY assembly as shown, ensuring the motor mounts face upwards.
- Focus on the triangle protrusion on the metal part.
- Insert the bed-stop-rear **under** the protrusion at the back of the CoreXY plate.
- Align all three holes in both parts.
- Secure both parts together with three M3x8rT screws.
- i** The upper screw is screwed into plastic with no pre-cut thread. It cuts the thread as it's tightened. Slight resistance is expected.

PASO 41 X&Y motors: parts preparation

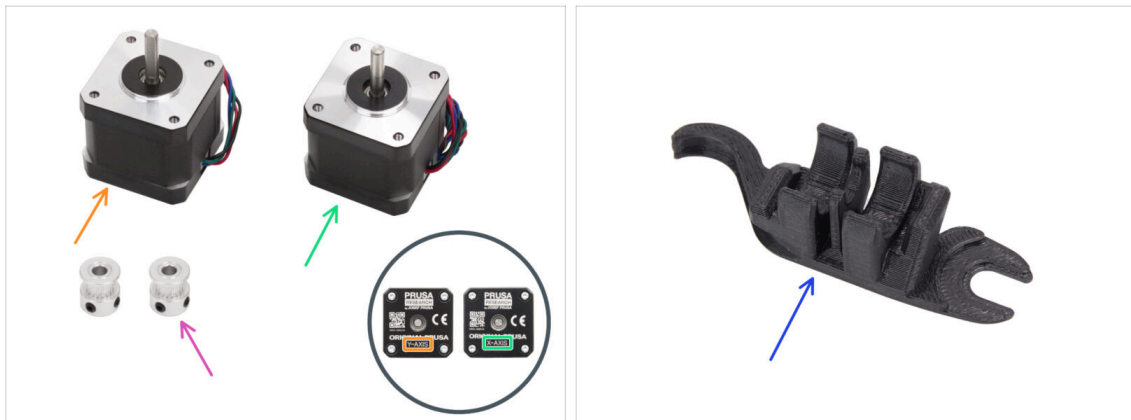

- For the following steps, please prepare:**
- Y-axis motor (1x)
- X-axis motor (1x)
- i** Note that the motors are marked as X and Y-axes in order to distinguish between them. We will continue to follow this marking.
- Pulley T16-2GT (2x)
- Assembly-multi-tool (1x) *you already used*

PASO 42 Instalando la polea del eje X




- Prepare the **X-axis** motor.
- Note the flat part on the motor shaft.
- ⚠ Slide the Pulley on, **note the CORRECT orientation.**
- Rotate the motor shaft with the flat part facing you.
- Using the fork on the Assembly-multi-tool set a gap between the pulley and the motor.
- Push the pulley on the tool and firmly tighten the screw against the flat part on the shaft.
- Rotate the pulley and firmly tighten the second grub screw.
- ⚠ Double-check the pulley orientation. **The toothed side of the pulley must be on the motor side.**

PASO 43 Installing the Y-axis pulley



- Prepare the **Y-axis** motor.
- Note the flat part on the motor shaft. Rotate the motor shaft with the flat part facing you.
- ⚠ Slide the Pulley on, and **note the CORRECT orientation. The Y-axis pulley orientation is DIFFERENT from the X-axis. Make sure the pulley teeth face away from the motor. Use the wider hook on the assembly tool.**
- Using the hook on the Assembly-multi-tool, place the thicker curved part between the pulley and the motor.
- ⚠ **Do not try to hook it around the shaft.** Just rest the tool against the motor and make sure the hook tip slides between the motor and the pulley.
- Push the pulley on the tool and firmly tighten the screw against the flat part on the shaft.
- Rotate the pulley and firmly tighten the second grub screw.
- ⚠ **Double-check the pulley orientation. The teeth must face away from the motor.**

PASO 44 XY belts: parts preparation

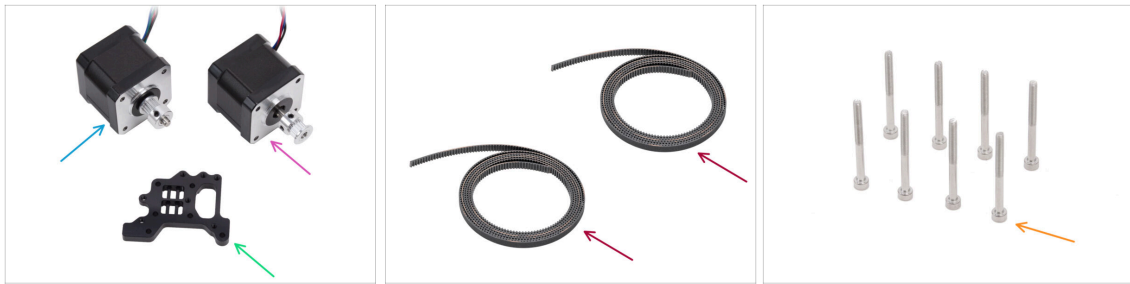

■ For the following steps, please prepare:

- X-axis motor assembly (1x) *you assembled earlier*
- Y-axis motor assembly (1x) *you assembled earlier*
- XY belt (2x) *found in the CORE XY parts + hinges + HB set package*
- Nextrunder holder (1x) *found in the CORE XY parts + hinges + HB set package*
- M3x35 screw (8x)

PASO 45 XY belts INFO




❗ The next steps cover belt installation and guiding on the core XY assembly. Before starting, refer to the illustration for an overview and better understanding of each belt's path.

- X-axis belt - at the **top position**
- Y-axis belt - at the **bottom position**


■ Let's guide the belts step by step...

PASO 46 Y belt guiding: Y motor pulley

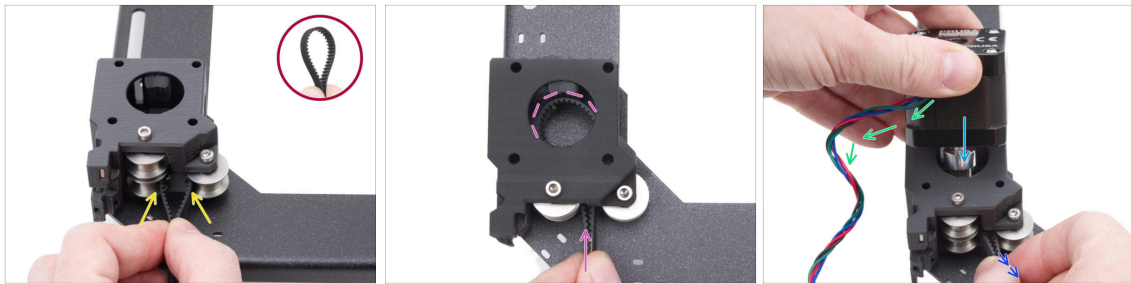

- From the back of the CoreXY, focus on the motor-mount on the **left** side.
- Create a loop anywhere on the belt so the **belt teeth are pointing inside** the loop.
- Push this loop through the space between the lower pulleys inside the motor mount.
- Push through enough to make the loop follow the top round hole of the motor-mount as closely as possible.
- Insert the **Y** motor into the motor holder, the pulley must be in the middle of the belt loop.
- Insert the Y motor pulley into the motor mount, ensuring the pulley is centered within the belt loop.
Fully attach the motor to the motor-mount with the motor cable facing you.
- Pull lightly on the belt loop to encircle the pulley.

PASO 47 Securing the Y-axis motor

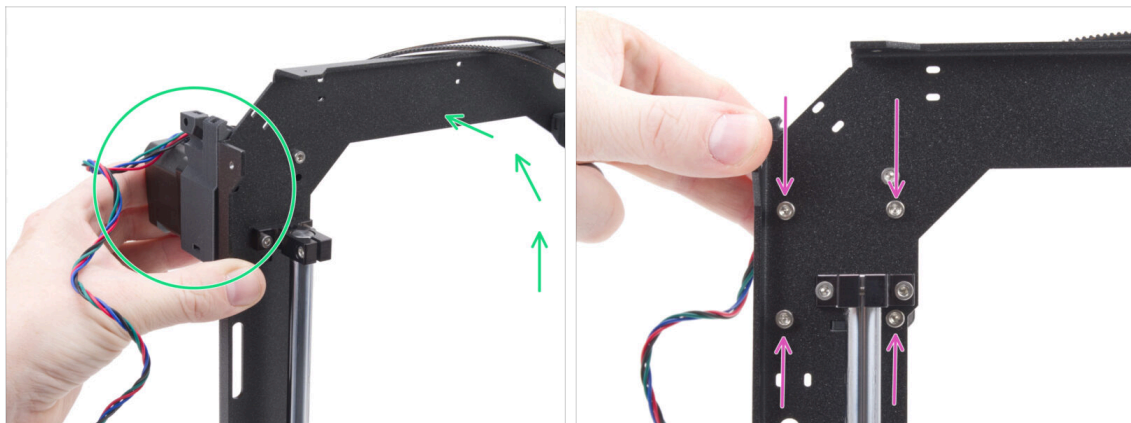

- Sujeta firmemente el conjunto del motor del eje Y y coloca el conjunto CoreXY en posición vertical. **¡No dejes caer el motor!**
- ⚠ Be careful not to pull the entire belt out of the motor.
- Keep holding the motor with one hand. With the other hand, secure the motor using four M3x35 screws on the underside of the frame. **Tighten firmly.**
- Place the CoreXY assembly back into the horizontal position.

PASO 48 Y belt guiding: Y motor mount




- 🟡 Guide the left end of the belt around the lower left pulley.
- 🟣 Push the belt through the part and guide it to the front of the CoreXY plate.
- ⚠️ **Don't pull too long so you don't pull the whole belt out.** Remember that the other end is loose. The whole process would then have to be repeated.

PASO 49 Y belt guiding: belt tensioner




- 🟡 Guide the belt around the pulley in the belt tensioner.
- 🟣 Push the belt around the front pulley in the linear assembly.
- 🟢 Prepare the Nextruder holder in the same orientation as in the picture. Note the holes for securing the belts.
- 🟡 Push the end of the belt through the middle hole into the left hole in the bottom row - leave 4-5 teeth sticking out.
- 📄 The belt is secured on this end. You can leave it free for now.

PASO 50 Y belt guiding: X motor mount

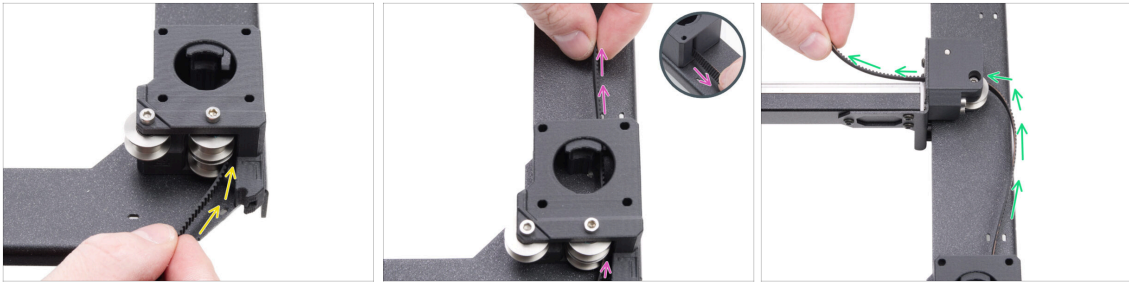


- ⬛ Back to the other end of the Y belt.
- 🟡 Take the other end of the belt and guide it around the lower pulley in the X motor mount.
- 🟣 Push it through the motor mount to the front.
- 🟢 Route the belt around the lower right pulley in the linear rail holder.

PASO 51 Y belt guiding: securing the belt

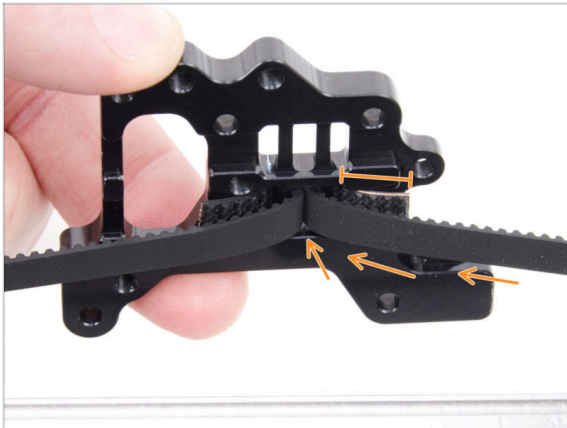


- 🟠 Push the end of the belt through the middle hole to the right hole in the bottom row of the Nextruder holder - leave 4-5 teeth sticking out.
- 📌 ⓘ If it's difficult to reach the Nextruder holder with the belt, you can loosen the belt tensioner screw on the front of the assembly.
- 📌 ⚠️ Don't forget to adjust it back after securing the belt.

PASO 52 X belt guiding: X motor pulley

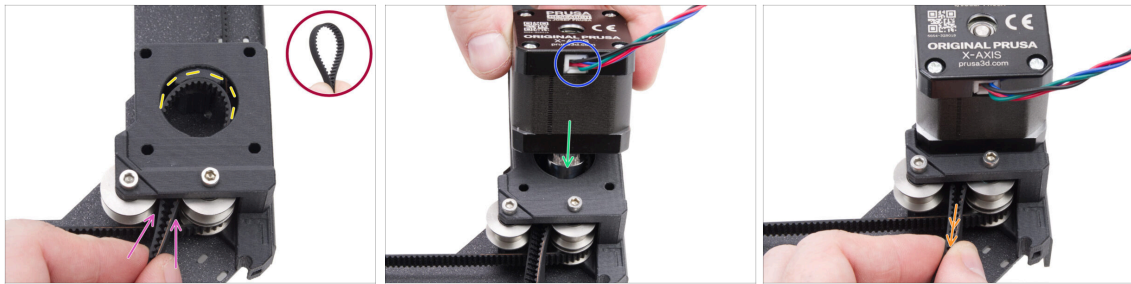

- From the back of the CoreXY, focus on the motor-mount on the **right** side.
- Create a loop anywhere on the second belt so the belt teeth are pointing inside the loop.
- Push this loop through the space between the upper pulleys inside the motor mount.
- Push through enough to make the loop follow the top round hole of the motor-mount as closely as possible.
- Insert the **X** motor pulley into the motor mount, ensuring the pulley is centered within the belt loop.
- Ensure the motor cable is facing you (rear).
- Pull lightly on the belt loop to encircle the pulley.

PASO 53 Securing the X-axis motor

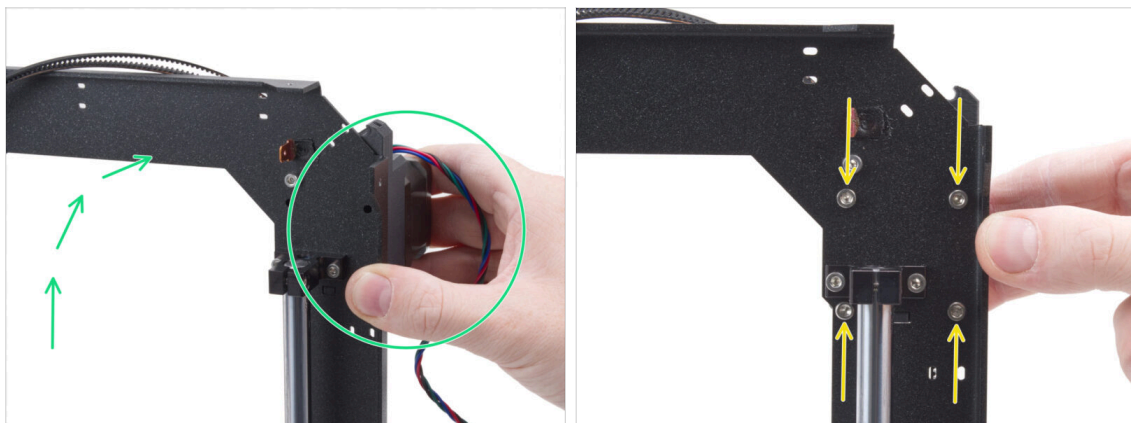

- Firmly grasp the X-axis motor assembly and position the CoreXY assembly vertically. **Do not drop the motor!**
- ⚠ Be careful not to pull the entire belt out of the motor.
- Keep holding the motor with one hand. With the other hand, secure the motor using four M3x35 screws on the underside of the frame. **Tighten firmly.**
- Place the CoreXY assembly back into the horizontal position.

PASO 54 Y belt guiding: X motor mount




- Guide the right end of the belt around the upper right pulley.
- Push the belt through the part and guide it to the front of the CoreXY plate.
- ⚠ **Don't pull too long so you don't pull the whole belt out.** Remember that the other end is loose. The whole process would then have to be repeated.

PASO 55 X belt guiding: belt tensioner



- Guide the belt around the pulley in the belt tensioner.
- Push the belt around the front upper pulley in the linear assembly.
- Route the end of the belt through the middle hole into the right hole - leave 4-5 teeth sticking out.
- ⓘ The belt is secured on this end. You can leave it free for now.

PASO 56 X belt guiding: Y motor mount

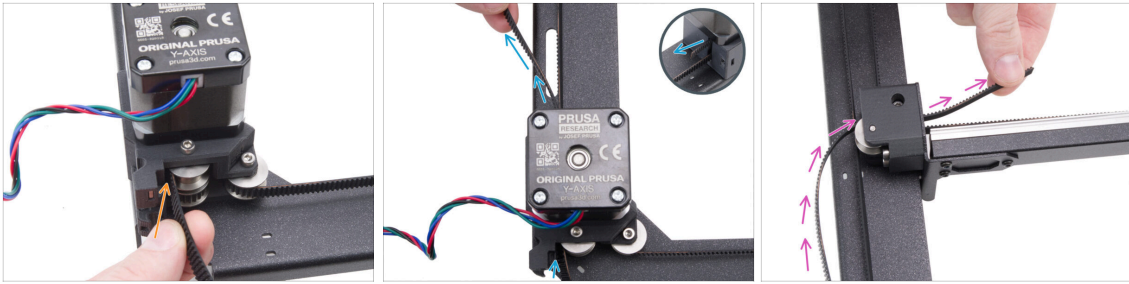

- ✦ Take the other end of the belt and guide it around the upper pulley in the Y motor mount.
- ✦ Push the belt through the motor mount.
- ✦ Route the belt around the upper front pulley in the linear rail holder.

PASO 57 X belt guiding: securing the belt





- ✦ Push the end of the belt through the middle hole to the left hole in the upper row of the Nexttruder holder - leave 4-5 teeth sticking out.

PASO 58 Checking the belt guidance




Before proceeding, recheck the belt routing according to the illustration.

PASO 59 Bowden guide: parts preparation

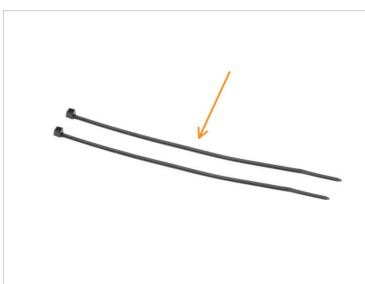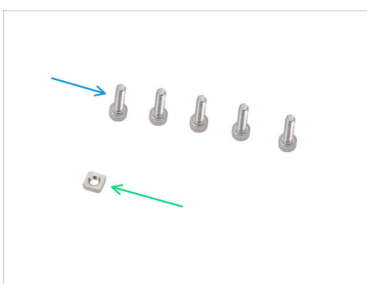

- **For the following steps, please prepare:**
- Bowden-guide (1x) *found in the Printed parts package*
 - M3x10 screw (5x)
 - M3nS nut (1x)
 - Zip tie (2x)


PASO 60 Securing the Nextruder holder

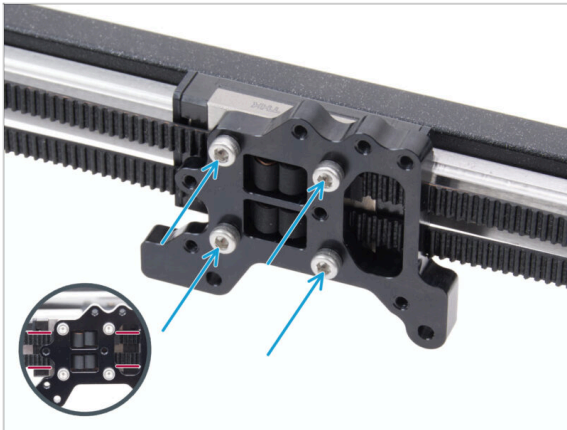

- Attach the Nextruder holder to the linear rail carriage and secure it using four M3x10 screws.


CAUTION: Ensure no belt obstructs the screw. Avoid screwing through the belt!

PASO 61 Securing the Y motor cable

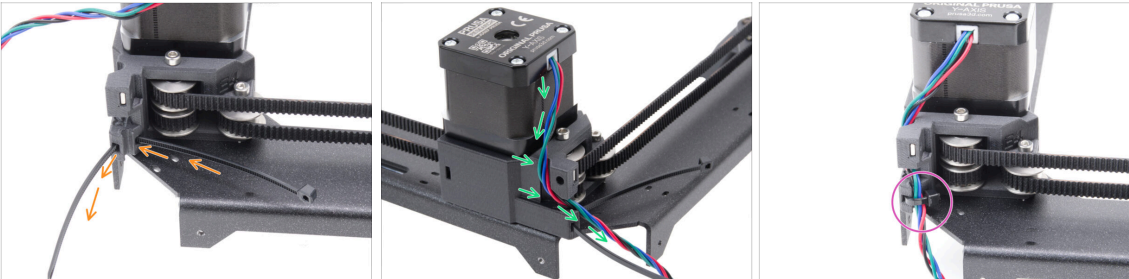


- Push the zip tie through the motor-mount-right (Y-axis motor).
- Route the Y motor cable through the cable channel in the motor-mount-right and over the zip tie.
- Secure the cable with a zip tie and trim the excess.

PASO 62 Securing the X motor cable

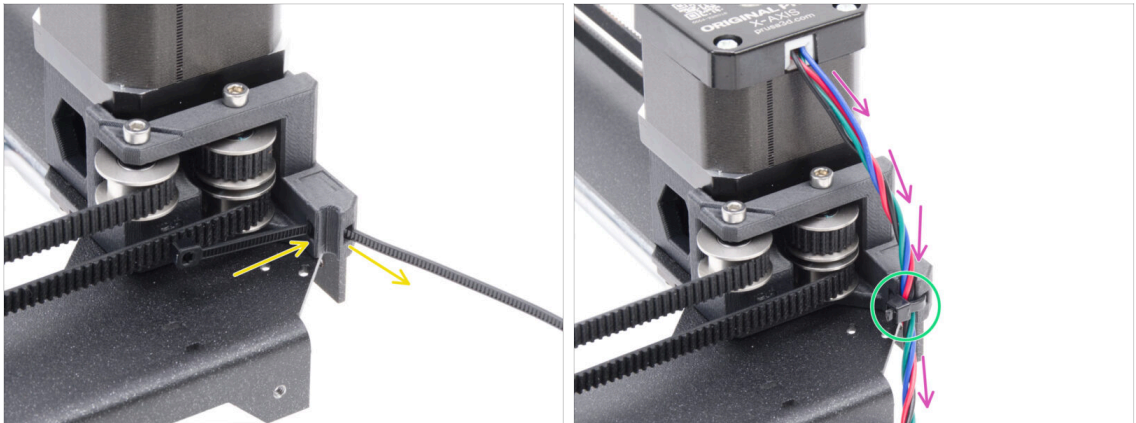

- ✦ Push the zip tie through the motor-mount-left (X-axis motor).
- ✦ Route the X motor cable through the cable guide in the motor-mount-right and over the zip tie.
- ✦ Secure the cable with a zip tie and trim the excess.

PASO 63 Installing the bowden guide

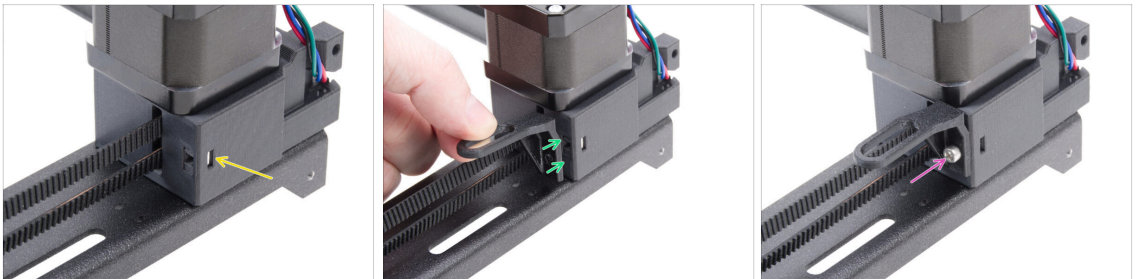

- ✦ Insert the M3nS nut into the motor-mount-right (Y-axis motor).
- ✦ Attach the bowden-guide to the motor-mount-right.
 - ⚠ Note the correct orientation of the part.
- ✦ Fix the bowden-guide in place using the M3x10 screw.

PASO 64 White LED strip: parts preparation



● For the following steps, please prepare:

● White LED strip (1x) found in the *Electronics & Fasteners* package

● CoreXY strut (1x) found in the *Metal parts 1/3* package

ⓘ The part is inserted in a foam cutout and may not be immediately visible at first glance.

● M3x4rT screw (2x)

PASO 65 Sticking the White LED strip



● Carefully peel off the protective (paper) layer from the White LED strip.

⚠ After removing the protective layer, the LED strip is adhesive.


● Position the White LED strip near the CoreXY strut to check alignment, but **do not attach it yet**.

⚠ Note the rectangular cutout on the strut, orient the strip cable to the same side.

● Stick the White LED strip evenly to the strut - on the side with the rectangular cutout.


● After sticking, press lightly on the blank areas of the strip to ensure adhesion. **Do not touch LEDs and resistors!**

PASO 66 Installing the white LED assembly

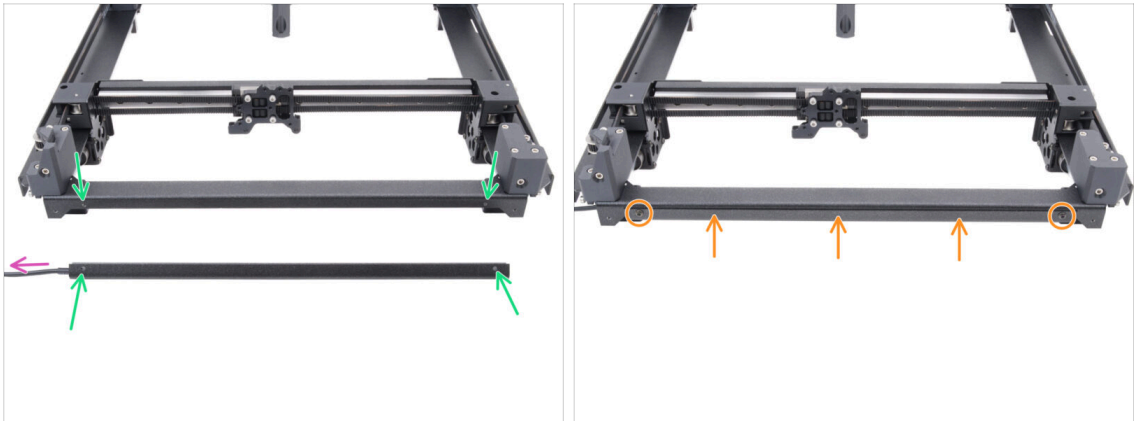


- Take the white LED assembly and attach it to the front of the CoreXY assembly. Align the holes of both parts.
- **The white LED strip cable must point to the left.**
- Attach the LED assembly to the CoreXY plate and secure it with two M3x4rT screws.

PASO 67 Door sensor & White LED strip: parts preparation

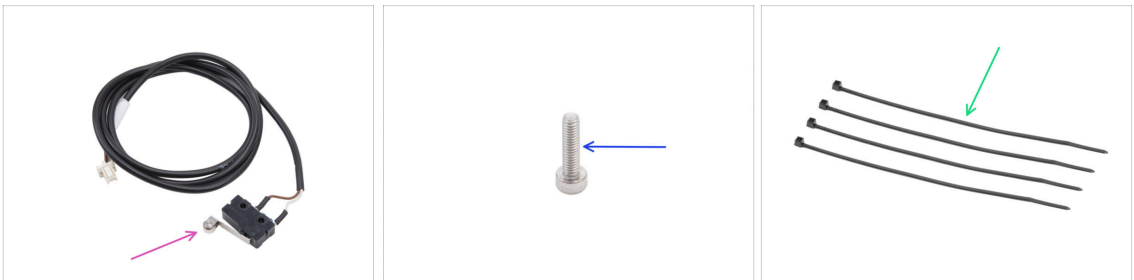

- **For the following steps, please prepare:**
- Door sensor (1x) *found in the CORE XY parts + hinges + HB set package*
- M2.5x10 screw (1x) *silver*
- Zip tie (4x)

PASO 68 Inserting the zip ties

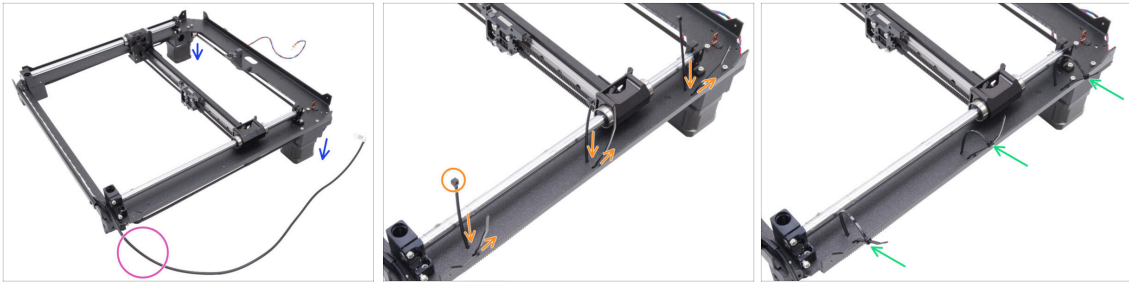


- ◆ Flip the CoreXY assembly upside down and rest it on the motors.
- ◆ Position it with the white LED strip cable facing toward you.
- ◆ Thread three zip ties through the CoreXY plate, ensuring the zip tie heads point inward.
- ◆ Partially tighten the zip ties—just enough to catch the first few teeth.
- ⚠ **Do not fully secure them yet, as we will route cables through them later.**
- ◆ Flip the assembly back with the motors facing upwards.

PASO 69 Installing the door sensor



- ◆ Place the door sensor on the left belt tensioner. The lever of the door sensor must face forward.
- ◆ Secure the door sensor with the M2.5x10 screw.
- ◆ Tighten the bolt fully and then loosen 1/4 turn. The sensor must be allowed to move.
- ◆ From the rear of the belt tensioner, tighten the M3x12 screw so that it touches the door sensor.

PASO 70 Securing the door sensor cable

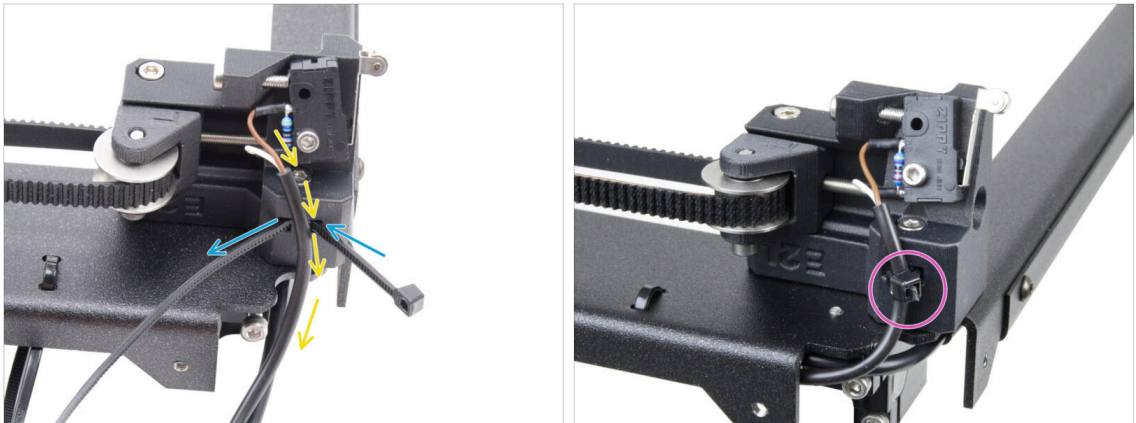

- ◆ Push the zip tie through the hole in the left belt tensioner.
- ◆ Guide the door sensor cable through the zip tie.
- ◆ Tighten the zip tie to secure the door sensor cable. Cut off the excess.

PASO 71 Guiding the cables: LED and door sensor




- ◆ Prepare a cardboard box. You can use any box from the kit. *The box used in the picture is for illustrative purposes only.*
- ◆ Flip the CoreXY assembly upside down, positioning the smooth rods on top.
- ◆ Slightly lift and support the front side of the CoreXY assembly with the cardboard box.
- ⚠ **Be careful not to damage the door sensor.**
- ◆ Route the white LED strip cable and the door sensor cable through the zip ties.
- ◆ Tighten all the zip ties to secure the cables. Cut off the excess zip ties.
- ◆ **Cables must be slightly taut and straight.** Excess slack or bends may cause collisions with the Y-axis and lead to damage.

PASO 72 Smooth rods: parts preparation




- For the following steps, please prepare:
- Smooth rod 330 x 8 mm (2x) *originally from the Y-axis.*
- M3x8rT screw (1x)

PASO 73 Installing the CoreXY assembly

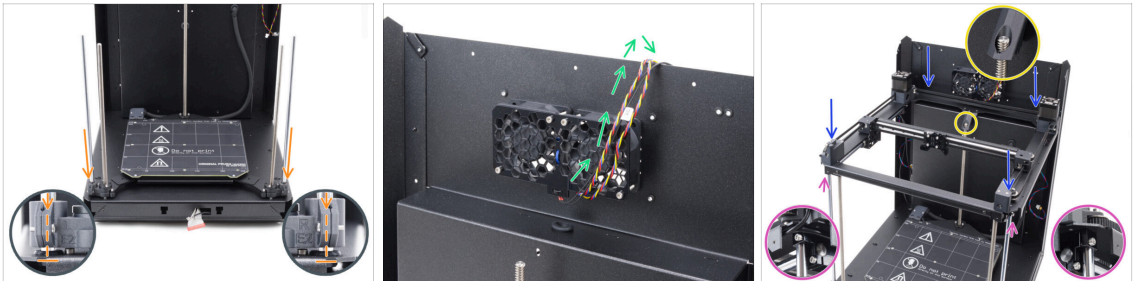

- Carefully insert both smooth rods through the heatbed assembly bearings and into the rod mount part in the base assembly.
- ⚠ **It is a requirement to insert the smooth rod in the axis with the bearing very slowly to prevent the balls from shooting out of the bearing.**
- Temporarily hang the cables from the cooling fans over the rear panel. **There must be a space between the cables and the back panel pocket.**
- Exercise extreme caution when placing the assembly on the smooth rods and back panel assembly.
- ⚠ **Ensure that no cables are pinched.**
 - Ensure both smooth rods are properly seated in the rod holders.
 - The threaded rod of the rear Z motor must pass through the bed-stop-rear part.
- ⚠ **WARNING: When handling the printer, DO NOT lift it by the CoreXY assembly. Always lift it by the base of the entire assembly.**

PASO 74 Securing the smooth rods

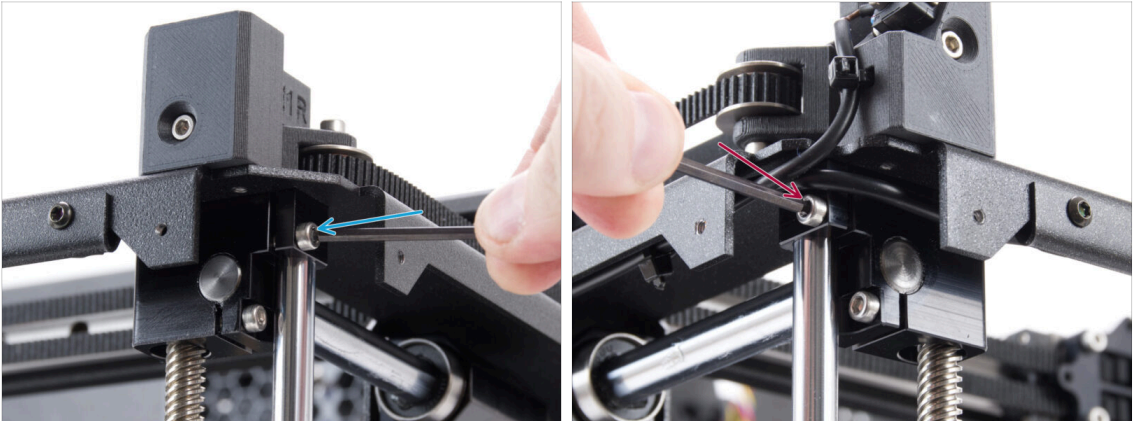


⚠ Check that both smooth rods are seated correctly in the holders.

🔵 Firmly tighten the right M3x10 screw to secure the smooth rod.

🔴 Firmly tighten the left M3x10 screw to secure the smooth rod.

PASO 75 Aligning the linear rail

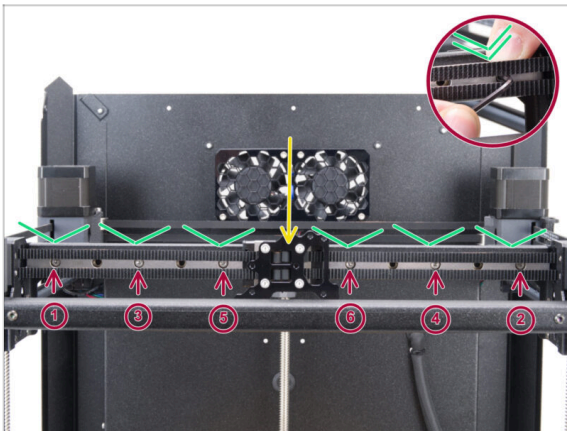


🟡 Move the linear rail carriage to the center.

⚠ Firmly tighten all screws in the order shown in the picture.


🟢 Push the linear rail down while tightening.

PASO 76 Guiding the corexy cables

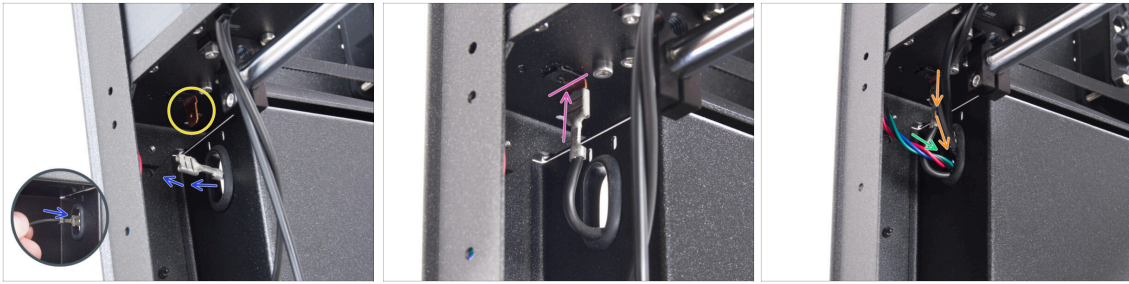


- From the back of the printer, push the FE connector through the oval hole.
- Locate the FE cable connector (number 5) in the rear left corner - under the CoreXY assembly.
- Plug the FE connector onto the Faston on the underside of the CoreXY plate.
- On the same side, push the X motor cable through the oval hole in the back panel.
- Push the White LED strip and Door sensor cables through the oval hole in the back panel.

PASO 77 Guiding the cooling fan cables

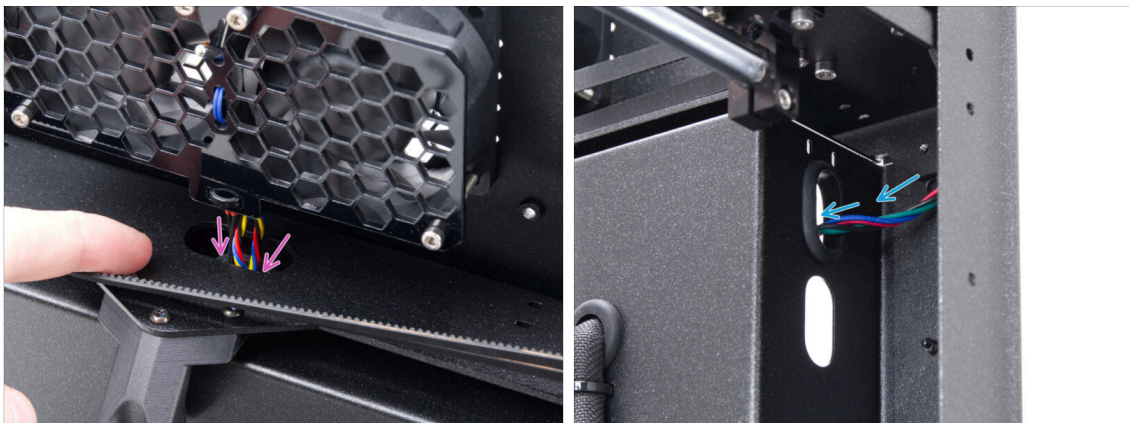


- Push the cooling fan and thermistor cables through the oval hole in the back panel.
- On the right back corner, locate the Y motor cable and push it through the upper oval hole in the back panel.

PASO 78 Fixing the bed-stop

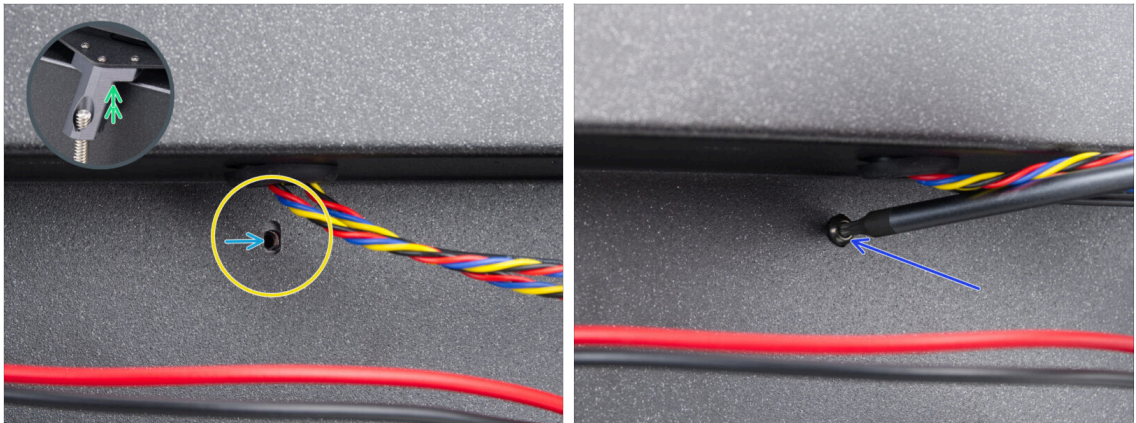


- From the back side, locate the oval screw hole under the cooling fans.
- The oval hole must be flush with the hole in the bed-stop part on the opposite side.
- To compensate, slightly raise the rear of the CoreXY assembly - just a few millimeters.
- After aligning the holes, secure them with an M3x8rT screw.

PASO 79 Connecting the cooling fans cables

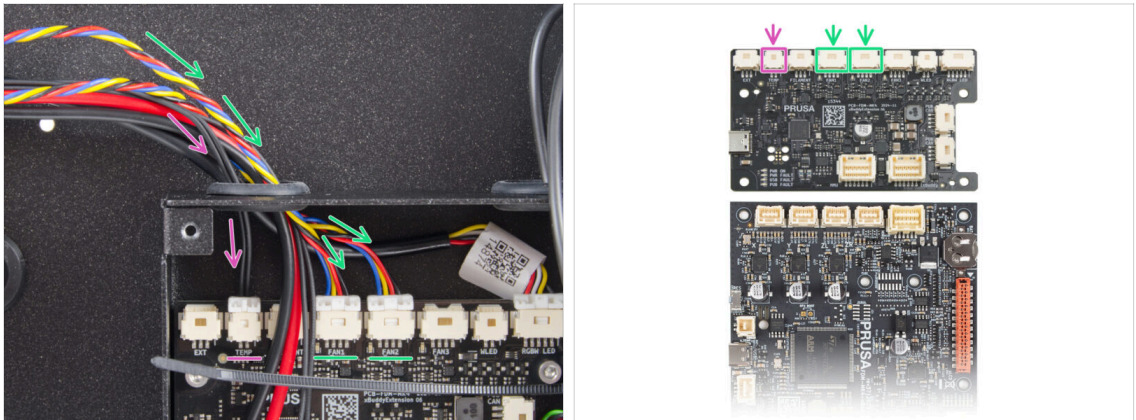


- Route the cooling fan cables through the left hole in the xBuddy box and plug them into the fourth and fifth slots on the xBuddy extension board labeled FAN 1 and FAN 2.
- ⓘ The connection order does not matter, both cables are the same.
- Guide the chamber thermistor cable together with the cooling fan cables.
- Connect it to the second slot from the left on the xBuddy extension board labeled TEMP.

PASO 80 Connecting the corexy cables

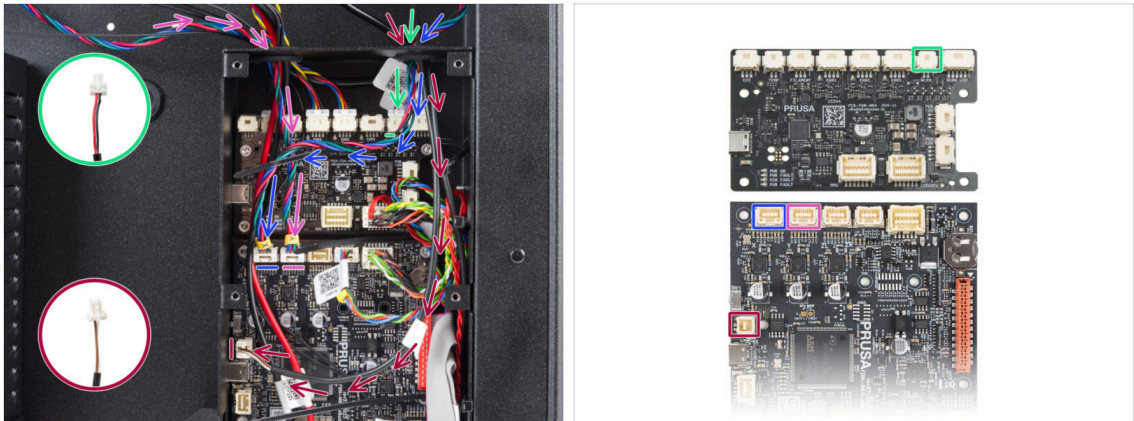

- Guide the X motor cable through the right hole in the xBuddy box. Connect it to the first slot from the left on the xBuddy board.
- Guide the door sensor cable through the right hole in the xBuddy box. Connect it to the lower slot on the left side of the xBuddy board.
- Guide the white LED strip cable through the right hole in the xBuddy box. Connect it to the second slot from the right on the xBuddy extension board.
- Guide the Y motor cable through the left hole in the xBuddy box. Connect it to the second slot from the left on the xBuddy board.

PASO 81 Haribo time

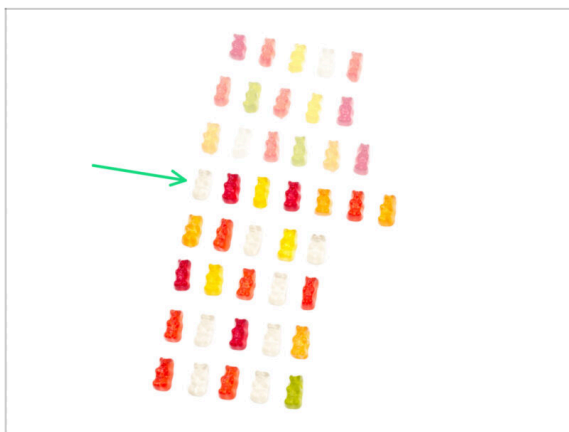


- Think it's snack o'clock again.
- You deserve to eat the whole bag, but keep... Eat just the fourth row.

PASO 82 Done




- ◆ Congratulations! You have just assembled and installed the CoreXY assembly.
- ◆ Let's go to the next chapter.

6. Nextruder assembly

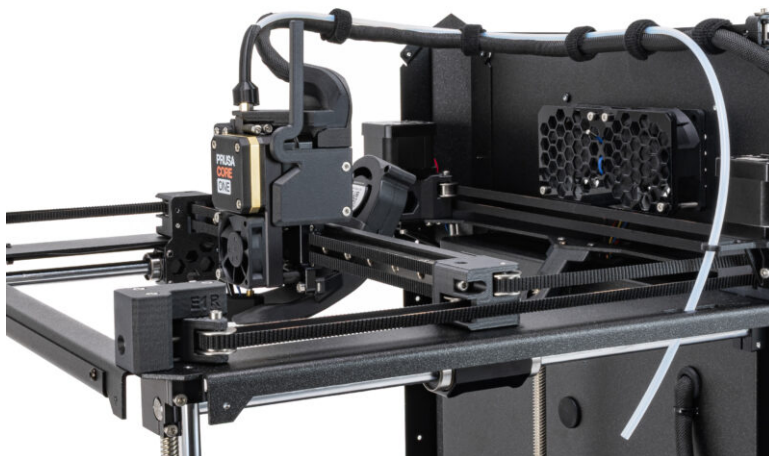


PASO 1 Tool necessary for this chapter

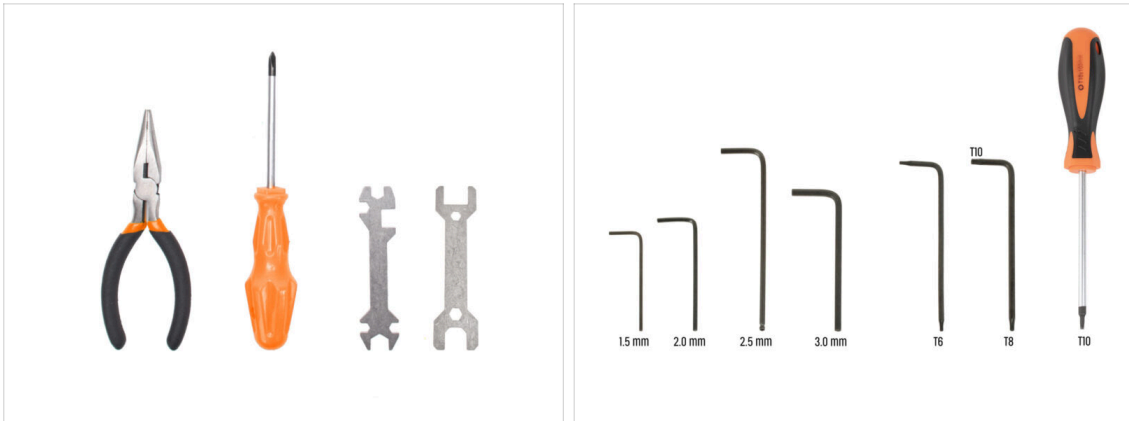

For this chapter, please prepare:

- Universal wrench
- 1.5mm Allen key
- 2.5mm Allen key
- T6 torx key
- T10 torx key / T10 torx screwdriver

PASO 2 Nextruder idler assembly: parts preparation

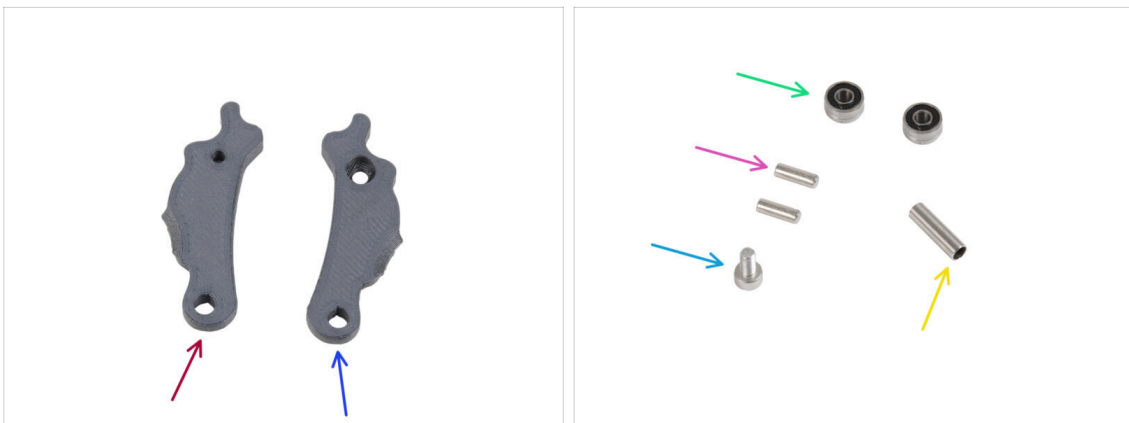

For the following steps, please prepare:

- Idler-lever-a (1x) *found in the Electronics package*
- Idler-lever-b (1x) *found in the Electronics package*
- Bearing 693 2RS (2x) *found in the Electronics package*
- Pin 2.9x8.5 (2x) *se encuentra en el paquete de Electronics*
- M3x6 screw (1x)
- Tubular spacer 13.2x3.8x0.35 (1x) *found in the Electronics package*

PASO 3 Assembling the extruder idler



- Place both bearings into the Idler-lever-a.
- Insert the pin 2.9x8.5 into each bearing 693 2RS, as seen in the picture.
- Close it up with the Idler-lever-b part and secure it with the M3x6 screw. **Do not overtighten the screw.** Both bearings must be able to rotate without significant resistance.
- From the same side, push the tubular spacer into the assembly. The "bottom" of the tubular spacer must be flush with the bottom part of the Idler assembly.

PASO 4 Assembling the extruder: parts preparation I.




● For the following steps, please prepare:

- PG-assembly (1x) found in the Electronics package
- Heatsink assembly (1x) found in the Electronics package
- Main-plate (1x) found in the Electronics package
- PG-ring (1x) se encuentra en el paquete de Electronics
- PG-assembly-adaptor (1x) found in the Electronics package

① The list continues in the next step...

PASO 5 Assembling the extruder: parts preparation II.

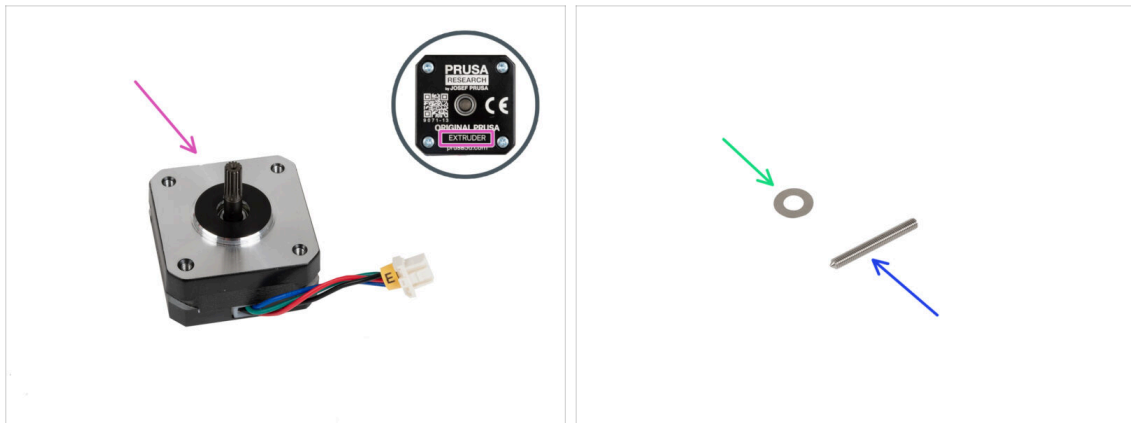


- ◆ Extruder motor (1x) *found in the Motors package*
- ◆ Spacer 5x10x0.1 mm (1x) *found in the Electronics package*
- ◆ Socket set screw M3x25 (1x) *found in the Electronics & Fasteners package*

PASO 6 Assembling the extruder




- ◆ Place the 5x10x0.1 spacer over the shaft on the extruder motor.
 - ◆ Place the heatsink on the extruder motor. Note the orientation of both parts.
 - ◆ The motor cable must be facing "up".
 - ◆ The heatsink cables must be on the right side.
 - ◆ Coloca la main-plate en el disipador. Observa la orientación de la pieza. Utiliza el recorte como guía.
- ⚠ **Before proceeding to the next step, make sure that the 5x10x0.1 spacer is placed on the extruder motor.**

PASO 7 Assembling the gearbox

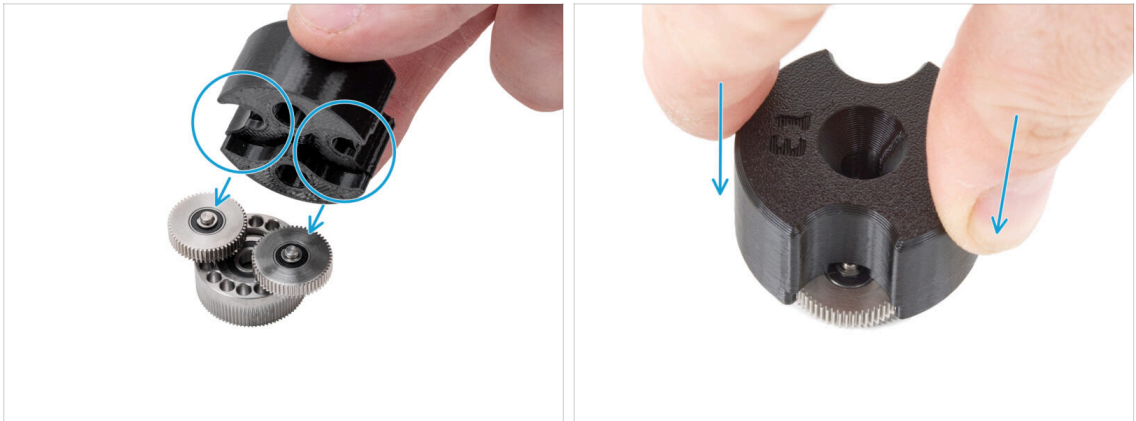

- i** The following instructions need to be done correctly and carefully. Achieve better understanding and successful assembly by watching the video alongside the guide: prusa.io/PG-assembly
- After watching the video, follow the steps in this guide.
 - Attach the PG-assembly-adapter on the PG-assembly. Note the pockets for the gears in the adapter.


PASO 8 Assembling the PG-ring

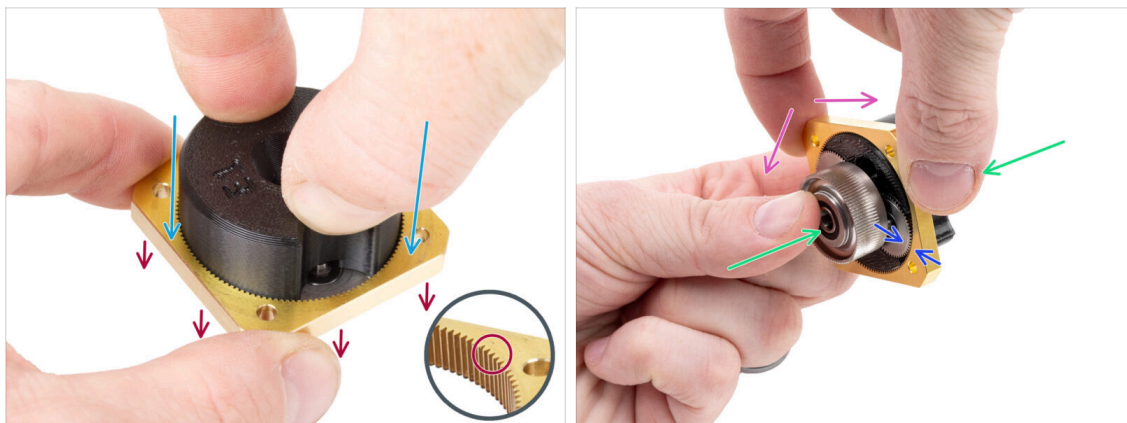

⚠ Do not assemble the gearbox without the PG-assembly-adaptor. This tool is intended to ensure that the gears are correctly fit together.

- Slide the PG-ring onto the adaptor.
- Note there is a chamfer on one side of the PG-ring teeth. This side must be facing down (to the PG-assembly).
- Grasp the entire assembly in one hand so that it can be rotated with the PG-ring.
- Con la otra mano, desliza el PG-ring en el ensamblaje PG con un movimiento oscilante (mueva el PG-ring a izquierda y derecha repetidamente) - un cuarto de vuelta es suficiente.
- Stop when the surfaces of the gears are approximately flush with the surface of the PG ring.

PASO 9 Assembling the PG-assembly

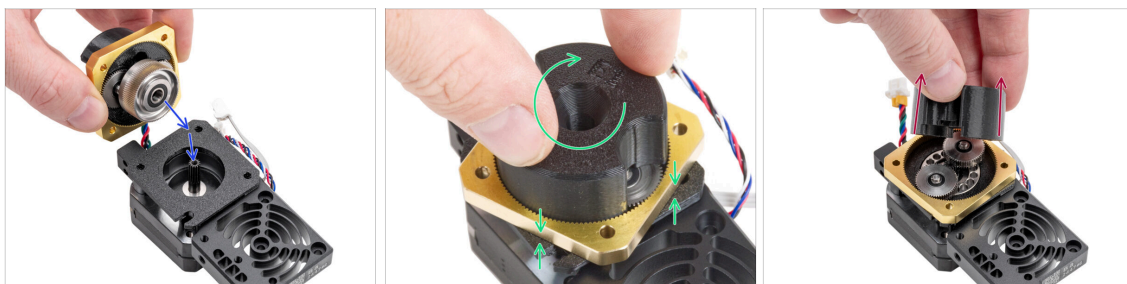

⚠ Proceed very carefully in this step.


- Maintain the position of the PG-assembly and attach it on to extruder motor shaft.
- Very gently and freely rotate with the whole PG assembly (PG-assembly-adaptor, PG-assembly and PG-ring) until it drops down so that there is no gap between the assembly and the main-plate. **Do not push on the assembly.**
- Remove the PG-assembly-adaptor.

PASO 10 Checking the PG-assembly



- ◆ Attach the PG-assembly-adaptor back on the PG-assembly again to verify that all parts are properly seated.
- ◆ Rotate with the PG-assembly-adaptor. **The PG assembly must be easy to rotate without having to exert much force.**
- ◆ Remove the PG-adaptor. You will no longer need it during assembly. We recommend keeping it for maintenance.
- ◆ Ensure that the PG-assembly is not sticking out above the PG-ring. It should be positioned lower than the level of the PG-ring's surface or at the same level as the ring.
- ◆ Asegúrate de que la separación entre el PG-ring y la Main-plate es mínima. Si se observa una separación significativa, desmonta el conjunto del engranaje planetario y vuelve a colocarlo.

PASO 11 Assembling the Nextruder idler

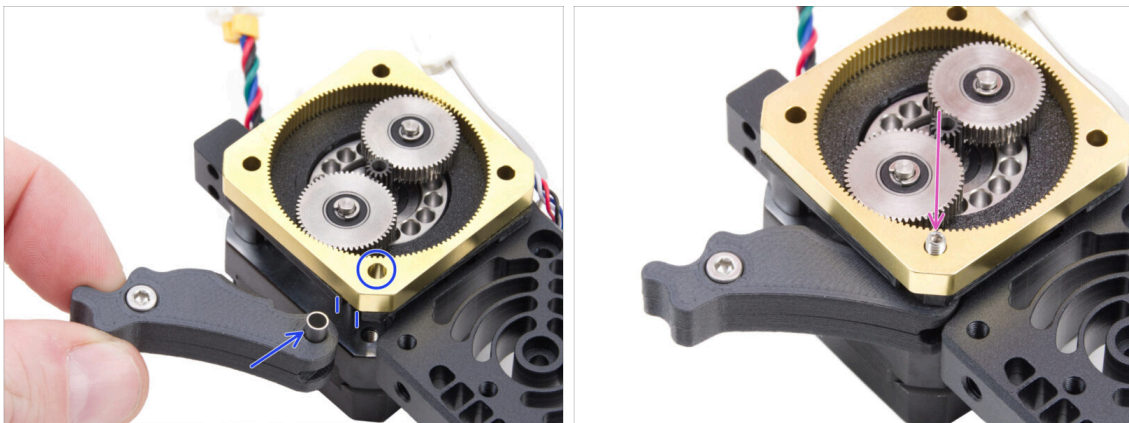

- ◆ Insert the idler assembly between the PG-ring and the extruder motor. There is a cutout for the spacer in the main-plate. Line up the idler spacer with the hole in the PG-ring.
- ◆ Secure both parts with the socket set screw 3x25. **Do not overtighten the screw! The screw protrudes from the PG-ring after tightening.**

PASO 12 Gear lubrication: parts preparation



● For the following steps, please prepare:

● Front Case (1x) found in the Printed parts package

① The logo on the Nextruder front case will remain as **PRUSA CORE ONE**.

● M3x25 screw (3x)

● Lubricante (1x) se encuentra en el paquete de Electronics & Fasteners

● Several paper towels to wipe grease from your hands.

PASO 13 Lubricating the gear




● Remove the cap from the lube. Use the spike on the opposite side of the cap to pierce a hole in the lube tube opening.

● Squeeze a small amount of lubricant onto the tip of the zip tie, then spread it over the gears.

● Apply a small amount of Prusa Lubricant **all around** the PG-ring and PG-assembly teeth.


● Close the lubricant; it is no longer needed for the assembly.

PASO 14 Covering the planetary gear

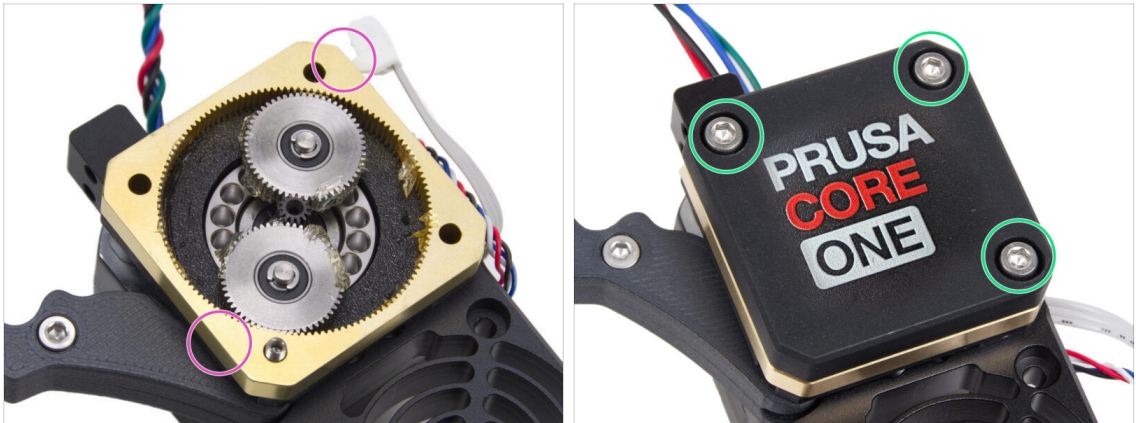


- Using the paper towel, wipe off the lubricant residue from the face surface of the PG-ring.
- Place the front case onto the gearbox and secure it with three M3x25 screws. **Do not tighten them completely** at this moment.
- i The screws on the front case will be completely tightened during the self-test in the final chapter.

PASO 15 Assembling the Idler-swivel: parts preparation

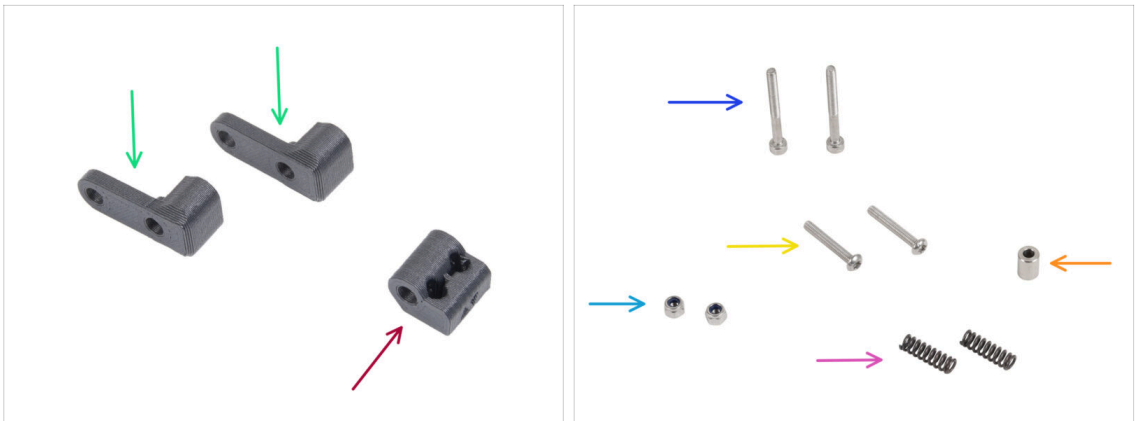

- **For the following steps, please prepare:**
- Idler-swivel (2x) *found in the Electronics package*
- Idler-nut (1x) *found in the Electronics package*
- M3x30 screw (2x)
- M3x20rT screw (2x)
- M3nN nut (2x)
- Spring 15x5 (2x) *found in the Electronics package*
- Spacer 6x3.1x8 (1x) *found in the Electronics package*

PASO 16 Assembling the Idler-swivel

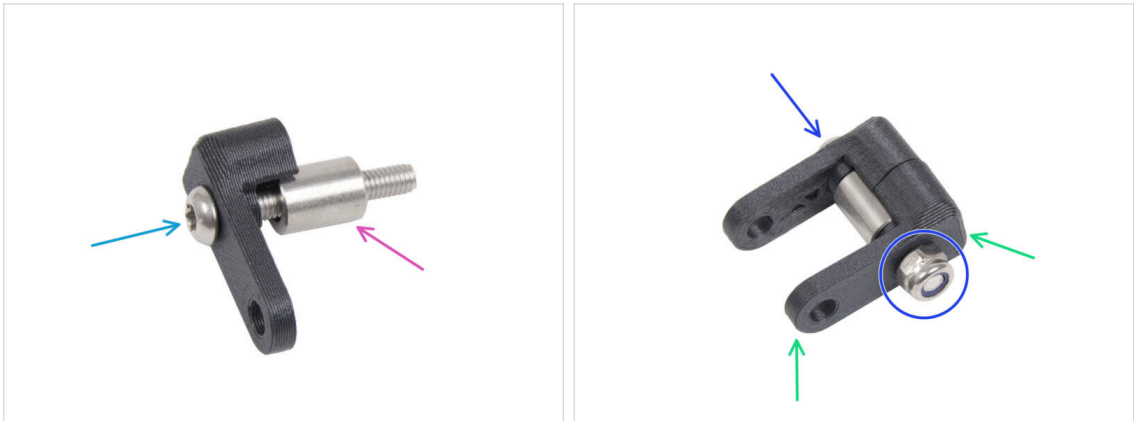


- Push the M3x20rT screw all the way through one of the idler-swivel.
- Slide the spacer onto the screw.
- Place the second idler-swivel from the opposite side on the screw.
- From the other side, attach the M3nN nut onto the screw. Hold the nut using the universal wrench and tighten the screw. **Tighten just lightly!** The spacer must rotate freely.

PASO 17 Assembling the Idler-nut



- Insert the Idler-nut into the Idler-swivel assembly. Make sure that both parts are oriented correctly according to the picture.
- Secure both parts together by inserting the M3x20rT screw from the same side, like the first screw.
- Secure the screw with M3nN nut. **Do not overtighten the nut.** It must be possible to move with the Idler-swivel on the Idler-nut.

PASO 18 Mounting the Idler-swivel assembly

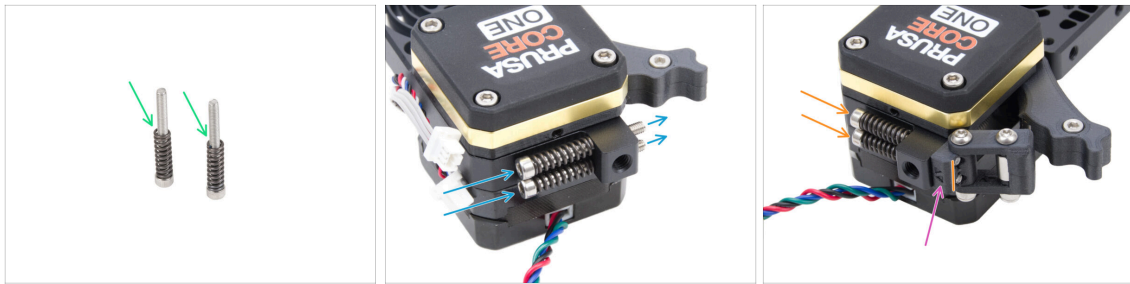


- Attach the spring 15x5 on both M3x30 screws.
- Push the two screws with the springs through the holes in the protrusion on the heatsink. There are no threads inside.
- Fija el conjunto Idler-swivel en los tornillos. Observa la orientación correcta de la Idler-nut. El lado con las marcas de la versión debe ser visible. Mira la imagen.
- Tighten both screws. **Stop tightening as soon as the screw tips reach the front face of the idler nut.**

PASO 19 NTC thermistor: parts preparation



- **For the following steps, please prepare:**
- NTC thermistor 90 mm (1x) *found in the Electronics package*
- Tornillo prisionero M3x4T (1x)

PASO 20 Assembling the NTC thermistor

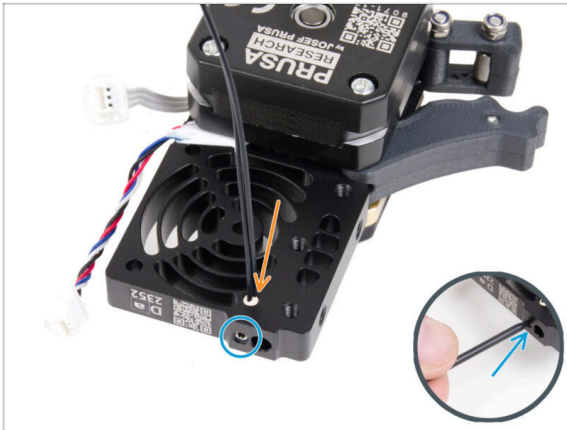

- En el **lado del motor del extrusor**, inserta el termistor NTC en el orificio del disipador térmico.
- Secure it with the M3x4T grub screw. Screw it all the way in. **Tighten gently, but firmly** using two fingers and the short side of the T6 Torx key. Applying more force may cause permanent damage to the thread.

PASO 21 Mounting the Nextruder: parts preparation




- **Para los siguientes pasos, por favor prepara:**
- Nextruder spacer (3x) *found in the Electronics & Fasteners package*
- M3x10 screw (3x)
- Cardboard box (1x) *used as temporary heatbed protection*
- i Sugerencia: Puedes utilizar cualquier caja de cartón del paquete del kit.

PASO 22 Protecting the heatbed



- Coloca una caja de cartón vacía sobre la base calefactable, asegurándote de que cubre la mayor superficie posible.
- i** This will protect the heatbed from falling parts.

PASO 23 Mounting the Nextruder

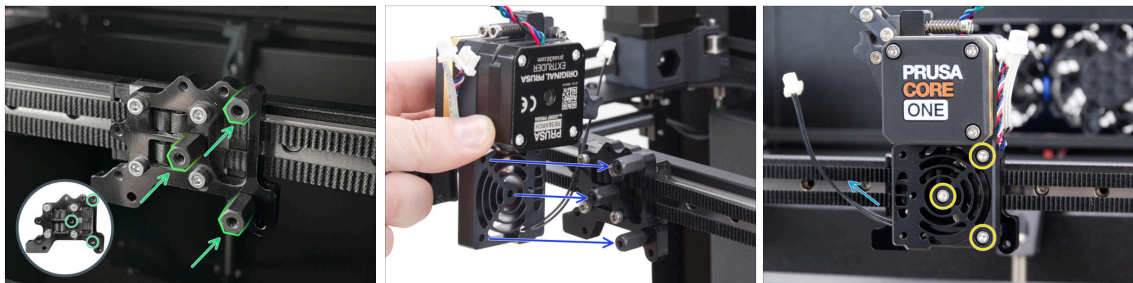

- Screw three Nextruder spacers to the Nextruder holder. Tighten the spacers firmly.
- Place the Nextruder assembly on the spacers.
- Alinea los orificios del Nextruder con los espaciadores y fíjalo con tres tornillos M3x10. **No aprietes demasiado los tornillos.**
- Ensure the NTC cable is pointing to the left.


PASO 24 Hotend fan: parts preparation



For the following steps, please prepare:

- Hotend fan (1x) found in the Electronics package
- Hotend-cable-clip (1x) se encuentra en el paquete de Printed parts
- M3x4rT screw (2x)
- M3x18 screw (2x)

PASO 25 Installing the Hotend fan

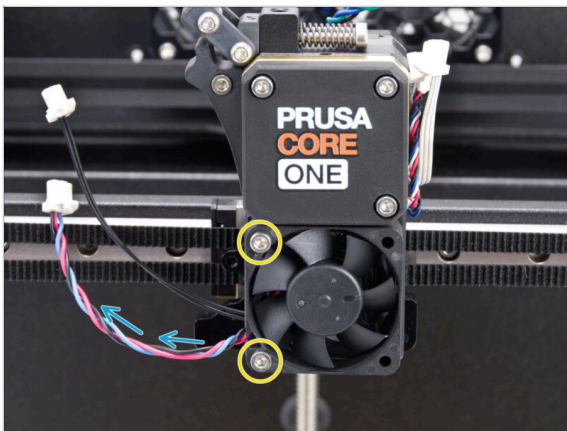


- Attach the hotend fan onto the heatsink with two M3x18 screws on the left side. **Tighten the screw gently, but firmly, otherwise the plastic housing may crack.**

⚠ There is a sticker on the hotend fan, the sticker must be on the rear side of the fan - not visible.

- El cable debe apuntar hacia la esquina inferior izquierda.

PASO 26 Guiding the Hotend fan cables

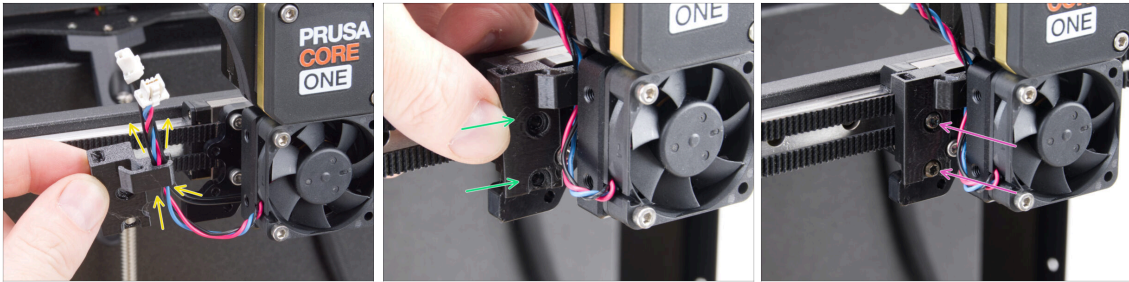


- ✦ Take the Hotend-cable-clip in the same position as shown and guide the **heatsink fan cable** together with the **NTC thermistor cable** through the right cable hook.
- ✦ Attach the Hotend-cable-clip to the Nextruder holder.
- ✦ Asegúralo utilizando dos tornillos M3x4rT.

PASO 27 LoveBoard: parts preparation I.




- ✦ **For the following steps, please prepare:**
- ✦ Printhead-cover (1x) *found in the Printed parts package*
- ✦ Loveboard-mount (1x) *se encuentra en el paquete de Printed parts*
- ✦ Main cable (1x) *found in the Electronics & Fasteners package*
- ⓘ Nota: El color del cable puede variar en función del lote. Esto no afecta al procedimiento.
- ✦ M3x10 screw (4x)
- ✦ M3x8rT screw (1x)
- ✦ M3nS nut (5x)
- ⓘ The list continues in the next step...

PASO 28 LoveBoard: parts preparation II.

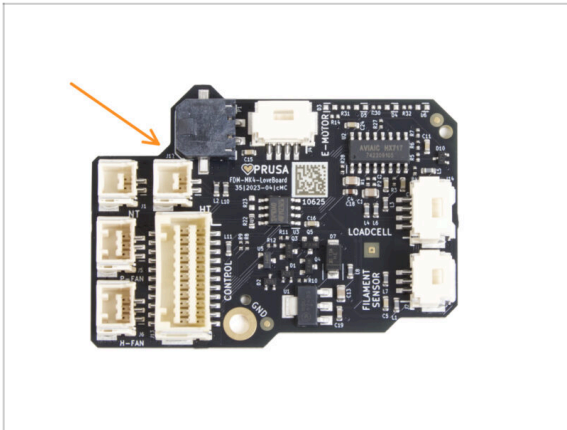


- For the following steps, please prepare:
- LoveBoard (1x) found in the Electronics package

PASO 29 Assembling the Loveboard-mount

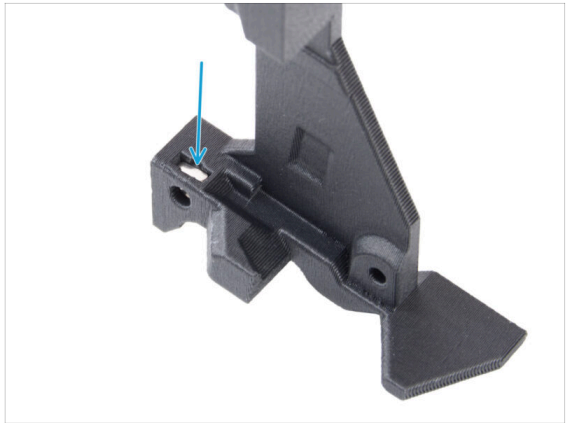


- Locate the U-shaped cable channel on the Loveboard-mount and insert an M3nS nut into the nearby hole.
- Use a 2.5mm Allen key to push the nut all the way in.
- En el lado opuesto de la pieza, inserta una tuerca M3nS y empújala hasta que encaje en su sitio.

PASO 30 Assembling the Printhead-cover

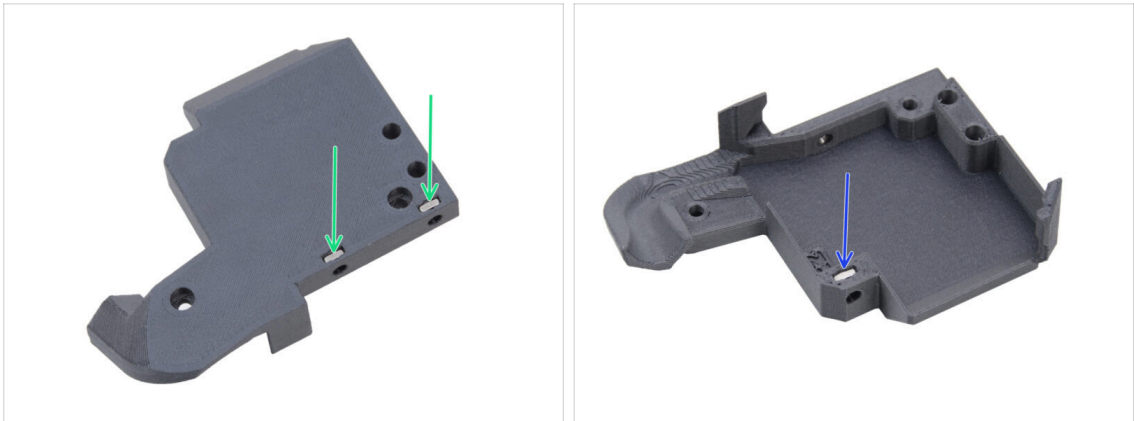


- From the back of the printhead-cover, insert two M3nS nuts into the part.
- From the other side of the printhead-cover, insert one M3nS nut into the part.

PASO 31 Assembling the LoveBoard

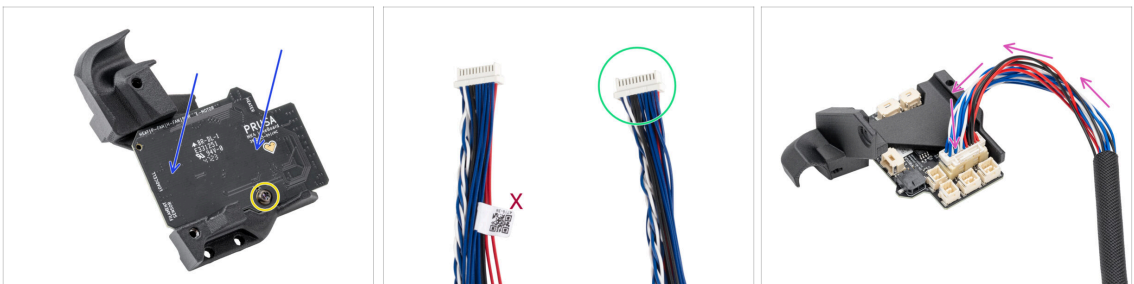

- Place the LoveBoard to the Loveboard-mount. Note the correct orientation - the connectors must be facing downwards.
- Align the holes with both parts and secure the board with the M3x8rT screw. **Do not overtighten it**, it might damage the part.
- Coge el extremo del cable principal del extrusor sin la etiqueta blanca.
- Turn the Loveboard-mount upside down and connect the Main cable to the LoveBoard.

PASO 32 Guiding the main cable

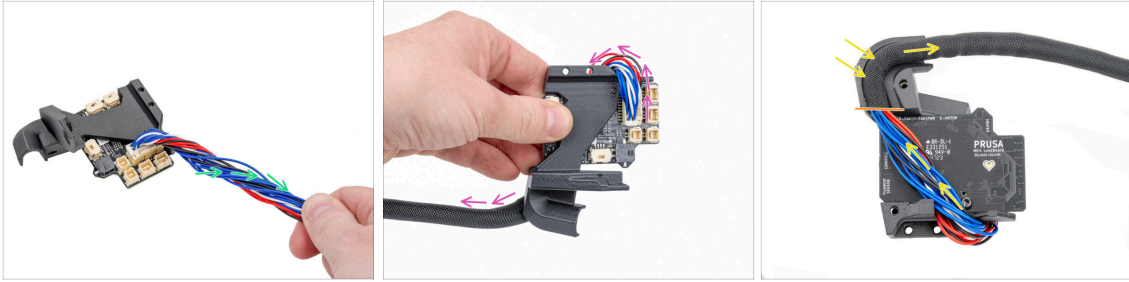


- ✚ Twist the main cable half a turn.
- ✚ Fold the main cable over the LoveBoard to its opposite side.
- ⬛ Da la vuelta al conjunto LoveBoard.
- ✚ Guide the main cable over the LoveBoard through the cable channel in the Loveboard-mount.
- ✚ El extremo de la funda textil debe quedar alineado con el borde de la pieza de plástico.

PASO 33 Covering the LoveBoard



- ✚ Insert two M3x10 screws into the Loveboard-holder.
 - ⚠ Ensure you insert the screws from the correct side. Use the LoveBoard logo on the board as a reference.
- ✚ Cubre la LoveBoard con la Printhead-cover.
 - ⚠ **Avoid pinching any wires in the main cable.**
- ✚ Fija las dos piezas juntas usando dos tornillos M3x10.
- ✚ Check that there is no large gap or pinched textile sleeve between the parts.

PASO 34 Swingarm: parts preparation I.

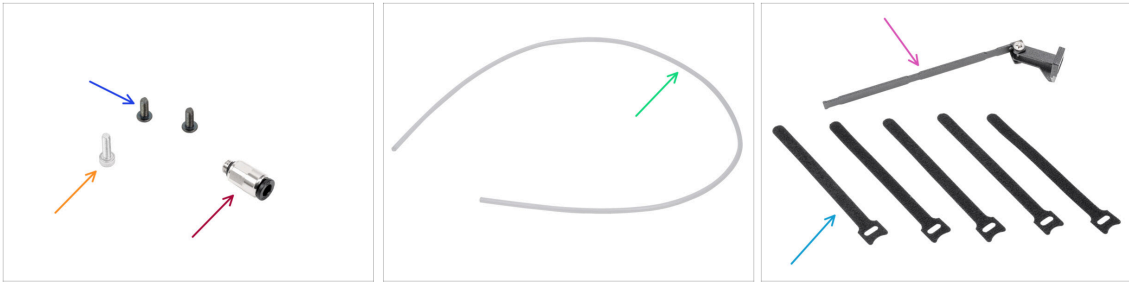

● For the following steps, please prepare:

● M3x8rT screw (2x)

● M3x10 screw (1x)

● Racor M5-4 (1x) *se encuentra en el paquete de Electronics & Fasteners*

● Tubo PTFE 710 x 4 x 2.5 (1x) *se encuentra en el paquete de CoreXY parts + Hinges set*

● Swingarm assembly (1x) *found in the Metal parts 3/3 package*

● Cable tie (5x) *found in the Electronics & Fasteners package*

ⓘ Packed in a stack and must be separated.

ⓘ The list continues in the next step...

PASO 35 Swingarm: parts preparation II.




● For the following steps, please prepare:

● Bowden-bend (1x) *found in the Printed parts package*


● Main-cable-clip (1x) *se encuentra en el paquete de Printed parts*

PASO 36 Guiding the main cable

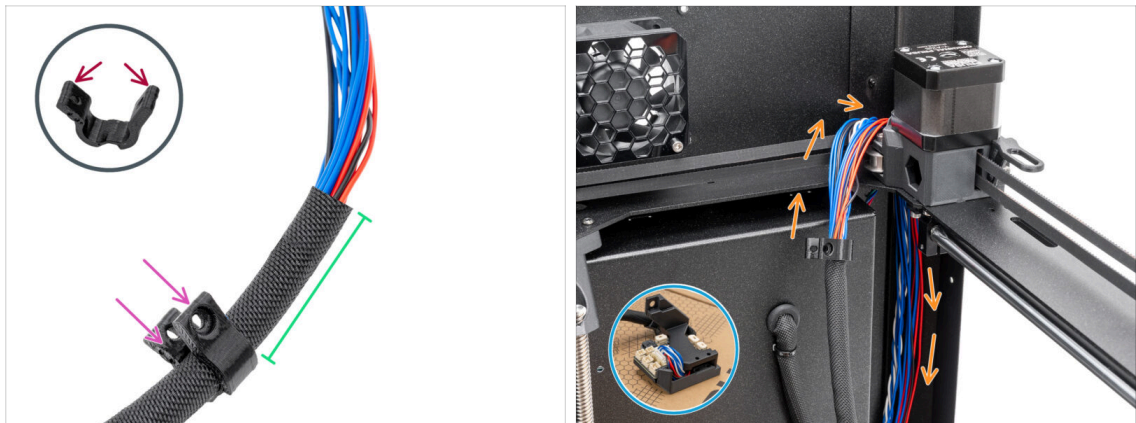


- Carefully open the Main-cable-clip. Be careful not to crack the part.
- Insert the main cable into the Main-cable-clip.
- Coloca el Main-cable-clip a unos 5 - 15 cm (2 - 6 in) del extremo de la funda textil y cierra el clip.
- Coloca el conjunto LoveBoard en la caja de cartón sobre la base calefactable.
- Empuja el cable principal por detrás del conjunto CoreXY en la esquina trasera derecha.

PASO 37 Mounting the main cable

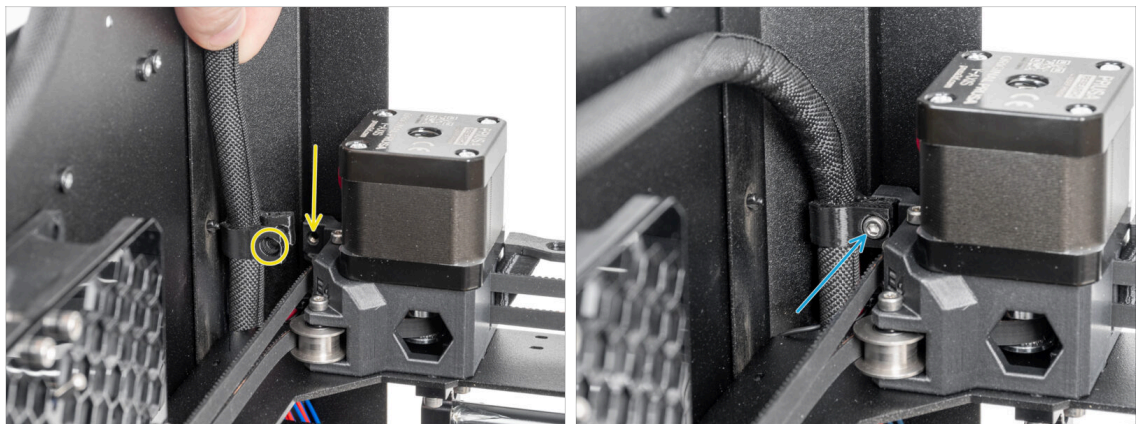


- In the right corner of the printer on the Y motor assembly, locate the hole in the plastic part and align it with the main-cable-clip.
- Fix the main-cable-clip with the cable to the hole using the M3x10 screw.

PASO 38 Attaching the LoveBoard assembly

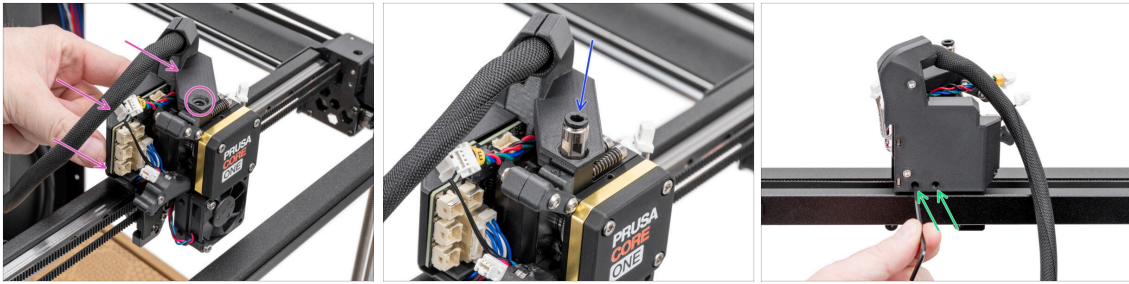


- ◆ From the back of the Nextruder, attach the LoveBoard assembly to the Nextruder.
- ◆ Align the hole in the Loveboard-mount with the threaded hole in the top of the heatsink (Nextruder).
- ◆ Inserta y aprieta el racor M5-4 al disipador. Utiliza la llave universal.
- ◆ Desde la parte posterior del Nextruder, aprieta los dos tornillos M3x10 para fijar el conjunto de la LoveBoard.

PASO 39 Mounting the swingarm

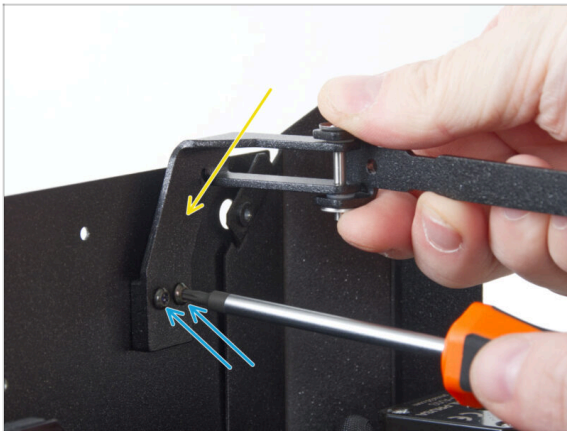


- ◆ Attach the swingarm assembly to the pair of threaded holes on the back panel near the top right corner.
- ◆ Secure it with two M3x8rT screws.
- ⚠ No aprietes demasiado los tornillos, ya que podrías dañar las roscas.

PASO 40 Attaching the main cable

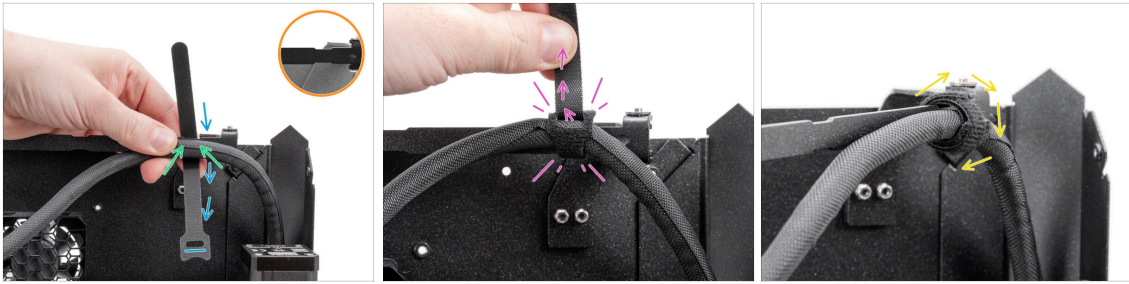


- 🟠 Notice the cutouts on the swingarm.
- 🟢 Position the main cable at the first cutout on the swingarm.
- 🟡 Coloca una brida para cables detrás del primer recorte del brazo oscilante, asegurándote de que la orientación de la brida sea la correcta.
- 🟡 Pasa la brida por su orificio, enrollándolo alrededor del brazo oscilante y del cable principal.
- ⬛ Aprieta la brida al máximo.
- 🟡 Wrap the cable tie around.

PASO 41 Inserting the PTFE tube

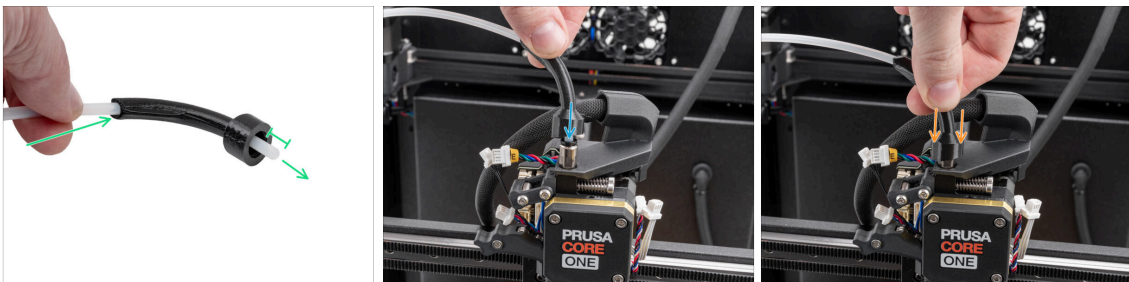


- 🟢 Push one end of the PTFE tube through the bowden-bend and keep protruding at least 1 cm (0.39 in) of the tube.
- 🟡 Insert the PTFE tube into the fitting M5-4 on the Nextruder. Push it all the way down.
- 🟠 Desliza el bowden-bend hacia abajo para cubrir el racor M5-4.

PASO 42 Securing the PTFE tube

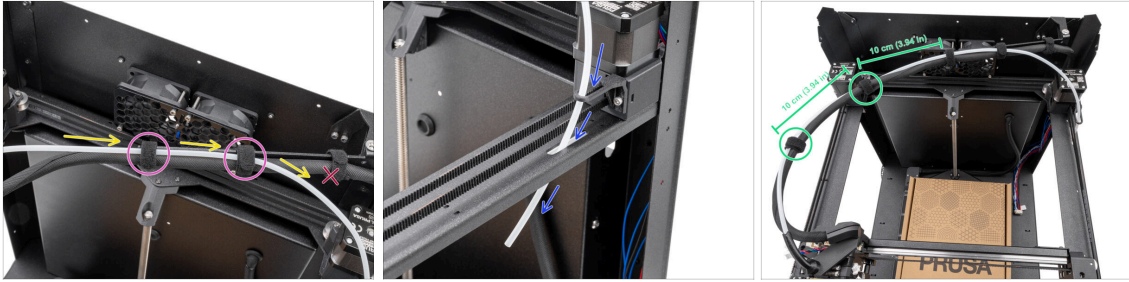


- ◆ Route the PTFE tube in parallel with the main cable, ensuring the PTFE tube stays above the main cable.
- ◆ Secure the PTFE tube and main-cable to the swingarm using two cable ties to the remaining cutouts.
- ⚠ **No pases el tubo de PTFE por la primera abrazadera del brazo oscilante.**
- ◆ Empuja el extremo libre del tubo de PTFE a través de la guía Bowden y la placa CoreXY hacia abajo. Deja que el extremo cuelgue libremente.
- ◆ Une el tubo de PTFE y el cable principal con las dos bridas restantes, dejando una distancia de 10 cm (3.94 in) entre ellas.

PASO 43 Checking the movement

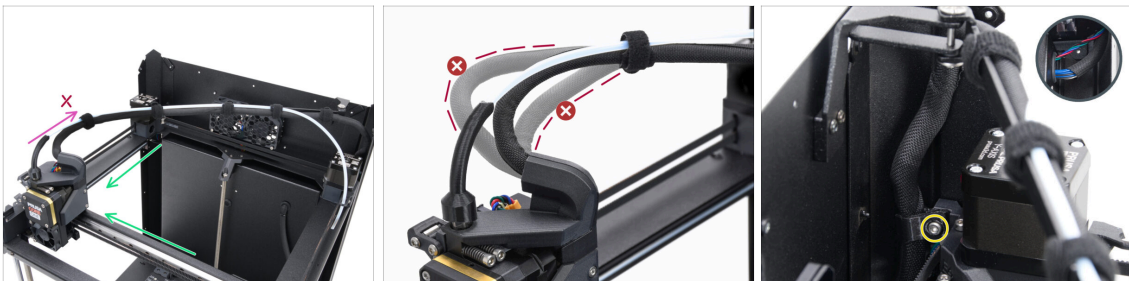

- ◆ Manually move the XY axes to their end positions several times and ensure that:
 - ◆ The main cable is not too tight and does not pull the Nextruder backward.
 - ◆ El cable principal no forma un arco excesivamente grande.
 - ◆ Si el cable está demasiado tenso, afloja ligeramente el tornillo del main-cable-clip y tira del cable hacia arriba unos milímetros. A continuación, aprieta el tornillo y vuelve a realizar la prueba.

PASO 44 Print fan: parts preparation

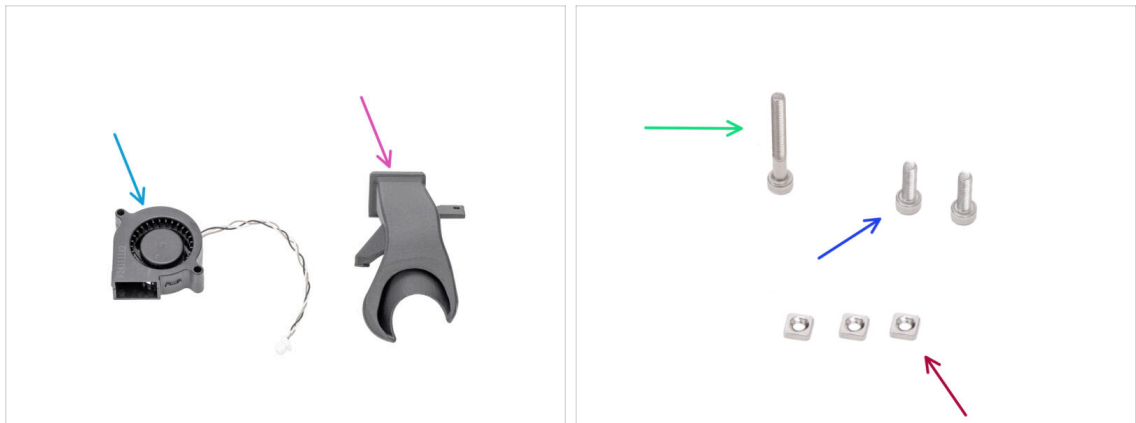

● For the following steps, please prepare:

- Print fan (1x) found in the Electronics package
- Fan-shroud (1x) se encuentra en el paquete de Printed parts
- M3x25 screw (1x)
- M3x10 screw (2x)
- M3nS nut (3x)


PASO 45 Assembling the fan-shroud



- Insert two M3nS nuts from one side into the fan-shroud.
- From the other side, insert one M3nS nut into the fan-shroud.
- Inserta el ventilador de impresión en la cubierta del ventilador como se muestra. Observa la orientación correcta de las piezas.
- Fija ambas piezas con un tornillo M3x25.

⚠ No aprietes demasiado los tornillos para no dañar la carcasa del ventilador.

PASO 46 Installing the print fan assembly

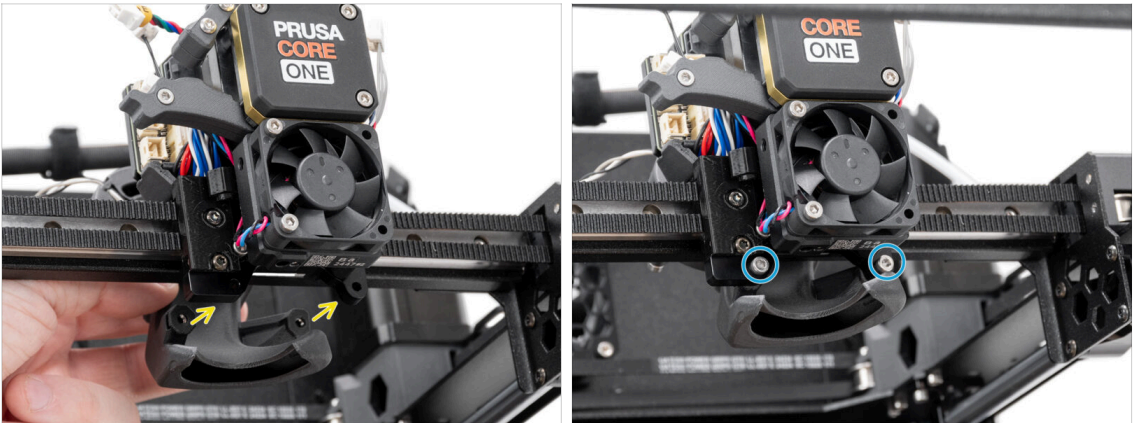


- Attach the print fan assembly to the back of the Nextruder.
- Align the holes in the Nextruder bracket with the holes in the fan-shroud.
- Fija el fan-shroud al soporte Nextruder con dos tornillos M3x10.

PASO 47 Hotend: parts preparation




- **For the following steps, please prepare:**
- Thumb screw (2x) found in the Electronics package
- Conjunto Prusa Hotend (1x) se encuentra en el paquete de Electronics

PASO 48 Installing the hotend

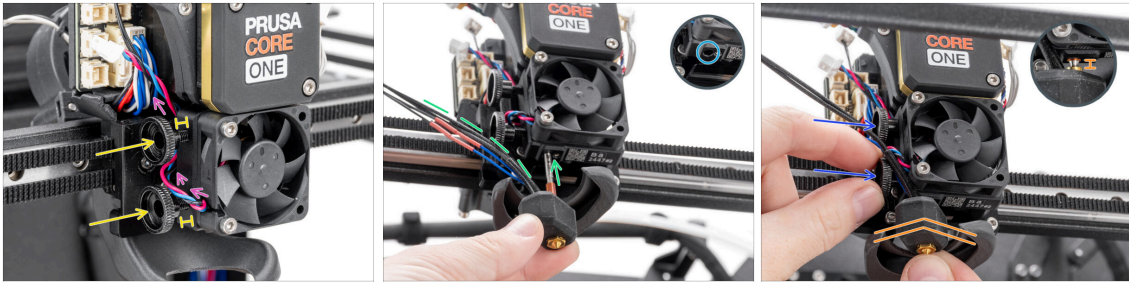




- ✿ Route the heatsink fan cable above the first threaded hole in the heatsink.
- ✿ Insert two thumb screws into the heatsink. **Do not tighten them completely.** Two turns are enough for now.
- ✿ Fíjate bien en la parte inferior del disipador y encuentra el agujero para el montaje del hotend.
- ✿ Inserta el tubo de ensamblaje del hotend en el orificio y desliza el conjunto en el disipador.
- ✿ Point the cables to the left according to the photo.
- ✿ Push the hotend assembly all the way into the heatsink. There should be approximately a 2 mm (0.08 in) gap between the heatsink and the brass part of the nozzle.
- ✿ While pushing the hotend assembly in, **firmly tighten both thumb screws.**
- ⚠ **Avoid pinching any cable between the screws and the heatsink!**

PASO 49 Connecting the heatsink cables

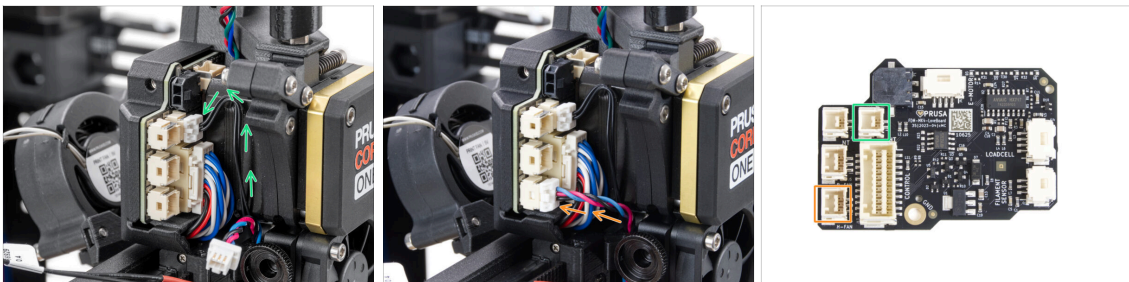




- ✿ Plug the NTC thermistor cable into the connector above the main cable on the LoveBoard.
- ✿ Plug the Hotend fan cable into the lower connector in the left row of the LoveBoard.

PASO 50 Connecting the hotend cables

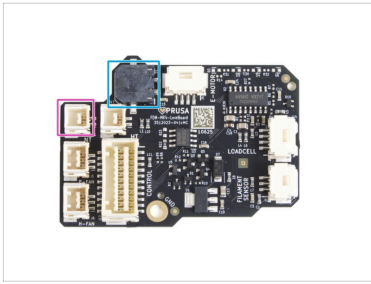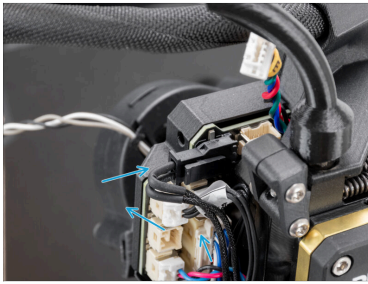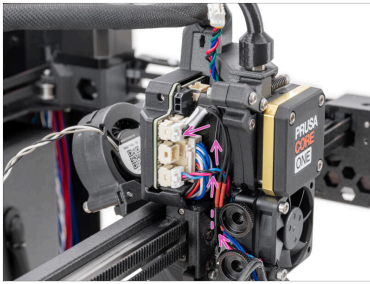



- ◆ Guide the hotend thermistor through the cable-clip on the Nextruder and connect it to the LoveBoard.
- ◆ Guide the hotend heater through the cable-clip on the Nextruder and connect it to the LoveBoard.

PASO 51 Connecting the print fan cable

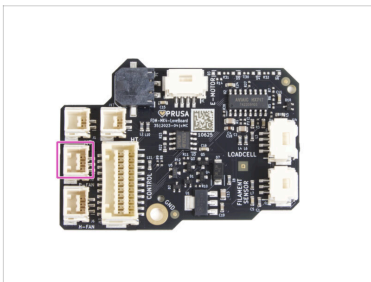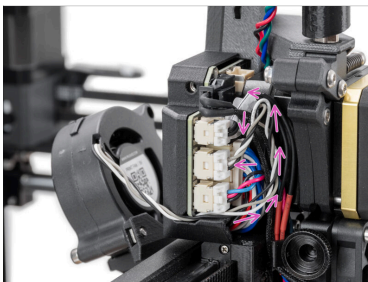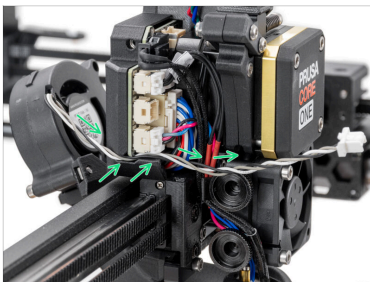


- ◆ Guide the print fan cable through the channel in the plastic cover.
- ◆ Create a loop with the print fan cable in the cable area and plug it into the middle connector in the LoveBoard.

PASO 52 Connect E-motor cable

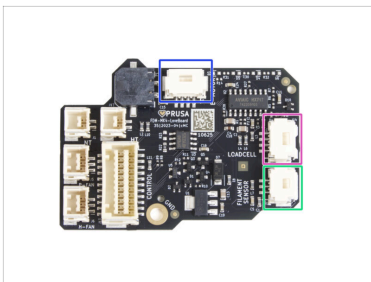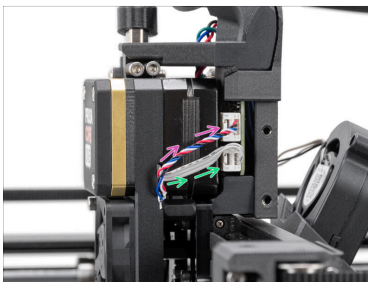

- ◆ Plug the Nextruder motor (labeled E) to the top-facing connector.
- ◆ Plug the loadcell cable (lower cable) to the upper connector on the right side of the Nextruder.
- ◆ Enchufa el sensor de filamento (cable superior) al conector inferior.


PASO 53 LoveBoard covers: parts preparation

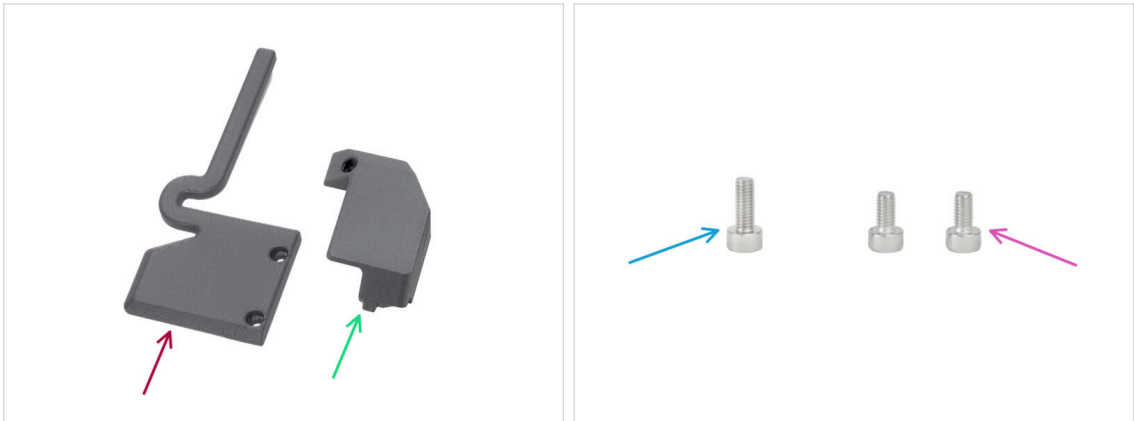

● For the following steps, please prepare:


- Printhead-cover-right-lever(1x)
- Print-head-cover-right (1x) *se encuentra en el paquete de Printed parts*
- M3x10 screw (1x)
- M3x6 screw (2x)

PASO 54 Covering the LoveBoard

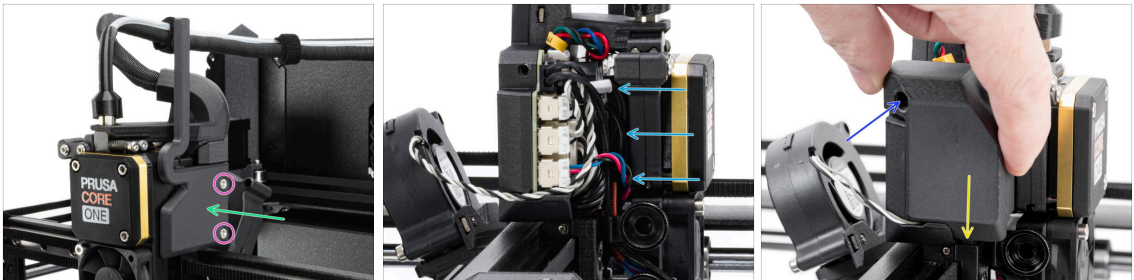

- Place the Printhead-cover-right-lever on the right side of the Nextruder.
- ⚠ Do not pinch the cables!
- Secure the cover with two M3x6 screws.
- Aprieta el mazo de cables hacia el interior de la LoveBoard tanto como sea posible para que no sobresalga e interfiera con el ajuste de la cubierta.
- Attach the Print-head-cover-left on the left side of the Nextruder.
- **Note the protrusion on the underside of the cover - the protrusion must fit into the counterpart on the Nextruder.**
- Secure the cover with one M3x10 screw.

PASO 55 LoveBoard: Wiring check

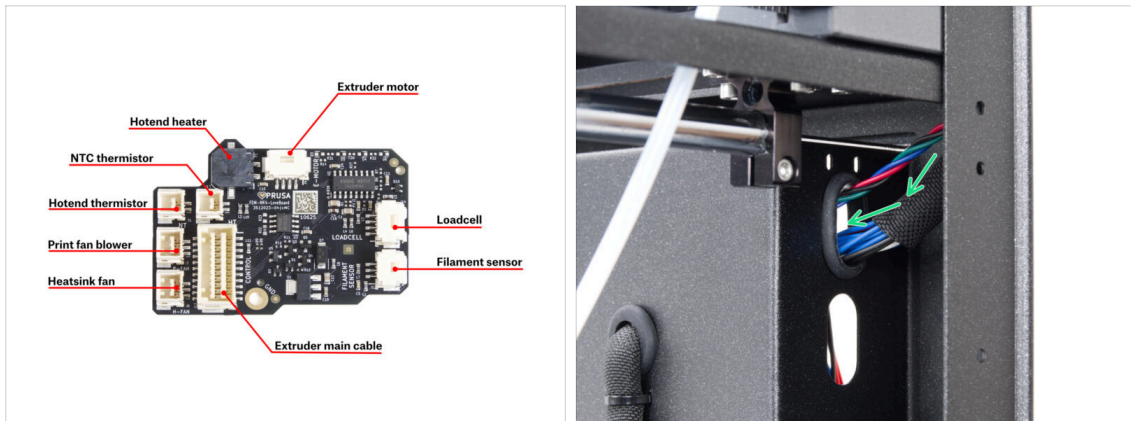


⚠ Before covering the electronics, check the connection of all cables.

i Click on the picture to open it in the high-resolution preview.

🟢 Guide the main-cable through the upper hole on the right side of the back panel assembly.

⬛ Deja que el final del cable cuelgue libremente por ahora.

PASO 56 Guiding the main cable

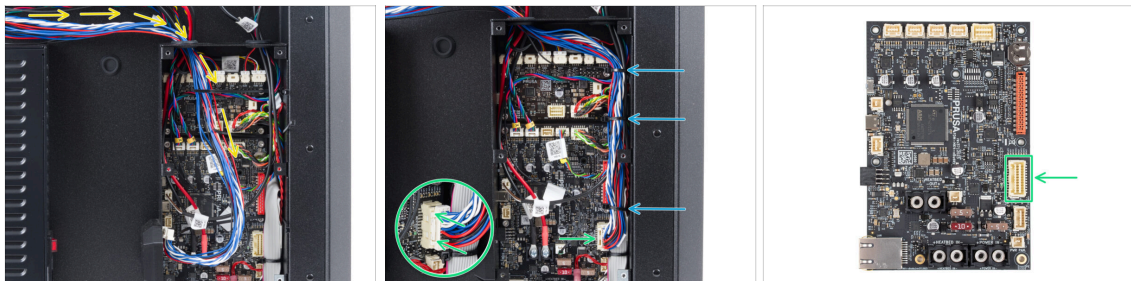

⬛ Rotate the printer so that the backside faces you.


🟡 Route the main cable through the left hole into the xBuddy box.

🟢 Plug the main-cable to the slot on the right side of the xBuddy board.

i Si el cable no llega al conector o está demasiado apretado, vuelve al paso **Guiando el cable principal** y tira del cable ligeramente hacia abajo desde el clip del cable principal.


🟢 Secure the cables with the pre-threaded zip ties in the xBuddy box. Carefully cut the excess, **avoiding cutting the cables**.

PASO 57 Haribo time

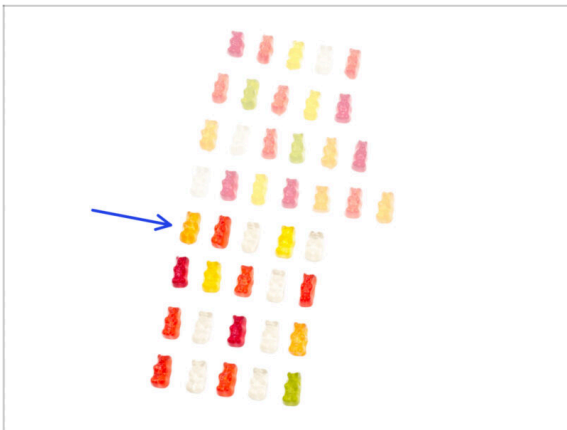

- ⬛ Power up and push forward!
- ⬛ Eat the fifth row.
- ⬛ Not full yet?

PASO 58 Done

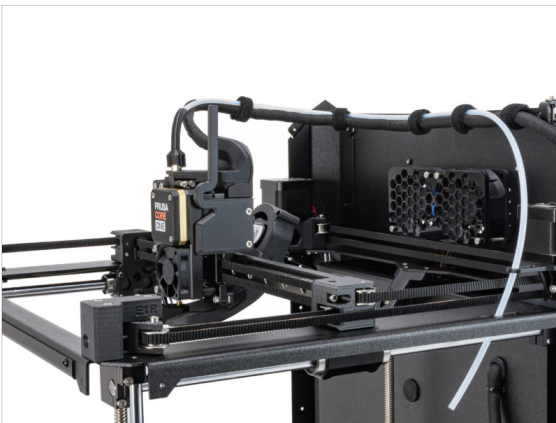


- ⬛ Congratulations! You just successfully assembled the Nextruder.
- ⬛ Let's move to the next chapter.

7. Bodywork & Electronics




PASO 1 Tools necessary for this chapter

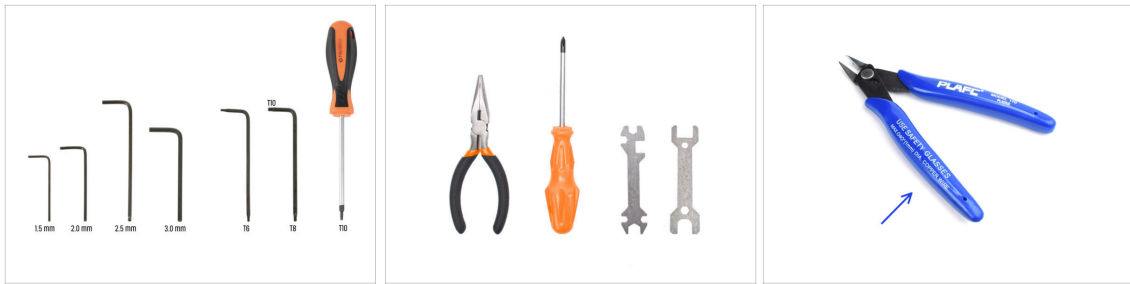

● **For the following steps, please prepare:**

- Llave Allen de 2.5mm
- Llave Allen de 1.5mm
- Llave Torx T10
- Alicates de punta fina
- Alicates de Corte Plano (Opcional)


PASO 2 Front profiles: parts preparation

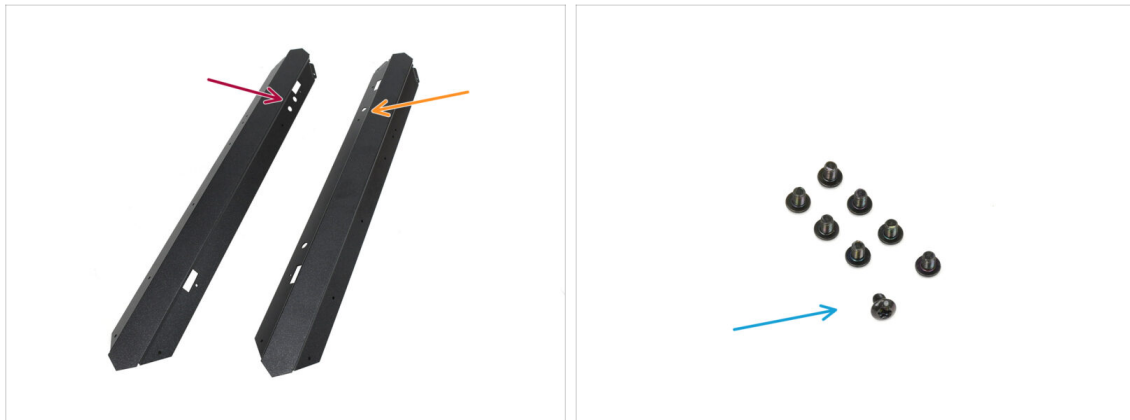

● **For the following steps, please prepare:**


- Front Left Profile (1x) *found in the Metal parts 1/3 package*
 - ① The one with the two circular openings on top.
- Perfil Frontal Derecho (1x) *que se encuentra en el paquete Metal parts 1/3*
 - ① The one with one circular opening on top.
- Tornillo M3x4rT (8x)

PASO 3 Installing the front right profile

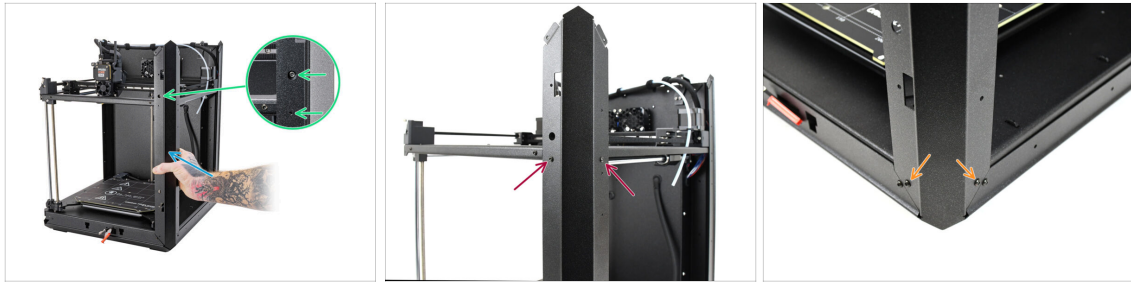


- Attach the Front Right Profile to the printer.
 - ❗ Ensure you are using the correct profile—it should have **one large round opening** for the belt tensioning screw.
 - Align the profile so that the calibration screw opening and the smaller bolt opening line up with the thread.
 - Fija el perfil al conjunto CoreXY con dos tornillos M3x4rT
 - Fix the profile at the bottom using the two M3x4rT screws.

PASO 4 Installing the front left profile

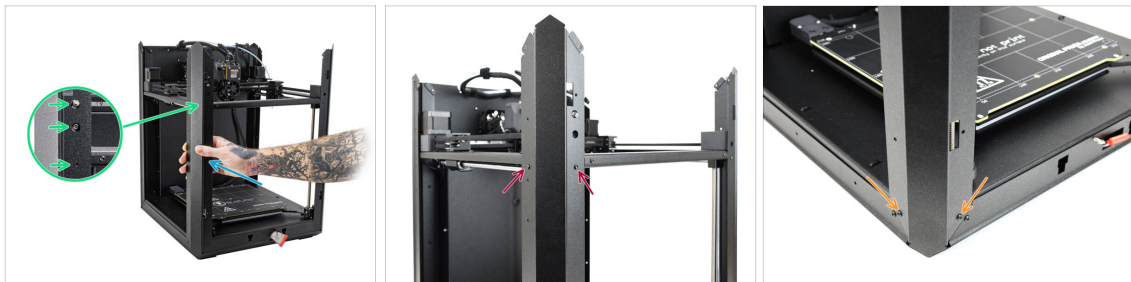

- Attach the Front Left Profile to the printer.
 - ❗ Ensure you are using the correct profile—it should have **two large round openings** for the door sensor and the belt tensioning screw.
 - Align the profile so that the openings match. **Be careful not to bend the door sensor lever!**
 - Fija el perfil al conjunto CoreXY con dos tornillos M3x4rT
 - Fix the profile at the bottom using the two M3x4rT screws.

PASO 5 Top profiles: parts preparation

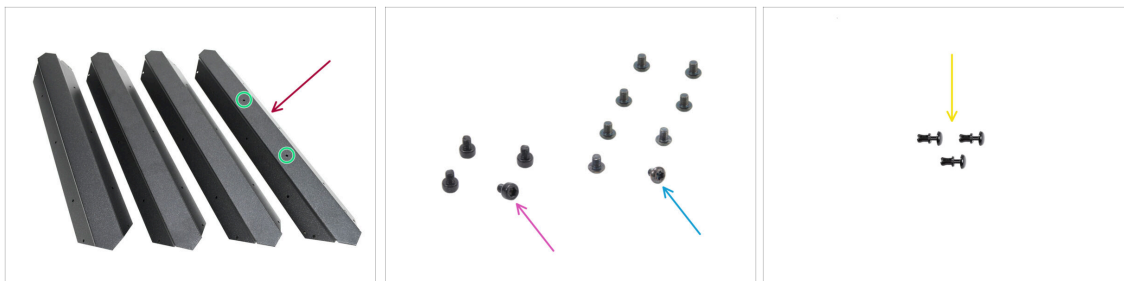

- Top Profile (4x) *found in the Metal parts 1/3 package*
- Note that one of the profiles has two openings in the middle—this one belongs at the back.
- Tornillo M3x4rT (8x)
- Tornillo M3x4 (4x) *con el tipo de cabeza diferente*
- Remache de nylon (3x)

PASO 6 Assembling the top profiles I.




- ⚠ Be very careful when handling sharp sheet metal parts to avoid injury or damage.
- According to the picture, place the top profile with two holes on the flat side.
- Orient the part according to the picture. **Use the flange as a guide.**
- Coloca cualquiera de los perfiles superiores en el lado izquierdo. Orienta la pieza según la imagen. **Utiliza la pestaña como guía.**
- Attach the two profiles together.
 - ⚠ The flange of the front plate (blue arrow) must be inserted **under** the left universal profile (green arrow), not on top of it.
- Align the holes in both parts and join both parts together with the M3x4 screw.
- Using the same procedure, join the other two profiles to form a corner, securing them with an M3x4 screw.

PASO 7 Assembling the top profiles II.



- Attach the corner profile assembly to the first one, aligning the holes on the flanges with the holes in the profiles.
- ⚠ Ensure the flanges are positioned **underneath** the profiles.
- Join the both profile assemblies using two M3x4 screws.

PASO 8 Aligning the top profiles

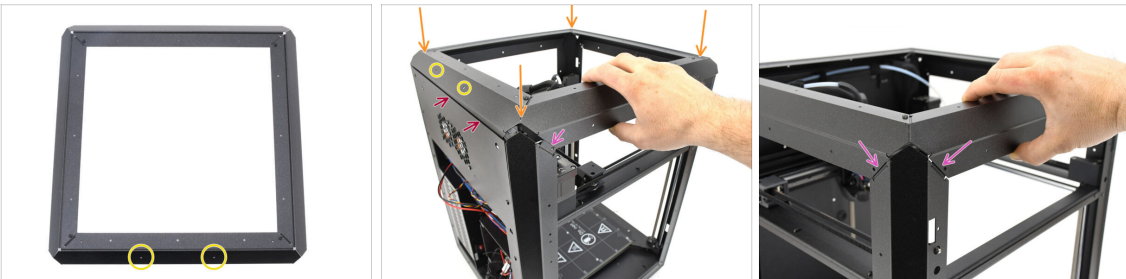

- Find the profile with **two openings in the middle**—this part should be positioned at the **rear of the printer**.
- Add the top profile assembly onto the printer, making sure the two openings are facing the back.
 - The protruding part of the rear profile must be positioned behind the back sheet metal plate.
 - En los laterales y la parte delantera, los perfiles deben asentarse sobre las pestañas con aberturas roscadas.

PASO 9 Installing the top profiles



- Once all the top profiles are properly aligned, fix them in place using the remaining 8 M3x4rT screws in the corners.
- Attach the back panel to the top profile with three nylon rivets.

PASO 10 CoreXY fixing screws: parts preparation



- For the following steps, please prepare:
- Tornillo M3x4rT (4x)

PASO 11 Fixing the CoreXY assembly



- Align the CoreXY assembly so the threaded holes match the screw openings in the rear profiles. You may need to push the assembly upward to align the holes.
- Fix the CoreXY assembly using the four M3x4rT screws in the marked openings.

PASO 12 Side sensor base: parts preparation



- **For the following steps, please prepare:**
- Filament-sensor-body (1x)
- Filament-sensor-lever (1x)
- Filament-sensor-switch (1x)
- Tornillo M3x10 (1x)
- 10x6x2mm magnet (2x) *found in the Electronics & Fasteners package*
- 7mm Ferromagnetic Ball (1x) *found in the Electronics & Fasteners package*
- Arandela M3w (1x)

PASO 13 Assembling the side sensor base



- Insert one of the magnets into the dedicated opening in the Lever.
- Insert the ball into the corresponding opening on the inside of the sensor base.
- Insert the lever with the magnet into the Base.

i La parte con el imán debe colocarse junto a la bola.

Ten en cuenta que la bola se sentirá atraída por el imán—asegúrate de que se mantiene en su sitio.

- Fija la palanca en su sitio con la arandela M3w y el tornillo M3x10. Apriétalo solo unas vueltas por ahora—lo suficiente para mantenerla en su sitio.

! **No aprietes completamente el tornillo. De lo contrario, ¡la palanca no se moverá y el sensor no funcionará!**

PASO 14 Probando la palanca



- Verify the lever is able to move freely.
- Si la palanca no se mueve libremente o no se puede mover en absoluto, afloja el tornillo un cuarto de vuelta y vuelve a probar el movimiento.


! **El tornillo no debe apretarse completamente; de lo contrario, la palanca no podrá moverse libremente.**

PASO 15 Montaje del interruptor



- Inserta el segundo imán 10x6x2 en el filament-sensor-switch.
 - Instala el filament-sensor-switch en el filament-sensor-body.
 - Mueve el filament-sensor-switch a la posición extrema izquierda, de modo que los imanes queden enfrentados.
 - Asegúrate de que **los imanes se repelen** - deben alejarse unos de otros.
 - **Si se atraen** - acércalos entre sí: retire el imán del interruptor del sensor de filamento e invierta su polaridad. A continuación, compruébelo de nuevo.
- i** *Consejo pro: Utiliza una de las llaves hexagonales finas o llaves Torx para retirar el imán del interruptor del sensor de filamento.*

PASO 16 IR Sensor: parts preparation

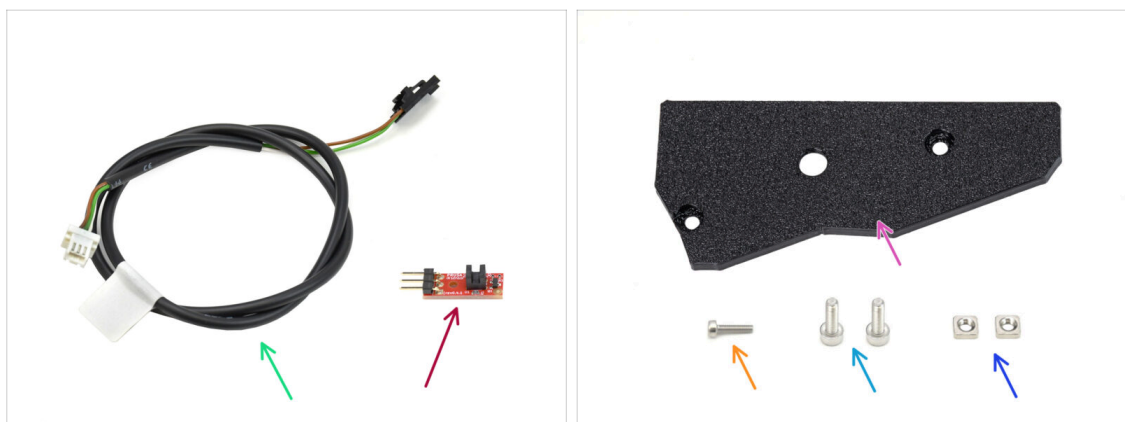


- **For the following steps, please prepare:**
- Side Filament Sensor Cable (1x) *found in the Electronics & Fasteners package*
- IR Filament Sensor (1x) *found in the Electronics & Chamber parts package*
- Cubierta Sensor Filamento Lateral (1x) *se encuentra en el paquete de Printed parts*
- Tornillo M2x8 (1x)
- Tornillo M3x10 (2x)
- Tuerca M3nS (2x)

PASO 17 Connecting the IR sensor




- Plug the cable into the IR filament sensor.
- ⚠ Ensure the connector is oriented correctly before plugging it in!
- On CORE One, the brown cable must connect to the +5V pin.
- El cable blanco se conecta a la patilla GND.

PASO 18 Installing the IR sensor

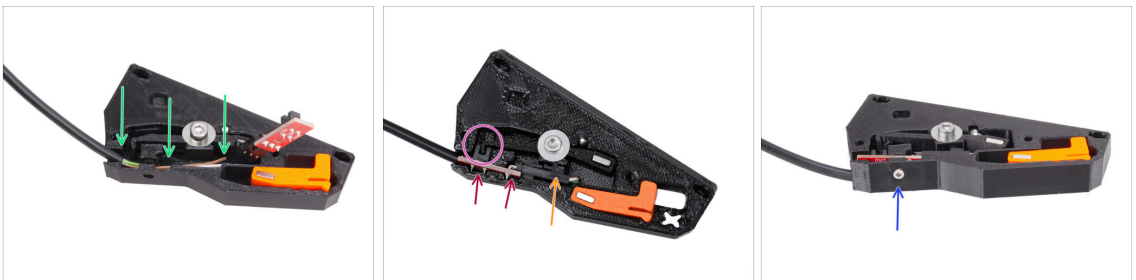

- First, insert the cable into the groove. The black connector should be approximately in the middle of the sensor base.
- Insert the IR sensor itself into the dedicated groove.
- The lever must fit into the optical gate part of the sensor.
- Asegúrate de que ni el conector ni los cables tocan la palanca, ya que esto podría impedir el correcto funcionamiento del sensor.
- Using the 1.5mm Allen key, fix the sensor in place with the M2x8 screw.

PASO 19 Installing the side sensor cover

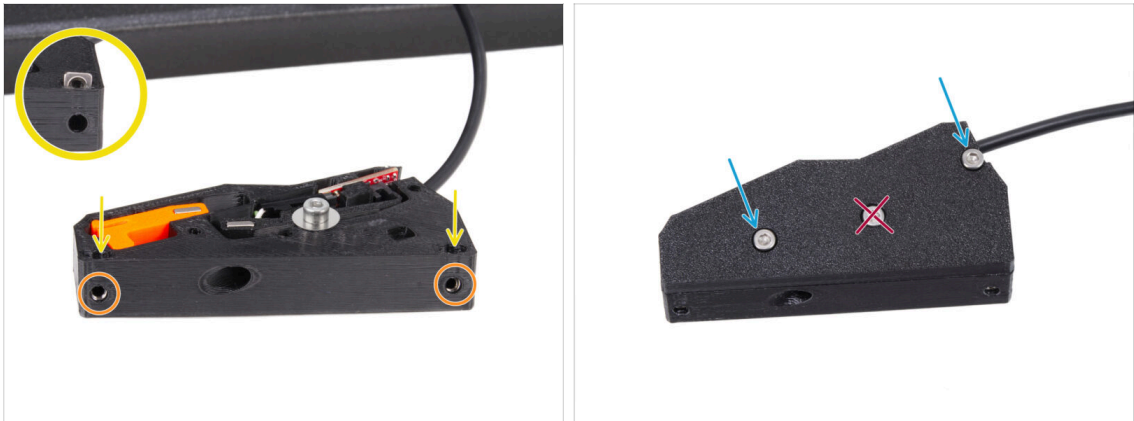

- ✦ Insert the two M3nS nuts into the designated openings. Use a 1.5mm Allen key to **push them all the way in.**
 - ✦ Look from the side to ensure the threads in the nuts align with the openings.
 - ✦ Add the cover part onto the assembly.
 - ✦ Fija la cubierta en su sitio utilizando dos tornillos M3x8 en los laterales.
- ⚠ **¡No aprietes el tornillo del centro! De lo contrario, el sensor dejaría de funcionar.**

PASO 20 Side filament sensor: parts preparation



- ✦ **For the following steps, please prepare:**
- ✦ Side Filament Sensor Assembly (1x) *you assembled earlier*
- ✦ Collet (1x) *found in the Electronics & Fasteners package*
- ✦ Brida (3x)

PASO 21 Installing the side filament sensor




- Install one zip-tie into the marked openings. We will use it to attach a cable underneath the metal profile.
 - Inserta la presilla en el orificio marcado en el conjunto del sensor.
 - Attach the sensor assembly onto the PTFE tube in the printer.
- ⚠ ¡Asegúrate de empujar el tubo hasta el fondo!

PASO 22 Guide the filament sensor cable




- Move the sensor assembly up, roughly to the middle of the printer's frame, to align the cable properly.
- Once in position, secure the cable underneath the metal profile using a zip-tie. Tighten the zip-tie lightly, allowing for cable adjustments if needed later. Cut off the excess zip-tie.
- Guide the sensor cable through the dedicated opening to the back of the printer.
- En la parte posterior de la impresora, guía el cable hacia la caja xBuddy. Déjalo colgando sin apretar por ahora.

PASO 23 Connecting the side filament sensor

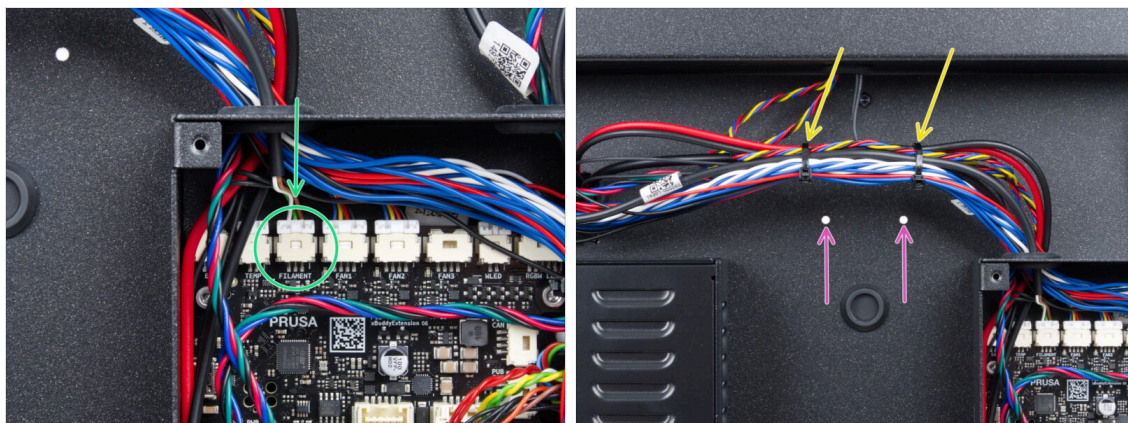

- Connect the Side Filament Sensor cable into the connector labeled FILAMENT on top of the xBuddy extension board.
- i You can use needle-nose pliers to assist you, but be careful not to damage the cables.
- Use two zip-ties to clamp the cable bundle together in the marked area.
- Fija los cables en la **posición más alta posible** para asegurarte de que dejen libres las dos aberturas de la chapa inferior.
- ⚠ Do not over-tighten the zip ties or strain the cables too much!

PASO 24 NFC Antenna: parts preparation

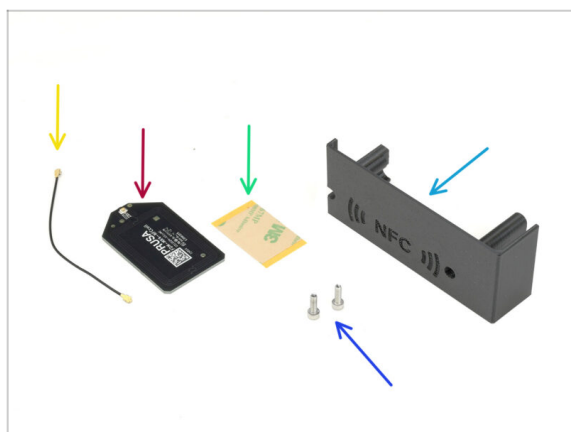

- For the following steps, please prepare:
- El-box-cover (1x) found in the Printed parts package
- Tornillo M3x10 (2x)
- NFCcoil (1x) se encuentra en el paquete de Electronics & Chamber parts
- Adhesive film 32 x 25 mm (1x) found in the Electronics & Chamber parts package
- NFC coil cable (1x) found in the Electronics & Chamber parts package

PASO 25 Applying the adhesive film




- Peel off the yellow protective film from the adhesive tape.
- Apply the film to the flat side of the NFC coil, ensuring it adheres properly.
- Peel of the remaining protective layer from the NFC coil.

PASO 26 Installing the NFC Coil




- Stick the NFC coil onto the inner side of the EI-box cover, approximately as shown in the picture.
- ① The small round connector should be positioned closer to the edge of the cover.
- Connect the cable to the board by aligning the connectors and pressing lightly until you feel a click, ensuring a secure connection.
- ⚠ **Ten mucho cuidado al conectar el cable de la bobina NFC. Una presión excesiva o una mala alineación pueden causar daños irreversibles.**

PASO 27 Connecting the NFC Coil

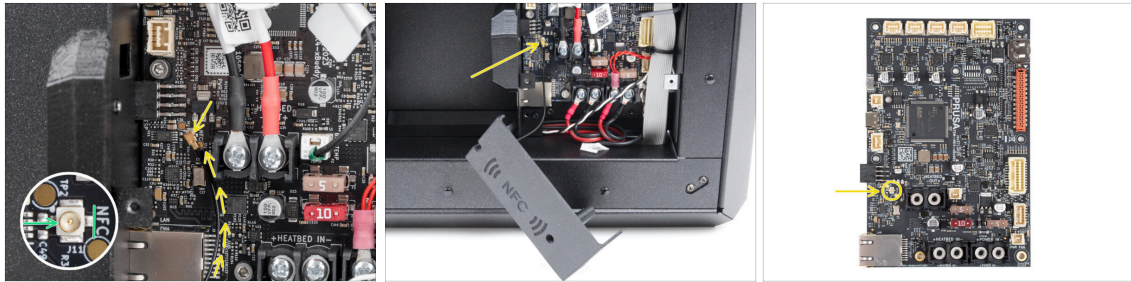

- 🟢 Locate the small round connector labeled NFC on the bottom left side of the xBuddy board.
- 🟡 Connect the NFC coil cable to the board by aligning the connectors and pressing lightly until you feel a click.

PASO 28 Comprobación del cableado

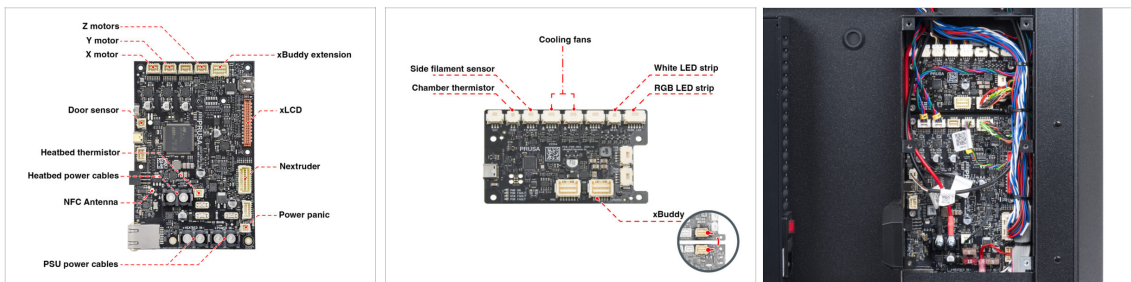

- ⬛ Use the pictures as a reference to verify your electronics connections.
- ⚠️ Make sure that all connectors are fully inserted and PSU cables properly tightened. Otherwise, there is a risk of damage to the printer!

PASO 29 Preparing the electronics cover



- Push two M3x10 screws through the EI-box-cover.


PASO 30 Installing the electronics cover



- Ensure the threaded holes on the bottom of the xBuddy box are not obstructed by cables.
- If so, rearrange the cables to allow clear access.
- Align the cover with the opening in the xBuddy box and fix it in place by tightening the screws.
- Pasa el cable NFC por el espacio entre el conector Ethernet y los cables de alimentación de la fuente de alimentación.

⚠ Avoid running it through the Ethernet connector or the power cables. The cable may be damaged when covering the xBuddy box.

PASO 31 Nota Cámara Buddy3D

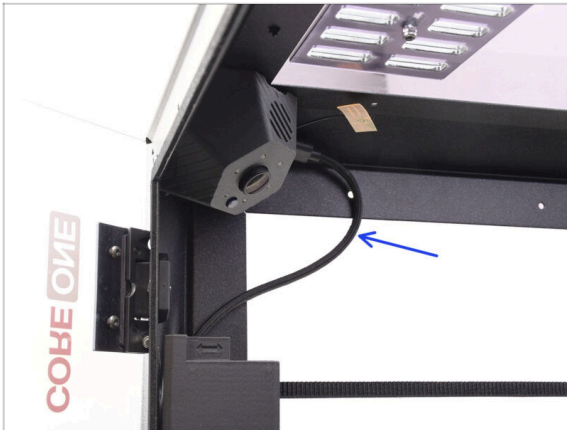



i For future Buddy3D Camera users:

- Si planeas utilizar la Cámara Buddy3D, ya tienes el cable USB instalado.



Para obtener información detallada sobre cómo montar y conectar la cámara Buddy3D, vuelve a esta guía: **Instalación Cámara Buddy3D en la CORE One**


PASO 32 xBuddy cover: parts preparation

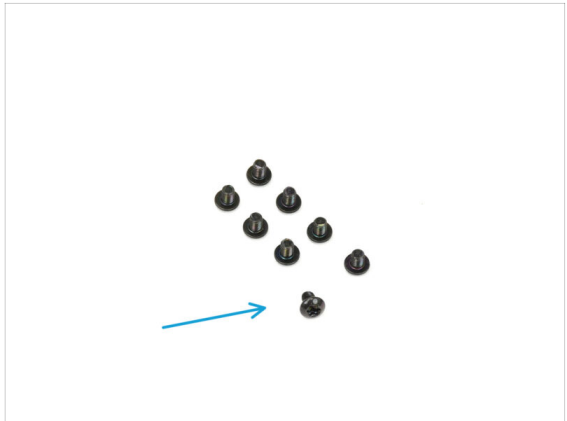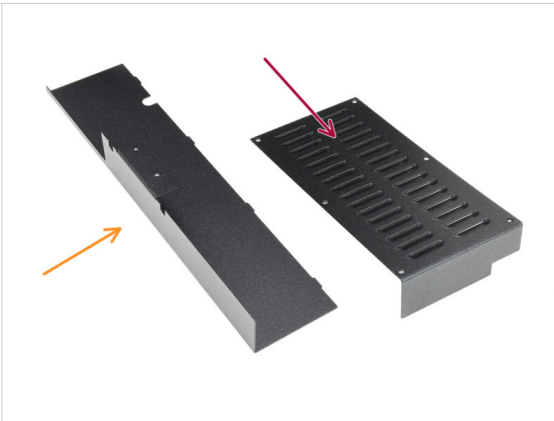

For the following steps, please prepare:

- Sheet metal back cover (1x) *found in the Metal parts 2/3 package*
- xBuddy cover (1x) *found in the Metal parts 3/3 package*
- Tornillo M3x4rT (8x)

PASO 33 Installing the xBuddy cover

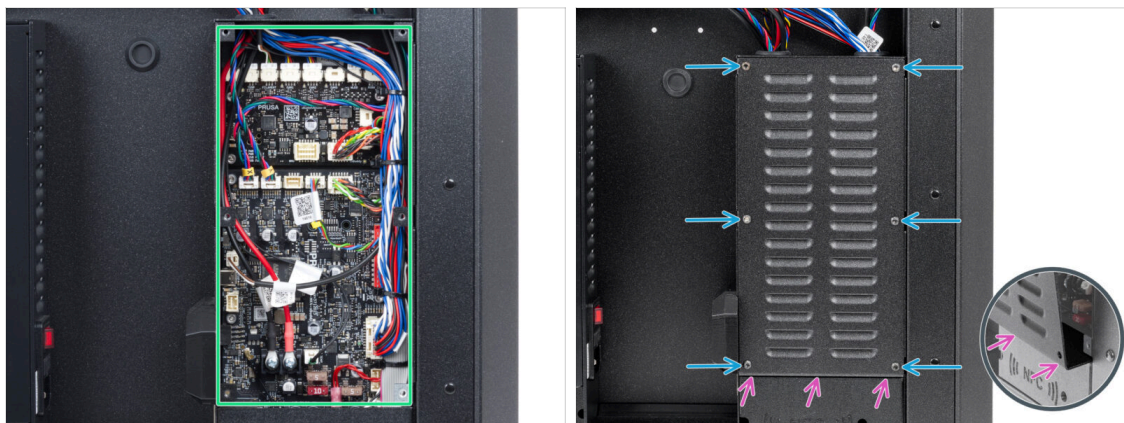


- Arrange the cables inside the xBuddy box as shown in the picture.
- Carefully cover the xBuddy box by first sliding the bent part of the cover into the box.
- ⚠ **Evita pellizcar los cables. Comprueba dos veces la posición del cable de la bobina NFC.**
- Fija la tapa de la caja xBuddy con los seis tornillos M3x4rT.

PASO 34 Installing the rear cover



- Align the rear sheet metal cover so that the cables can run through the "tray".
- Place the rear sheet metal cover into the recess. Push it toward the printer, then move it upward to engage it.
- Hay cuatro pestañas que deben encajar en el chasis de la impresora.
- Fija la cubierta posterior en su sitio utilizando dos tornillos M3x4rT desde el interior de la impresora.

PASO 35 Right side: parts preparation

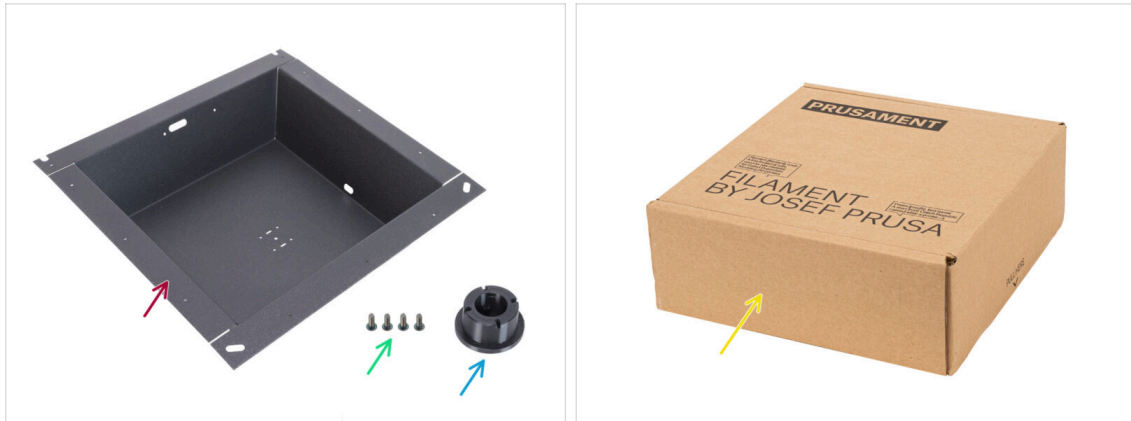

● For the following steps, please prepare:

● Right side sheet metal (1x) found in the Metal parts 2/3 package

⚠ La pieza correcta del **lado derecho** puede identificarse fácilmente por las aberturas para tornillos del centro.


● Tornillo M3x8rT (4x) se encuentra en el paquete de Electronics & Fasteners

● Puck-universal (1x)

● Cualquier caja de cartón (1x)

📌 Consejo: Una caja de Prusament funciona bien.

PASO 36 Installing the spoolholder puck

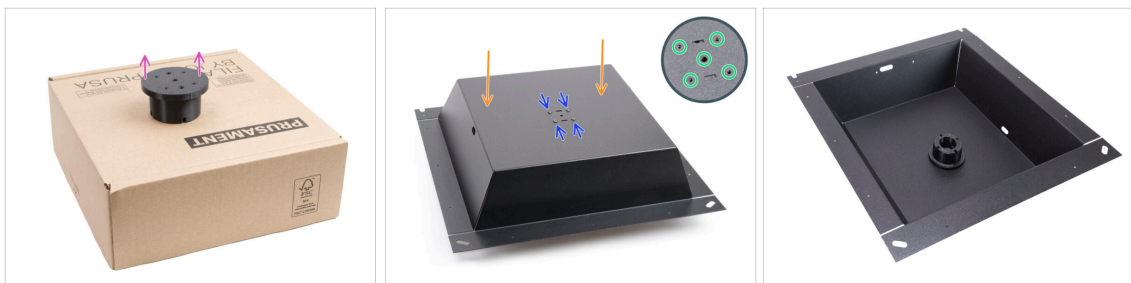

● Coloca el Puck-universal sobre la caja de cartón de manera que los orificios para los tornillos queden hacia arriba.


● Coloca con cuidado el panel derecho sobre el Puck-universal, situándolo en el centro de la caja.

● Alinea los orificios del Puck-universal con los orificios del panel derecho.

● Fija el Puck-universal con cuatro tornillos M3x8rT.

ⓘ Los tornillos pueden ofrecer resistencia al apretarlos, ya que crean su propia rosca dentro de la pieza.


PASO 37 Right handle: parts preparation

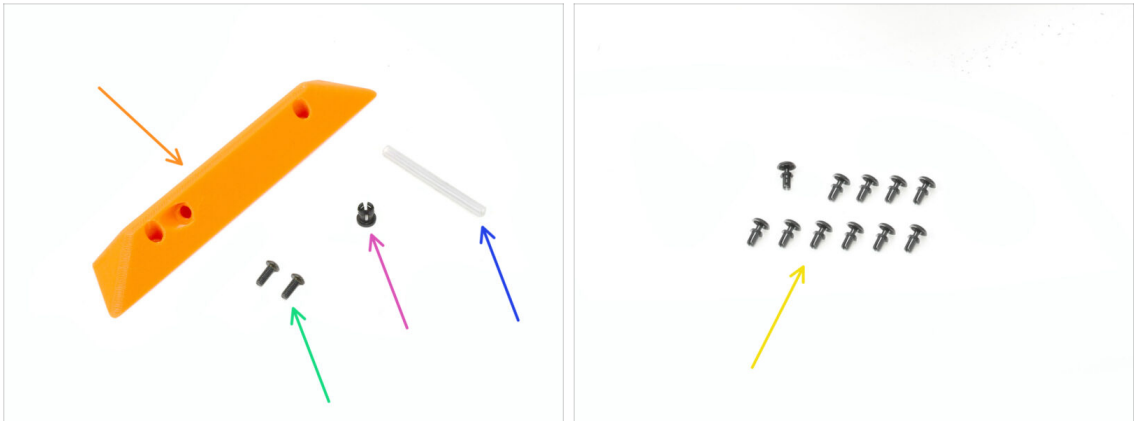

● For the following steps, prepare:

- Side Handle (1x) *found in the Printed parts package*
- Tornillo M3x8rT (2x)
- Pinza (1x) *se encuentra en el paquete de Electronics & Fasteners*
- PTFE Tube 4 x 2.5 x 45 mm (1x) *found in the CoreXY parts + Hinges set package (together with hinges parts)*
- Remache de nylon (11x)

PASO 38 Instalando la presilla

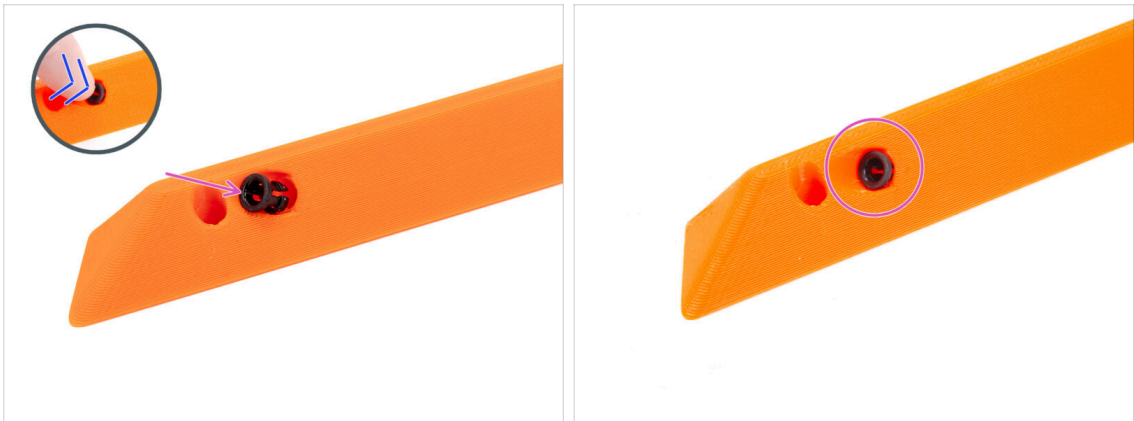


- Inserta la presilla en el mango.
- Push it all the way in.

PASO 39 Montando el asa




- ✦ Place the right-side metal sheet assembly on the right side of the printer. Ensure the U-shaped cutouts are facing upwards.
- ✦ Attach the right handle to the right metal sheet.
- ✦ Introduce un tornillo M3x8rT a través del orificio posterior del asa y la chapa.
- ✦ Attach the side filament sensor assembly on the screw.
- ⚠ **Do not pull the side sensor assembly too far; bring the right side metal sheet as close as possible.**
- ✦ Tighten the screw just slightly—the nut must remain free to move.
- ✦ Align the side filament sensor with the front screw hole in the metal sheet and the handle.

PASO 40 Fixing the right side

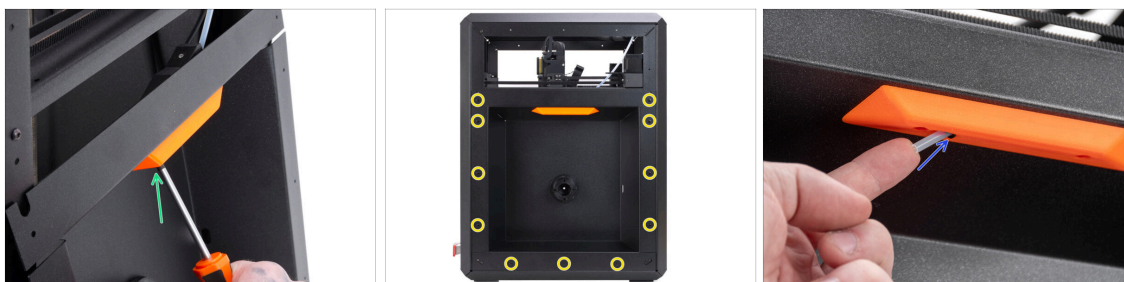

- ✦ Using the second M3x8rT screw, secure the right handle and the side filament sensor to the right metal sheet.
- ✦ Secure the side sheet metal to the printer using the 11 Nylon rivets.
- ✦ Introduce el tubo corto de PTFE 4 x 2.5 x 45 en la pinza. Empújalo hasta el fondo.
- ⓘ Part of the PTFE tube will remain protruding from the handle.

PASO 41 Left side: parts preparation

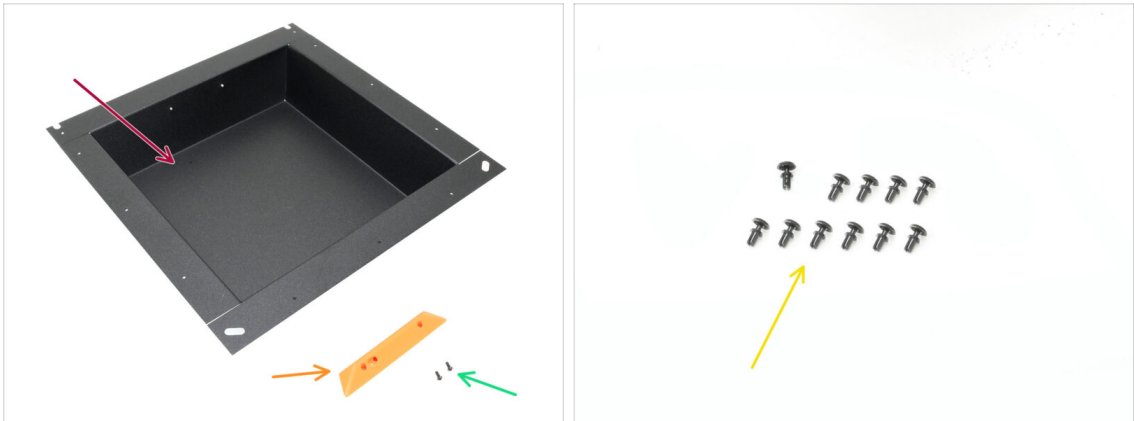

● **For the following steps, prepare:**


- Left side sheet metal (1x) *found in the Metal parts 2/3 package*
- Asa Lateral (1x) *se encuentra en el paquete de Printed parts*
- Tornillo M3x5rT (2x)
- Remache de nylon (11x)

PASO 42 Installing the left side



- Align the handle with the threaded openings in the sheet metal.
- Attach the handle using the two M3x5rT screws.
- Fija la chapa lateral a la impresora utilizando los 11 remaches de Nylon.

PASO 43 Momento Haribo

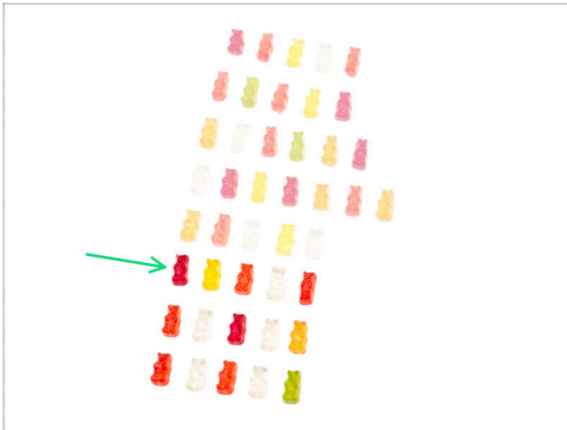

- Well done—fuel up for the next challenge!
- Eat the sixth row.
- ¡Tan cerca! ¡Pero **las manos fuera de esas últimas gominolas!**

PASO 44 Listo




- Congratulations! You've successfully assembled the entire body.
- Let's move to the next chapter.

8. Trim, Door & xLCD



PASO 1 Tools necessary for this chapter

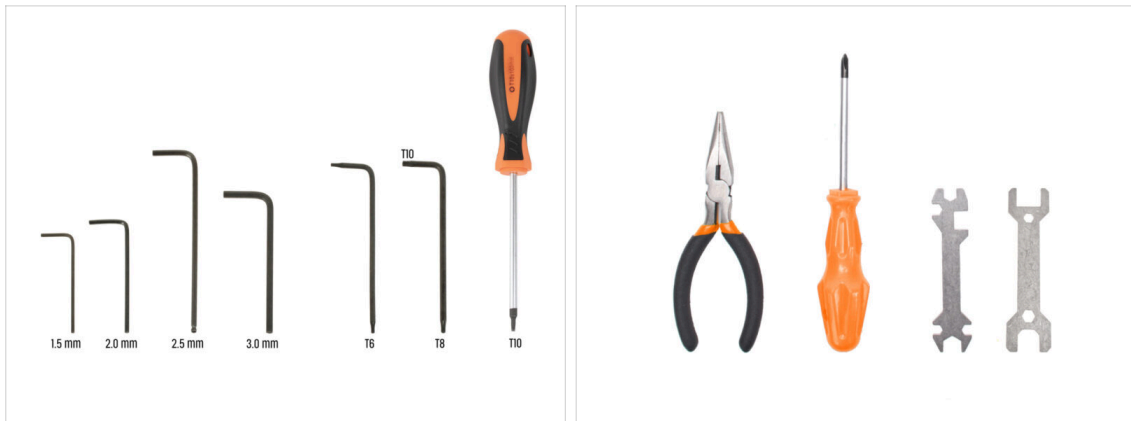

● **For the following steps, prepare:**

- Llave Allen de 2.5mm
- Llave Torx T10
- Alicates de punta fina


PASO 2 Top cover: parts preparation



● **For the following steps, prepare:**


- Top cover (1x) *found in the Plexi set package*
- Vent cover (1x) *found in the Plexi set package*
- Tuerca M3nN (3x)
- Insulating insert (3x) *found in the Electronics & Fasteners package*
- ⓘ This part may come in either gray or black. However, the shape is identical, and it does not affect the procedure.
- Tornillo M3x12rT (3x)
- Remache de nylon (4x)
- Upg-vent-block

PASO 3 Retirando la película

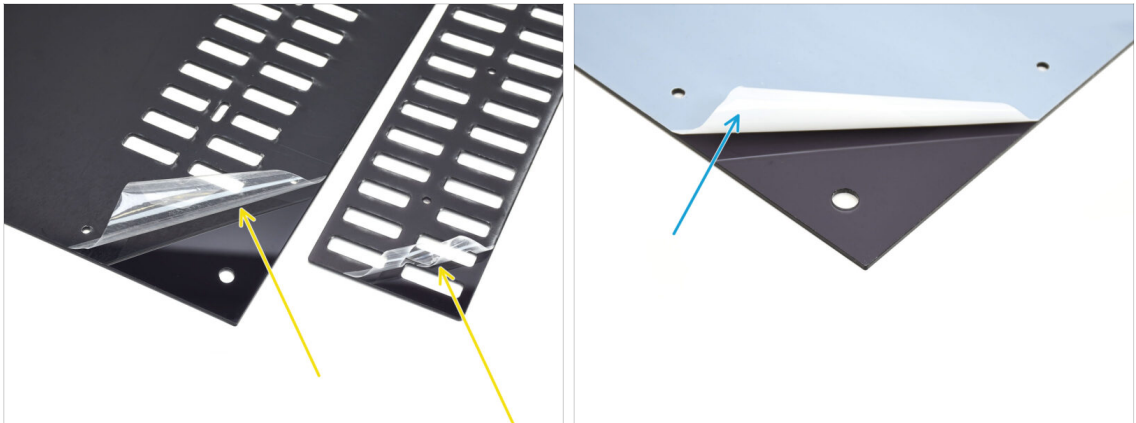


- First, remove the protection foil from both the plastic sheets.
- Flip the parts around and remove the protective foil from the other sides.

PASO 4 Test-fitting the top cover

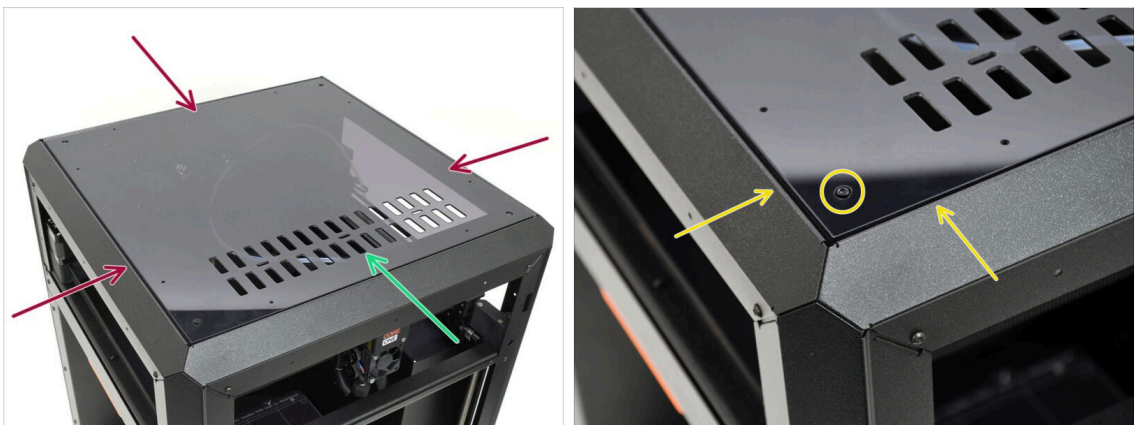


- Lay down the top cover onto the printer.
- The part with the vent openings should be oriented towards the front of the printer.
- If oriented correctly, the cover will align with the recess, and the bolt heads in the corners will fit into the cutouts.
- i** If the bolt openings don't align, flip the cover.

Spoiler alert: The cover isn't symmetrical!

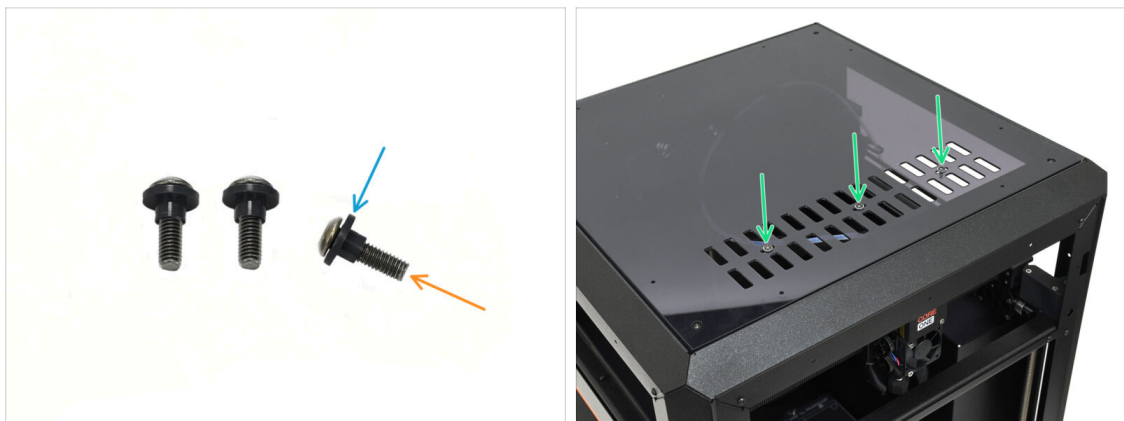PASO 5 Assembling the top cover I.

- Run all three M3x12rT screws through the insulating inserts.
- Make sure the flanged part of the insert is oriented toward the screw head.
- Insert the screws with the inserts through the three slot openings in the vent.

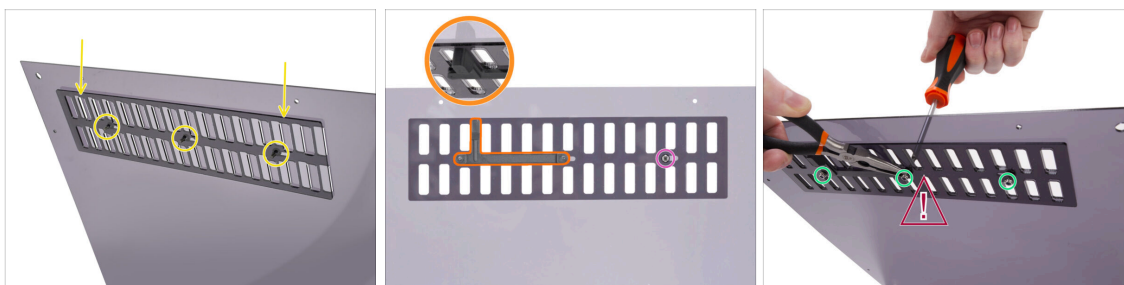PASO 6 Assembling the top cover II.

- Align the vent cover with the screw ends on the bottom.
 - Aprieta a mano la tuerca M3nN situada más a la derecha en el tornillo M3x12rT para fijar la cubierta en su sitio.
 - Fija el Upg-vent-block a la cubierta de ventilación. Asegúrate de que esté colocado correctamente.
 - Fija el Upg-vent-block en la cubierta de ventilación con tuercas M3nN. Utiliza los alicates de punta fina para sujetar las tuercas mientras aprieta los tornillos.
- ⚠ The screw must be tight enough just to remove the slack. It must remain loose, or the ventilation cover won't open and close properly.

PASO 7 Probando la ventilación




- ◆ Try moving one of the three screws with your hand.
- ⓘ The vent openings must open and close smoothly without effort.
- ⚠ If movement is difficult, loosen the screw that is restricting it.

PASO 8 Installing the top cover




- ◆ Alinea la cubierta con el hueco de la impresora, asegurándote de que la rejilla de ventilación quede orientada hacia delante.
- ◆ Secure the cover to the frame using four nylon rivets in the marked openings.
- ⓘ There are eight openings, but four rivets should be sufficient.

PASO 9 Side covers: parts preparation

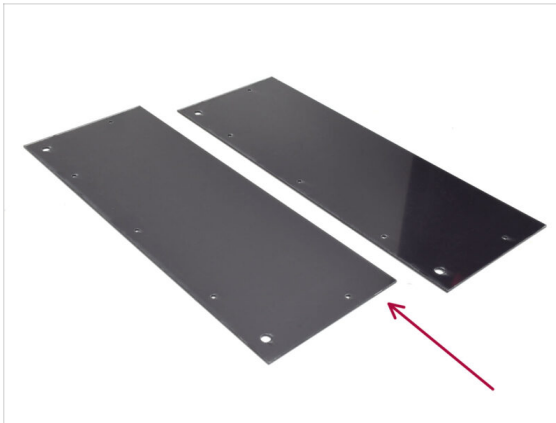

- For the following steps, prepare:
- Side Cover (2x) found in the Plexi set package
- Remache de nylon (10x)

PASO 10 Retirando la película

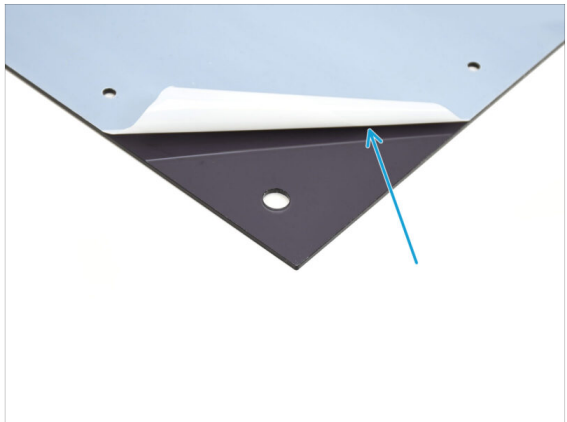

- Remove the protective foil from both the side covers.
- Remove the protective foil from the other sides of both the side covers.

PASO 11 Covering the left side



- ✎ Align the cover with the recess on the left side of the printer.
- ✎ The protruding screws on the printer must align with the larger openings in the cover.
- ✎ Secure the cover to the frame using five nylon rivets in the marked openings.

PASO 12 Covering the right side



- ✎ Align the other cover with the recess on the right side of the printer.
- ✎ Secure the cover to the frame using five nylon rivets in the marked openings.

PASO 13 xLCD: preparación de las piezas



- For the following steps, prepare:**
- ✖ xLCD (1x) found in the *Electronics package*
 - ✖ xLCD Front Cover (1x) found in the *Printed parts package*
 - ✖ xLCD Display-mount (1x) found in the *Printed parts package*
 - ✖ Knob (1x) found in the *Printed parts package*
 - ✖ Tornillo 3x8sT (4x)
 - ✖ Faston connector (1x) found in the *Electronics package*

PASO 14 Assembling the xLCD I.



- ✖ We recommend placing the front cover face down on a cardboard box edge or desk to create space for the encoder knob.
- ✖ Remove the protective foil from the xLCD.
- ✖ Insert the xLCD into the front cover.

PASO 15 Assembling the xLCD II.




- Cover the assembly with the rear part.
 - If you have an older version of the printed rear cover, it must hook by the xLCD itself in the corner. With the up-to-date version, the rear part can be simply laid down.
- Fix the parts together using **JUST THREE** 3x8sT screws in the marked openings.
 - ⚠ Do not insert the screw into the fourth opening next to the long slot for the xLCD connector, visible through the cutout. Leave it empty for now.

PASO 16 Installing the FE Faston connector



- Let's move on to the fourth screw opening—this is where we will attach the grounding faston connector.
 - Using needle-nose pliers, carefully maneuver the grounding faston connector over the screw opening, ensuring the holes line up.
 - Secure the connector in place using one 3x8sT screw, making sure it stays lined up as indicated.
- ⚠ To prevent damaging some of the surrounding electronic components, be careful and make sure the connector doesn't spin, while tightening it.

PASO 17 Installing the LCD knob

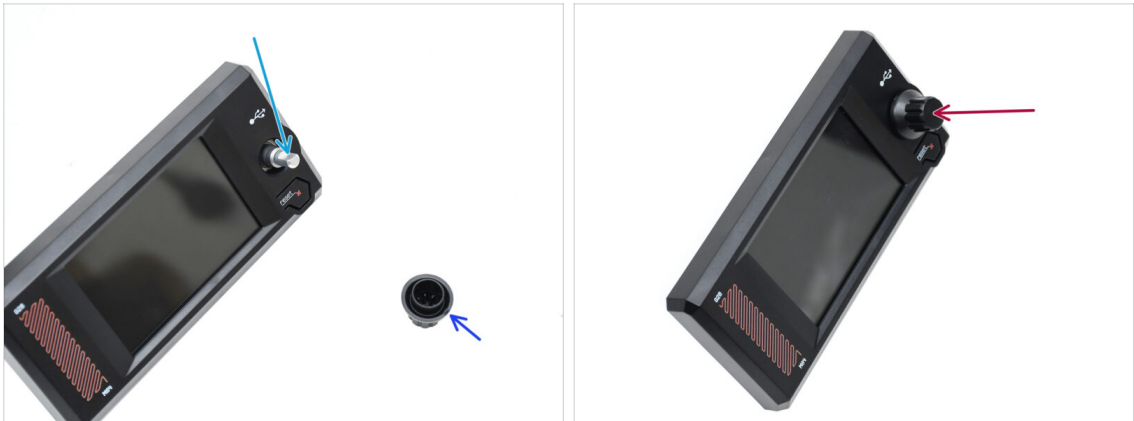

- There is a flat part on the encoder shaft. Rotate the encoder so that the flat part is facing up.
- There is a small gate scar on the injection-molded knob, which can serve as an orientation mark.
- Attach the knob onto the shaft, making sure the mark on the knob is facing up.

PASO 18 xLCD bezel: parts preparation




- **For the following steps, prepare:**
- xLCD (1x) *found in the Electronics package*
- Tuerca M3nS (2x)
- Tornillo M3x6 (2x)
- Bezel (1x) *found in the Metal parts 2/3 package*

PASO 19 Mounting the xLCD I.




- Insert the two M3nS nuts into the dedicated openings on the back of the xLCD assembly,
- Push the nuts all the way in until the threads line up with the screw openings.
- Attach two M3x6 screws into the openings. Do not screw them all the way in.
- Leave a gap under the screw heads.

PASO 20 Mounting the xLCD II.

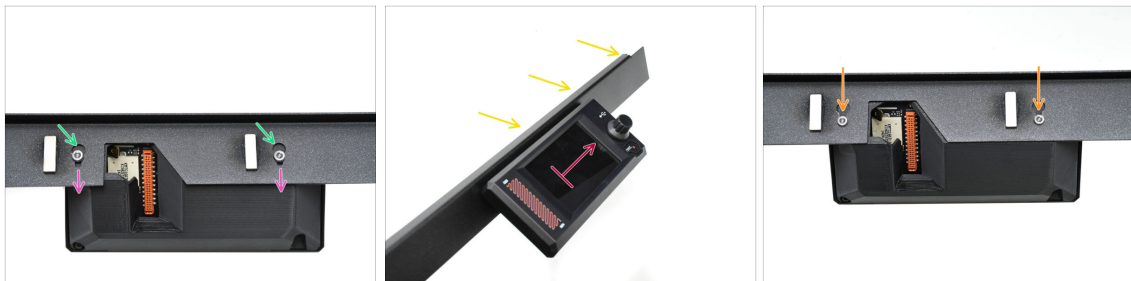

- Hook up the xLCD assembly onto the Bezel.
- Insert the screw heads into the keyhole openings.
- Slide the xLCD assembly so that the screw heads engage into the narrower parts of the keyholes.
- If assembled correctly, the LCD should be pointing up...
 - ...While the bent lip on the Bezel is on top.
- Push the screws all the way into the narrow part of the keyhole on both sides. Then, tighten the screws.

PASO 21 Installing the xLCD assembly

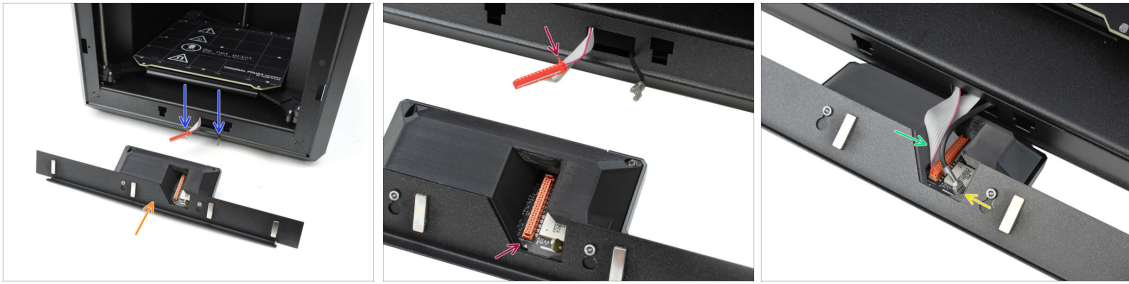


- Put the xLCD assembly in front of the printer, as pictured.
- Pull the appropriate cables out from the front of the printer to make connecting them easier.
- There is a small red tab on the main connector. This tab must be oriented towards the triangle symbol on the PCB.
- Connect the main connector into the xLCD.
- Connect the grounding faston connector.

PASO 22 Securing the xLCD assembly



- Gently lift the xLCD assembly into the upward position.
⚠️ Proceed carefully to ensure none of the cables get pinched or disconnected.
- Hook the tiny tab on the left side of the bezel behind the left vertical profile of the printer.
- Gently lift the bottom part of the xLCD assembly to allow for smoother tab engagement and extra wiggle room.
- Hook the tab on the right side into the printer's right profile.



PASO 23 Door seal: parts preparation

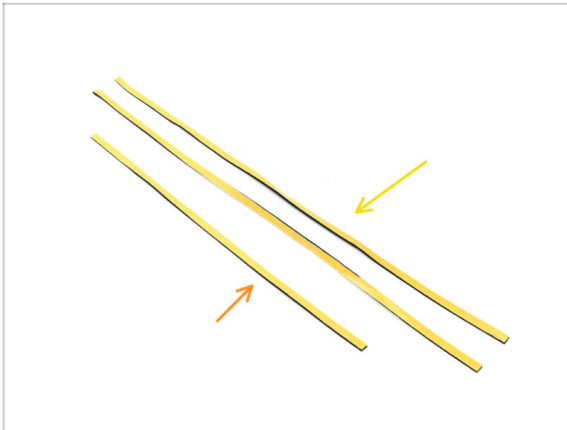

For the following steps, prepare:

- Side door seal, a longer one (2x) found in the *Electronics & Fasteners* package
- Top door seal, a shorter one (1x) found in the *Electronics & Fasteners* package
- i The color of the protective layer may vary.

PASO 24 Attaching the top seal

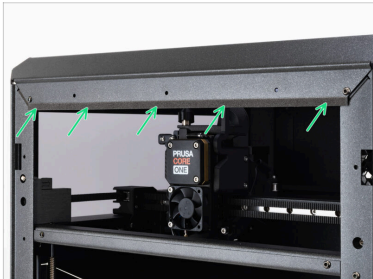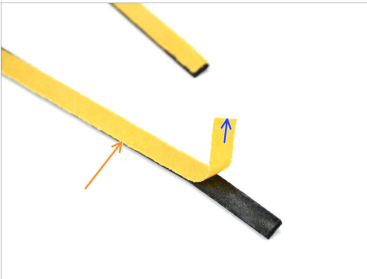


- Take the **SHORTER** seal.
- Peel off the start of the protective foil. No need to remove it entirely yet.
 - i No need to remove it entirely yet. For easier installation, you can peel it off gradually as you go.
- Start applying the seal along the top edge of the printer's frame.
 - Begin offset from the corner by a distance equal to the seal thickness.
- Apply the seal along the top edge, leaving the end offset from the corner, just like on the other side.

PASO 25 Attaching the side seals



- Apply the longer door seal, starting from the end of the seal on top.
- Work your way from the top down.
- ① With needle-nose pliers, trim the excess.
- Using the same technique, apply the remaining long seal along the left edge of the printer's frame.

PASO 26 Magnet holders: parts preparation

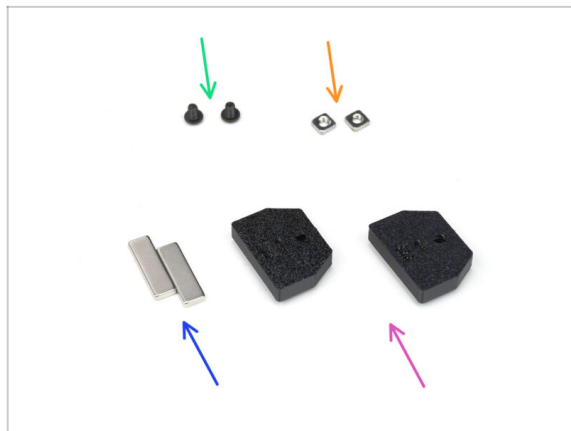

● For the following steps, prepare:

- Tornillo M3x5rT (2x)
- Tuerca M3nS (2x)
- 20x6x2 Magnet (2x) *found in the Electronics & Fasteners package*

⚠ **Mantén los imanes separados a una distancia suficiente. ¡Pueden romperse el uno al otro!**

- Magnet Holder (2x) *found in the Printed parts package*

PASO 27 Assembling the magnet holders




- ✚ Insert the M3nS nuts into the corresponding openings in the magnet holders.
- 🔴 Push the nuts all the way in, until the thread aligns with the screw opening.
- 🔵 Insert the magnets into the corresponding pockets in the holders. Push them all the way in.
- 📘 The orientation of the magnets does not matter.

PASO 28 Installing the magnet holders




- 🟡 From the inside of the printer, insert the magnet holder assembly into the corresponding bottom opening in the right-side metal profile.
- ⚠️ Ensure the protruding rectangular pocket fits into the cutout.
- 🟢 Secure the assembly in place using the M3x5rT screw.
- 🔵 Using the same technique, install the other magnet holder into the top opening on the right side.

PASO 29 Bisagras: preparación de las piezas

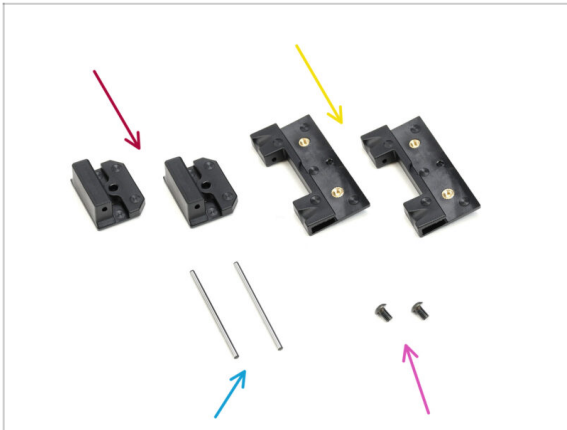


- For the following steps, prepare:
- Door-hinge-in (2x) found in the CoreXY + Hinges set package
 - Door-hinge-out (2x) found in the CoreXY + Hinges set package
 - Hinge Pin 2 x 40 mm (2x) found in the Electronics & Fasteners package
 - Tornillo M3x5rT (2x)

PASO 30 Installing the door-hinge-in parts

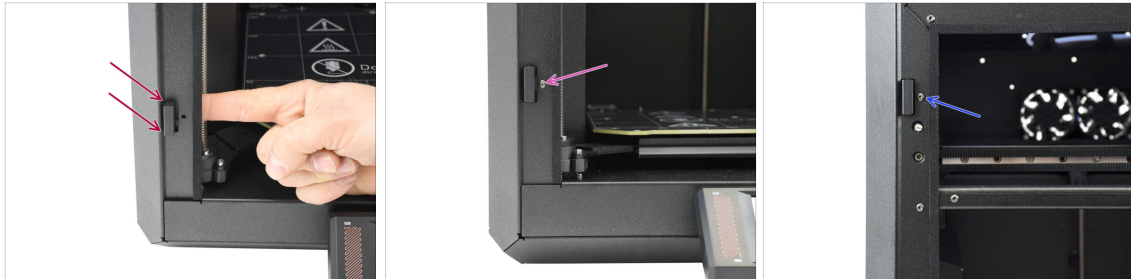


- From the inside of the printer, insert the door-hinge-in into the bottom rectangular opening in the left-side profile. The protruding part should pass through to the front.
- Fix the door-hinge-in in place using the M3x5rT screw.
- Using the same technique, install the other door-hinge-in into the opening on top.

PASO 31 Installing the door-hinge-out I.

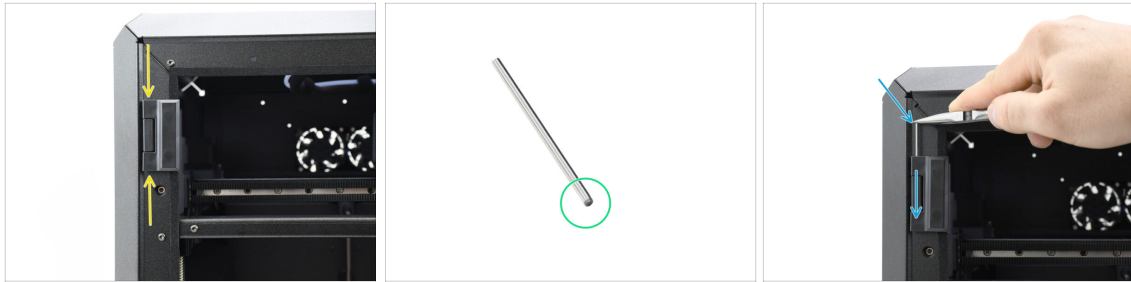

- ✦ Align the door-hinge-out with the door-hinge-in.
- ✦ The chamfered end of the hinge pin should be inserted first to make assembly easier.
- ✦ Insert the pin from the top of the door-hinge-out, guiding it through the door-hinge-in until it is fully inserted.
- ❗ Use the tip of needle-nose pliers to press the pin in securely.

PASO 32 Installing the door-hinge-out II.

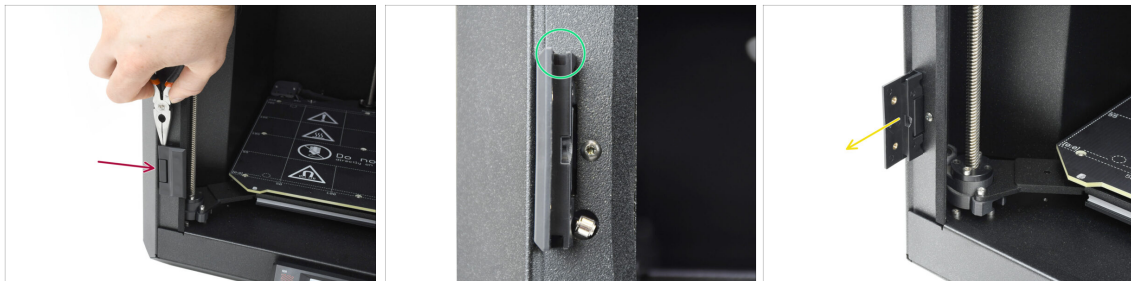


- ✦ Using the same technique, install the bottom door-hinge-out to complete the hinge assembly.
- ✦ Look into the grooves on the door-hinge-out parts and verify that the pins are fully inserted.

No part of the pin should be visible above the bottom surface in the groove.

- ✦ Open up both the hinges.

PASO 33 Door panel: parts preparation

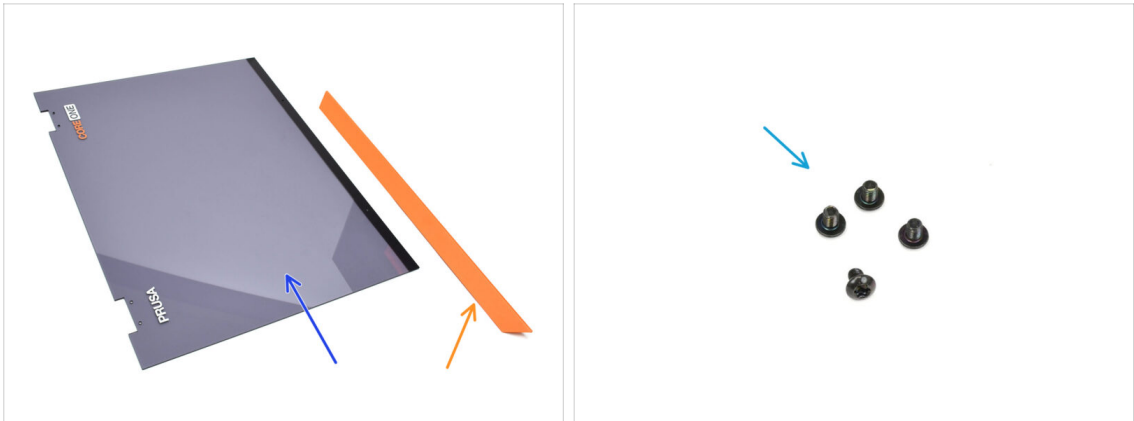


■ **For the following steps, prepare:**

- Door (1x) *found in the Plexi set package*

❗ El panel de la puerta está preetiquetado con **CORE ONE**. No te preocupes, **¡así debe ser!** En el último paso, aplicarás la pegatina de la actualización +.

- Door handle (1x) *found in the Metal parts 2/3 package*
- Tornillo M3x5rT (4x)

PASO 34 Door panel: removing the protective film

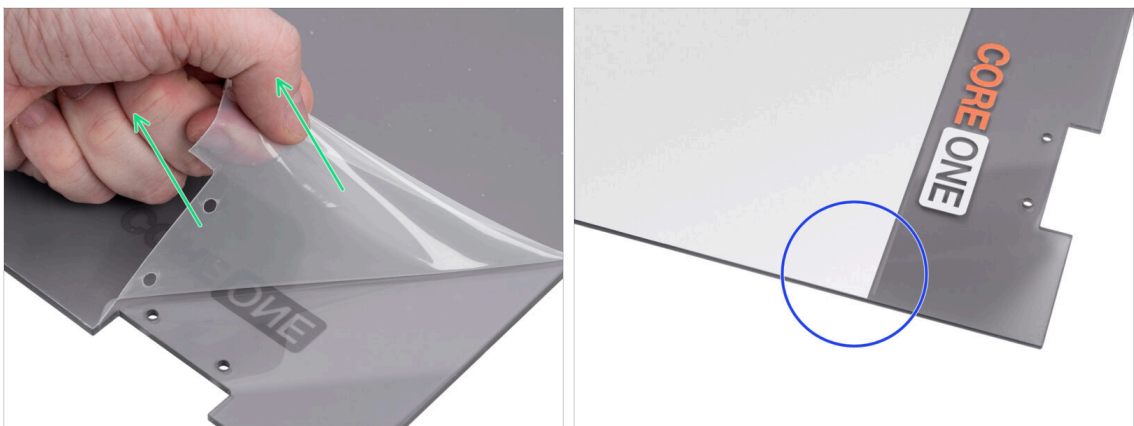

- **The door panel has protective film on both sides.** One covers the entire surface, the other just the center area.

- Peel off the film covering the entire door; it's lightly transparent.

- You can remove the center protective film (white) now or after mounting the panel to protect the surface during handling.

❗ This protective film does not interfere with the installation of the hinges or handle.

PASO 35 Instalando el panel de la puerta



- Align the door with the hinges. The cutouts on the door should fit into the grooves on top and bottom of the leaves.
- Make sure the door is oriented so that the signs on the door are pointing outward.
- Slide the door all the way into both the hinges.
- Fix the door to the hinges using four M3x5rT screws. Start with the top one. Then, do the bottom.


PASO 36 Assembling the door handle



- Let's move onto the handle. Remove the protective foil from both the adhesive strips on the inside.
- The part with the adhesive strip will go onto the back of the door. But do not attach the handle yet!

⚠ Wait for the upcoming step! We have to align the handle first!

PASO 37 Securing the door handle

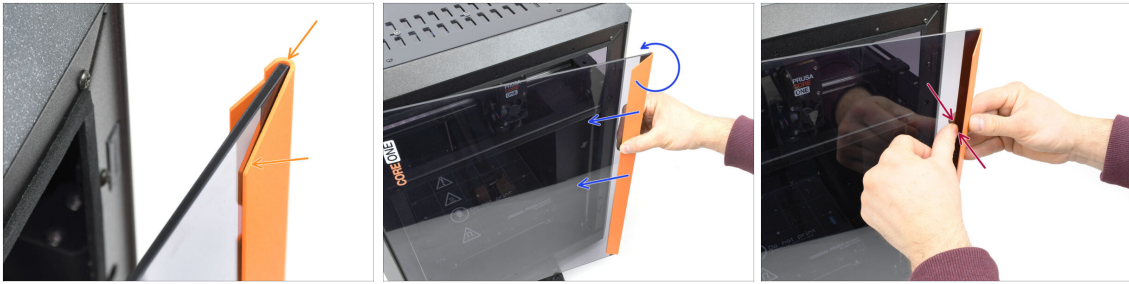

- ✦ Align the handle so that the front chamfered part is flat to the door. The top of the handle must be flush with the door.
- ✦ While pushing the handle against the door to keep it aligned, slowly rotate it counterclockwise until the adhesive strips bond to the door.
- ✦ Push the door and handle together firmly in the adhesive strip areas to ensure a secure attachment.

PASO 38 Colocando la pegatina: preparación de las piezas



- ✦ Para el siguiente paso, prepara:
 - ✦ Pegatina plexi CORE One+
- ❗ La pegatina del plexiglás CORE One+ se encuentra en la caja de actualización CORE One+.

PASO 39 Colocando la pegatina



- ◆ Retira la pegatina de la base azul.
- ◆ Alinea la pegatina con el **ONE** y aplica presión sobre la pegatina con suavidad pero con firmeza.
- ◆ Retira con cuidado la capa transparente y asegúrate de que el + no se despegue.

PASO 40 Momento Haribo




- ◆ Hard work deserves sweet results!
- ◆ Eat the seventh row.
- ⚠ But don't eat the rest yet.

PASO 41 Hecho



- ✦ ¡Enhorabuena! Has ensamblado correctamente tu Prusa CORE One+.
- ✦ Let's move to the final chapter.

9. Calibration & First run

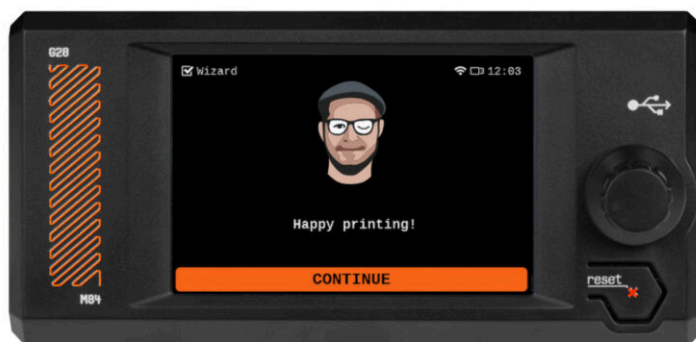

PASO 1 Tensado de la correa



i Este capítulo le guiará a través de la calibración y preparación de la impresora para su primer uso.

● Calibra la tensión de la correa. Consulta el siguiente artículo para obtener más información:

● **Adjusting belt tension (CORE One)**

⚠ Don't forget to come back here after adjusting the belts.

PASO 2 Instalando el porta bobinas: preparación de las piezas



● **Para los siguientes pasos, prepara:**

● Junta tórica

● Spoolholder-static


i El Spool-holder-static y la junta tórica se encuentran en la misma bolsa.

PASO 3 Colocando la lámina de impresión y el porta bobinas



- ⚠ **Asegúrate de que no haya nada sobre la base calefactable.** La base calefactable debe estar limpia. Cualquier suciedad puede dañar la superficie tanto de la base calefactable como de la lámina de impresión.
- 🟡 **Fija la lámina alineando primero el recorte trasero con los pasadores de bloqueo de la parte trasera de la base calefactada.** Sujeta la lámina por las dos esquinas delanteras y colócala lentamente sobre la base calefactable - ¡cuidado con los dedos!
- ⬛ Mantén la **lámina de impresión** limpia para un rendimiento óptimo.
- ⬛ #1 cause of prints detaching from the print surface is a greasy print sheet. Use **IPA (Isopropyl alcohol) to degrease it** if you have touched its surface before.
- 🟡 Coloca la junta tórica en el Spoolholder-static.
- 🟡 Empuje el Spoolholder-static en el dock del Puck-universal y fíjalo girándolo en el sentido de las agujas del reloj.

PASO 4 Descarga del firmware

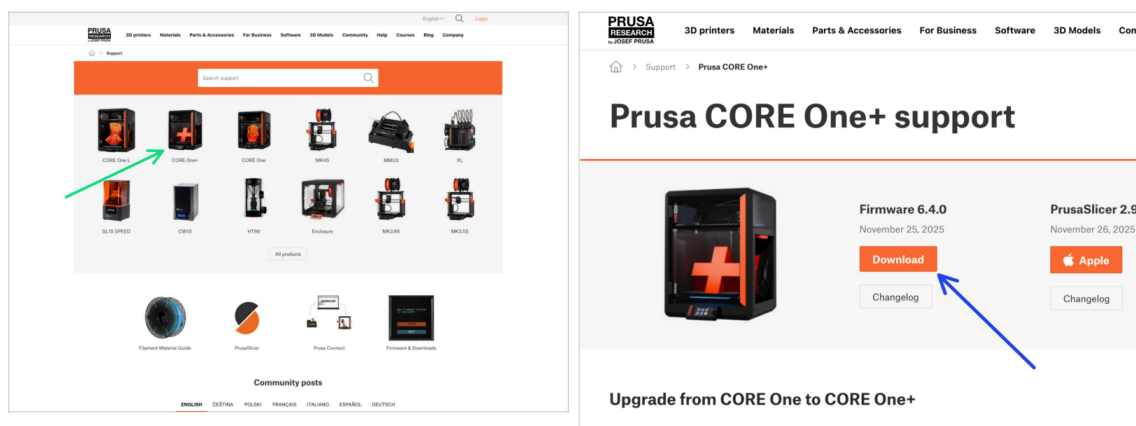


- ⬛ Tendremos que actualizar el firmware.
- 📄 El CORE One+ requiere la versión de firmware **6.4.0 o posterior**.
- 🟡 Visita la **página de ayuda de la Core One+ en Help.Prusa3D.com**.
- 🟡 Download the latest firmware file (.bbf). Save the file onto a USB drive.

PASO 5 Encendiendo la impresora



- ✿ Inserta la unidad USB incluida en tu kit en la impresora.
 - ❗ La unidad USB incluida contiene el archivo de firmware más reciente.
- ✿ Connect the power cable and plug the printer into a wall outlet.
- ✿ Turn the printer on using the switch on the back.
- ❗ The printer will now detect if a new firmware file is available on the USB drive.
- ✿ If the "New firmware available" screen appears, hit **FLASH** by pressing the rotary knob to upgrade to the latest firmware.
 - ✿ If no such message appears, the printer is running the latest firmware already. Proceed to the next step.

PASO 6 Setting up the printer: Intro

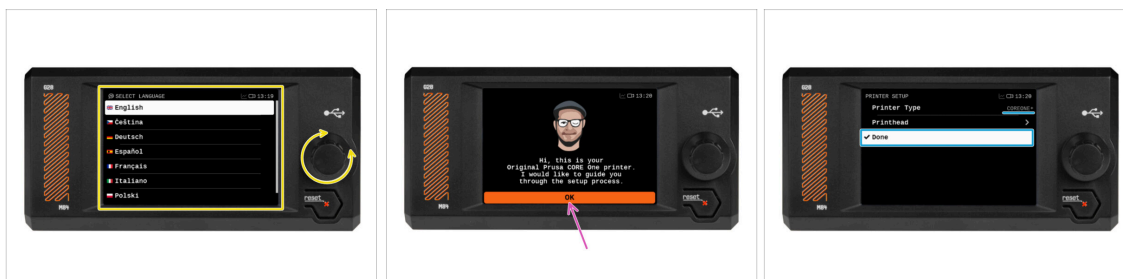

- ✿ La impresora muestra en la pantalla un mensaje para seleccionar el idioma. Utiliza el dial de control o la pantalla táctil para establecer tus preferencias.
- ✿ Tras seleccionar el idioma, la impresora mostrará la pantalla de bienvenida. Pulsa **OK** para continuar con el proceso de configuración.
- ✿ The next screen will prompt you to select your printer model COREONE. Hit **Done** to continue.

PASO 7 Setting up the printer: Network setup




- La pantalla de configuración de red te pedirá que te conectes a una red Wi-Fi utilizando nuestra aplicación móvil oficial Prusa.
- ① Lee más en prusa.io/app.
- If you select **No**, the printer will show alternative ways to connect to Wi-Fi. This step is optional and can be done later.
- ① You can skip this screen and set up the network connection later.

PASO 8 Asistente: Intro



- ① La impresora te pedirá que realices selftests y calibraciones de todos los componentes importantes. El proceso completo dura unos minutos, aunque algunas partes requieren la interacción directa del usuario.
- Pulsa **SÍ** para iniciar el self-test y sigue las instrucciones en pantalla.
- ⚠ **During the self-test, keep the door closed until you are prompted. Opening the door will interrupt the process.**
- **There are HOT and moving parts inside during the self-test.**
- The printer will begin by testing all the fans. **Be aware—it can get quite noisy for a while!**

PASO 9 Wizard: Door Sensor Calibration

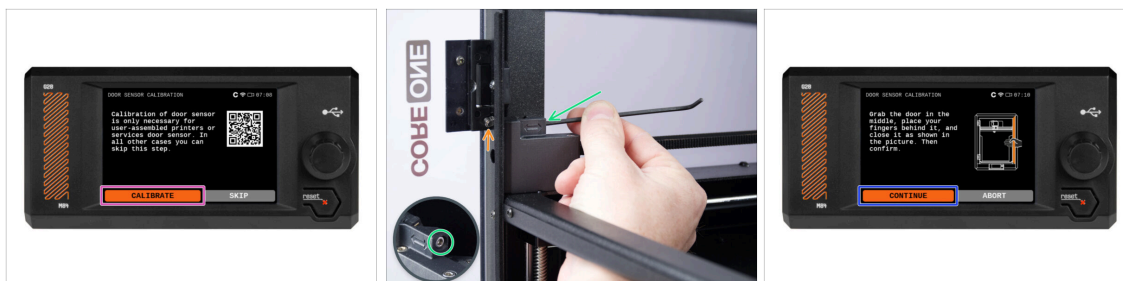


- ◆ La primera parte que requiere su interacción es la calibración del sensor de la puerta. Para empezar, pulsa **Calibrar** y sigue las instrucciones que aparecen en pantalla..
- ◆ Se te pedirá que aprietes gradualmente el tornillo de tensión del sensor desde su posición suelta predeterminada - normalmente en pasos de media vuelta, posiblemente varias veces durante la calibración.
 - ◆ After each adjustment, observe the door sensor switch emerging from the front profile hole.
- ◆ Repeat the procedure until the door sensor is correctly adjusted - meaning it switches at a hand-gap distance. Then hit **Continue**.
- ❗ Once the sensor is properly calibrated, you should hear an audible click from the door sensor area when opening and closing the door.

PASO 10 Asistente: Test Célula de carga



- ◆ El siguiente paso del asistente te pedirá que toques la boquilla para probar y calibrar la **Célula de carga**. Durante este procedimiento, las **partes de la impresora no se calientan**, puede tocar las partes de la impresora. Pulsa **Continuar**.
- ❗ La calibración de la célula de carga requiere que la puerta esté abierta, ya que debe interactuar directamente en el interior de la impresora.
 - ◆ Do not touch the nozzle yet, wait until prompted by the **Tap nozzle NOW** message.
 - ◆ Tap the nozzle from below. In case the Loadcell does not detect the touch, you will be prompted to repeat the step. Otherwise, you will see **Loadcell test passed OK** when it succeeds.
 - ◆ To allow the printer to continue with the Wizard, **close the door**.

PASO 11 Asistente: Alineación de los engranajes

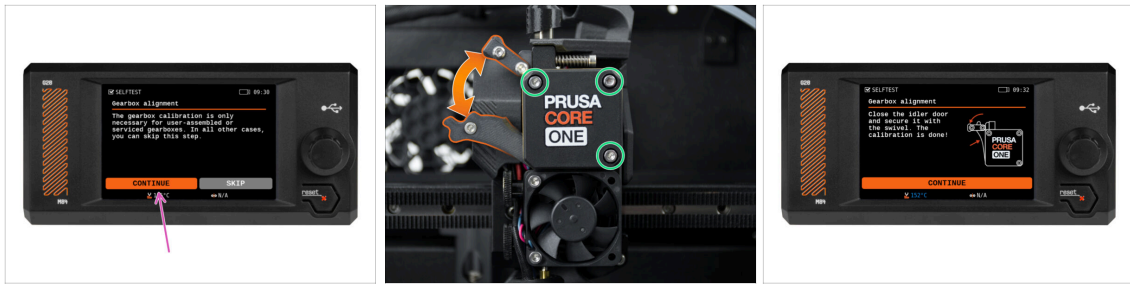


- ✿ Una vez que llegues a la parte de Alineación de la caja de engranajes, selecciona **Continuar** y sigue las instrucciones que aparecen en pantalla.
- ✿ Asegúrate de que el bloqueo del tensor (giratorio) está desbloqueado de la puerta del tensor.
- ✿ Loosen the three screws on the front of the gearbox by 1.5 turns.
- ❗ The printer will go through the automatic gearbox alignment. This process can't be seen from the outside.
- ⬛ Once prompted, tighten the three screws in the pattern indicated on the screen.

PASO 12 Wizard: Filament Sensor Calibration



- ✿ Comprueba el interruptor manual del sensor de filamento. **Asegúrate de que esté en la posición ON.**
- ✿ Durante la calibración del sensor de filamento, tendrás que utilizar un trozo corto de filamento. Prepara el filamento y selecciona **Continuar**. No debe haber filamento en el interior del extrusor antes de iniciar el proceso de calibrado.
- ❗ There should be no filament inside the extruder before the calibration process starts.
- ✿ Place a spool of filament onto the spool holder on the right side of the printer.
- ✿ When prompted, begin inserting the filament into the PTFE tube located beneath the right handle.
- ⬛ Remove the filament after the calibration finishes.

PASO 13 Asistente finalizado

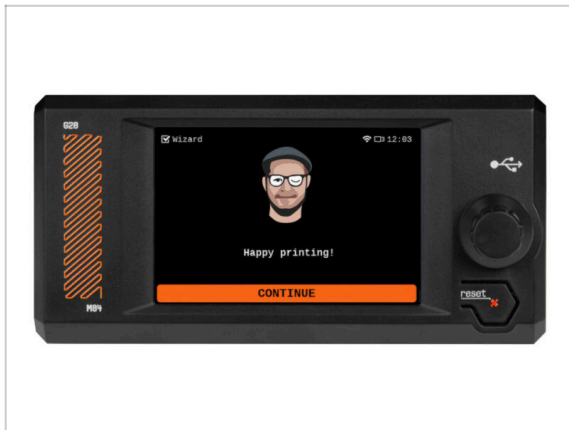


- ¡Felicidades! El Asistente está completo. Ahora es el momento de probar algunas impresiones.

PASO 14 Setting the printer up



- Para habilitar la apertura automática de la rejilla superior, ve a **Ajustes -> Hardware -> Control ventilación cámara** y selecciona la opción **Auto**.

PASO 15 Momento Haribo

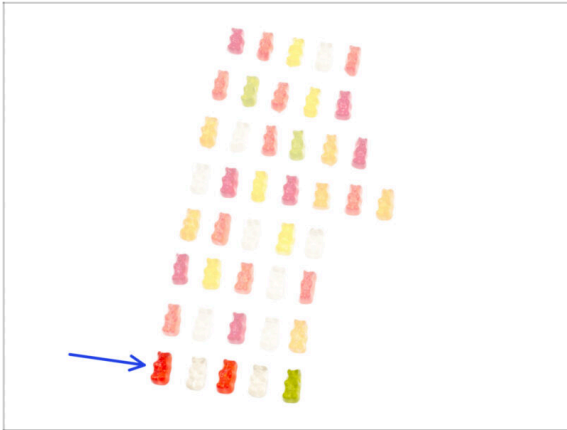


- ¡Victoria sabe a ositos de gominola!
- Disfruta del resto. Te lo has ganado.

PASO 16 Manual



- Lee el **Manual de impresión 3D** dedicado a tu impresora y sigue las instrucciones para configurar la impresora y prepararla para tu primera impresión.
- 📌 La última versión siempre se puede encontrar en help.prusa3d.com.
- ⚠️ **Read the Disclaimer and Safety instructions chapters.**


PASO 17 Actualización de firmware

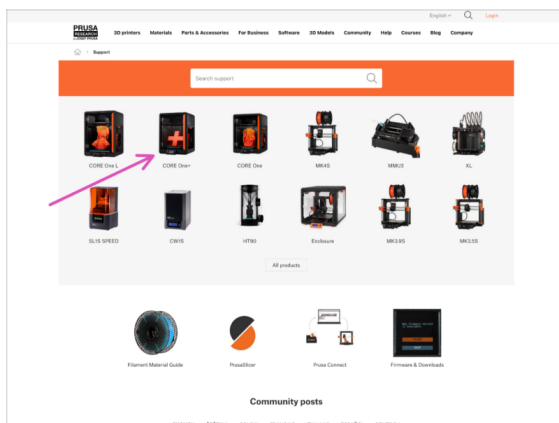

❗ Todas las impresoras incluyen una unidad USB con el firmware más reciente. Sin embargo, se recomienda comprobar y, si es posible, actualizar la versión del firmware cada pocas semanas.

- 🛠 Visita la página help.prusa3d.com.
- 🟡 Visita la página de la Prusa CORE One+.
- 🛠 Save the firmware file (*.bbf*) onto the bundled USB drive.
- 🔵 Conecta la unidad USB a la impresora. A continuación, cuando se te solicite, selecciona la opción FLASH en la pantalla.


PASO 18 Base de conocimientos Prusa

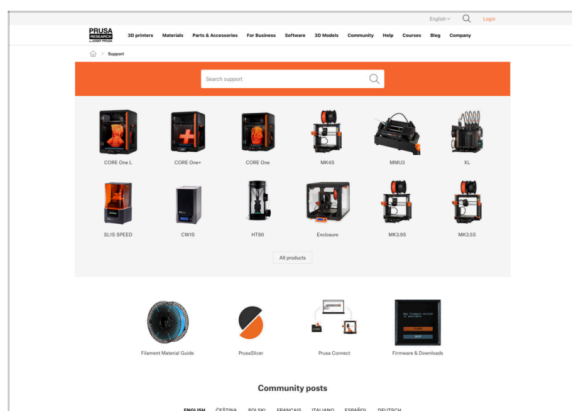

Si te encuentras con algún problema de cualquier tipo, no te olvides que siempre puedes revisar nuestra base de conocimientos en help.prusa3d.com

- 🛠 ¡Añadimos nuevos temas todos los días!

PASO 19 ¡Únete a Printables!

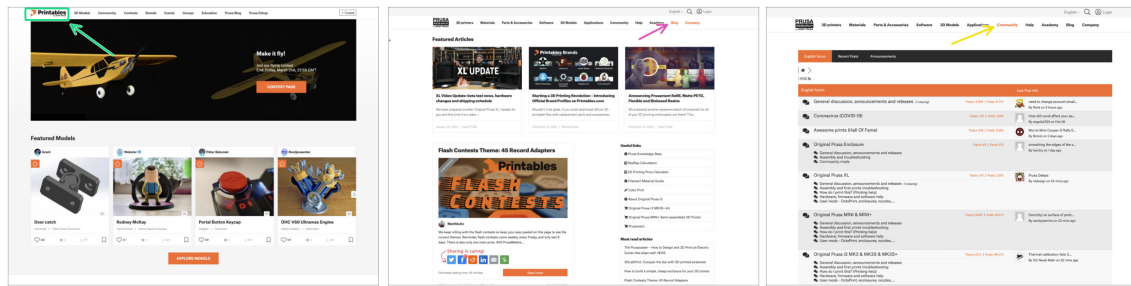

- ¡No olvides unirte a la mayor comunidad de Prusa! Descarga los últimos modelos en STL o código G a la medida de tu impresora. Regístrate en [Printables.com](https://www.prusa3d.com/printables)
- ¿Buscas inspiración en nuevos proyectos? Consulta nuestro blog con actualizaciones semanales.
- If you need help with the build, check out our forum with a great community :-)
- i All Prusa services share one user account.

Lista de cambios del manual



PASO 1 Historial de versiones



- **Versiones del manual del Kit de Conversión a Prusa CORE One+:**
- 11/2025 - Versión inicial 1.00

This image shows a full page of blank, lined paper. It features approximately 20 evenly spaced horizontal grey lines across the entire width of the page, providing a guide for writing. The background is a clean, solid white color. There are no margins, text, or other markings present on the sheet.

This image shows a full page of blank, lined paper. It features approximately 20 evenly spaced horizontal grey lines across the entire width of the page, providing a guide for handwriting or typing. The background is a clean, solid white color.

[illegible]

This image shows a full page of blank, lined paper. It features approximately 20 evenly spaced horizontal grey lines across its entire width, providing a guide for handwriting or typing. The background is a clean, solid white color. There are no margins, text, or other markings present on the page.